District I " 1625 N. French Dr., Hobbs, NM 88240 District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District Politics Road 1220 S. St Francis Dr., Santa Fe, NM 87505

# State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division

1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office.

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

Pit, Closed-Loop System, Below-Grade Tank, or
Proposed Alternative Method Permit or Closure Plan Application
Type of action:  Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method  Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method  Modification to an existing permit  Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
Operators Huntington France, L.I.C., OCPID #, 200706
Operator: Huntington Energy, L.L.C. OGRID #: 208706
Address: 908 N.W. 71st St., Oklahoma City, OK 73116
Facility or well name: Canyon Largo Unit #499
API Number: <u>30-039-30810</u> OCD Permit Number:
U/L or Qtr/QtrLot D, NWNWSection24Township25NRange _7WCounty:Rio Arriba
Center of Proposed Design: Latitude36.38966° N Longitude107.53182° W NAD □ 1927 ☑ 1983
Surface Owner:  Federal  State  Private  Tribal Trust or Indian Allotment
2.
☐ Pit: Subsection F or G of 19.15.17.11 NMAC
Temporary: Drilling Workover
Permanent Emergency Cavitation P&A
☐ Lined ☐ Unlined Liner type: Thickness <u>20</u> mil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
⊠ String-Reinforced
Liner Seams: Welded Factory Other Volume: 7000 bbl Dimensions: L 140' x W 65' x D 10'
3.
Closed-loop System: Subsection H of 19.15.17.11 NMAC
Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent)
Drying Pad Above Ground Steel Tanks Haul-off Bins Other
☐ Lined ☐ Unlined Liner type: Thicknessmil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
intent)  Drying Pad
2 MR 2011
Below-grade tank: Subsection I of 19.15.17.11 NMAC
Below-grade tank: Subsection I of 19.15.17.11 NMAC   Volume:
Tank Construction material:
Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other
Liner type: Thicknessmil
5.  Alternative Method:

Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)  Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church)  Four foot height, four strands of barbed wire evenly spaced between one and four feet  Alternate. Please specify	hospital,
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent puts and permanent open top tanks)  Screen Netting Other  Monthly inspections (If netting or screening is not physically feasible)	
Signs: Subsection C of 19.15.17.11 NMAC  ☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers  ☐ Signed in compliance with 19.15.3.103 NMAC	
Administrative Approvals and Exceptions:  Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.  Please check a box if one or more of the following is requested, if not leave blank:  Administrative approval(s): Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval.  Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	office for
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dryi above-grade tanks associated with a closed-loop system.	oriate district oproval.
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  (Applies to temporary, emergency, or cavitation pits and below-grade tanks)  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	Yes No
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  (Applies to permanent pits)  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No ☐ NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.  - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine.  - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area.  - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	Yes No
Within a 100-year floodplain FEMA map	☐ Yes ☐ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC  Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC  Design Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Treviously Approved Besign (and the copy of design) At Trumber.
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9  Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC  Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC  Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design)  API Number:
Previously Approved Operating and Maintenance Plan API Number: (Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC   Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.   Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC   Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC   Climatological Factors Assessment   Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC   Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC   Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC   Quality Control/Quality Assurance Construction and Installation Plan   Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC   Preeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC   Subsection Control Plan   Diffield Waste Stream Characterization   Monitoring and Inspection Plan   Erosion Control Plan   Erosion Control Plan   Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative
Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.  Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC  Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC  Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)  Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids, facilities are required.							
Disposal Facility Name:	Disposal Facility Permit Number:						
Disposal Facility Name:	Disposal Facility Permit Number:						
Will any of the proposed closed-loop system operations and associated activities o  ☐ Yes (If yes, please provide the information below) ☐ No							
Required for impacted areas which will not be used for future service and operations.  Soil Backfill and Cover Design Specifications based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC  Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC							
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may required an exception which must be submitted to the Santa Fe Environment demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC	re administrative approval from the appropriate dist. al Bureau office for consideration of approval. Justi	rict office or may be					
Ground water is less than 50 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Da	ta obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Da	ta obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Ground water is more than 100 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Da	ta obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other si lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	gnificant watercourse or lakebed, sinkhole, or playa	☐ Yes ☐ No					
Within 300 feet from a permanent residence, school, hospital, institution, or churc - Visual inspection (certification) of the proposed site; Aerial photo; Satelli		☐ Yes ☐ No					
Within 500 horizontal feet of a private, domestic fresh water well or spring that le watering purposes, or within 1000 horizontal feet of any other fresh water well or - NM Office of the State Engineer - iWATERS database; Visual inspection	spring, in existence at the time of initial application.	☐ Yes ☐ No					
Within incorporated municipal boundaries or within a defined municipal fresh wa adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written appro	·	☐ Yes ☐ No					
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visu	nal inspection (certification) of the proposed site	☐ Yes ☐ No					
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Minin	g and Mineral Division	☐ Yes ☐ No					
<ul> <li>Within an unstable area.</li> <li>Engineering measures incorporated into the design; NM Bureau of Geolog Society; Topographic map</li> </ul>	gy & Mineral Resources, USGS; NM Geological	☐ Yes ☐ No					
Within a 100-year floodplain FEMA map		☐ Yes ☐ No					
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached.  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Construction/Design Plan of Temporary Pit (for in-place burial of a drying Protocols and Procedures - based upon the appropriate requirements of 19.1 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	quirements of 19.15.17.10 NMAC of Subsection F of 19.15.17.13 NMAC oppropriate requirements of 19.15.17.11 NMAC pad) - based upon the appropriate requirements of 19. 5.17.13 NMAC quirements of Subsection F of 19.15.17 13 NMAC of Subsection F of 19.15.17.13 NMAC drill cuttings or in case on-site closure standards cann H of 19.15.17.13 NMAC of 10 of 19.15.17.13 NMAC	15 17.11 NMAC					

Page 4 of 5

Operator Application Certification:  I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief.
Name (Print): Title:
Signature: Date:
e-mail address: Telephone:
OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment)  OCD Representative Signature:  Approval Date: 2/9/201  Title: OCD Permit Number:
21.  Closure Report (required within 60 days of closure completion): Subsection K of 19.15.17.13 NMAC  Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report.  The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed.  □ Closure Completion Date:7/16/11
22. Closure Method:  ☐ Waste Excavation and Removal ☑ On-Site Closure Method ☐ Alternative Closure Method ☐ Waste Removal (Closed-loop systems only) ☐ If different from approved plan, please explain.
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized.  Disposal Facility Name:  Disposal Facility Permit Number:  Disposal Facility Name.  Disposal Facility Permit Number:  Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations?  Yes (If yes, please demonstrate compliance to the items below)  No  Required for impacted areas which will not be used for future service and operations:  Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Technique
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude36.38947° N Longitude107.53185° W NAD:1927 \overline{\text{MAD}} 1983
Operator Closure Certification:  I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.  Name (Print):Catherine Smith

Two Copies	riate Distr	et Office						rm C-105									
	French Dr., Hobbs, NM 88240				Energy, Minerals and Natural Resources					July 17, 2008  1. WELL API NO.							
District II 1301 W Grand Av	District II 1301 W Grand Avenue, Artesia, NM 88210 Oil Conservation Division							30-039-30810									
District III 1000 Rio Brazos Rd , Aztec, NM 87410						20 South S						2. Type of Lease					
District IV 1220 S St Francis			:05		12.	Santa Fe, N				<b>71.</b>		STA  3. State Oil &		Lease N		FED/IND SF 078879	IAN
				PECC	MDI	ETION RE				NIG							***
4 Reason for fil		LLIIO	VOI	NECC	JIVII L	LIIONIL	1 01	1170	٧L	7 200	$\dashv$	5 Lease Nam	e or U	Jnit Agre	ement	Name	
COMPLET	ION DE	BODT (C:U	in harras	#1 thmos	ab #21	for Ctata and Car	11	لاملسم				Canyon Largo	Unit				
☐ COMPLET		•						• •				<ol> <li>Well Numb</li> <li>499</li> </ol>	er:				
#33, attach this a	nd the pla										/or		•				
7. Type of Comp		T WORK	OVER [	] DEEPI	ENING	□PLUGBACI	κП	DIFFER	EN	NT RESERV	OIR	OTHER					
8. Name of Oper	ator		J VISIC _	, , , ,	31 111 10		<u> </u>	DITTE	-				2087	06			
Huntington Energian 10. Address of O		<u>.                                    </u>										11 Pool name	or W	ildcat			
908 N W. 71 <sup>st</sup> St		ma City, Ol	K 73116														
12.Location	Unit Ltı	Secti	on	Towns	hip	Range	Lot			Feet from t	he	N/S Line	Feet	from th	e E/V	V Line	County
Surface:																	
вн:																	
13. Date Spudded	d   14 E	Pate T D. R	eached	15. I 3/14		g Released		1	6	Date Compl	leted	(Ready to Prod	luce)		17. Elev RT, GR	,	and RKB,
18 Total Measur	ed Depth	of Well		19 I	lug Bac	ck Measured Dep	oth	2	20.	Was Direct	iona	l Survey Made?	)	21. Ty	pe Elec	ctric and O	ther Logs Run
22. Producing Int	terval(s),	of this com	pletion -	Top, Bot	tom, Na	ame								1		· · · · · · · · · · · · · · · · · · ·	
23.				-	CAS	ING REC	OR	D (Re	DO	ort all str	ring	s set in w	ell)				
CASING SI	ZE	WEIC	HT LB./	FT		DEPTH SET				LE SIZE		CEMENTIN		CORD		AMOUNT	PULLED
										*****							
					_												
24.	Laco		l no	PEO L	LIN	ER RECORD	EN ITO	Loope			25.			NG REC			co ora
SIZE	TOP		BO	ГТОМ		SACKS CEM	ENI	SCRE	EN		SIZ	.E	Di	EPTH SE	<u> </u>	PACK	ER SET
	1												1				
26. Perforation	record (i	nterval, siz	e, and nu	mber)							FRA	ACTURE, CE					
	ar <sup>a</sup>							DEPT	H 1	INTERVAL		AMOUNT A	ND K	IND M	ATERL	AL USED	
,	"Red								_								
														·			
28.		·								TION		<b>.</b>					
Date First Produc	tion		Product	ion Met	nod <i>(Fla</i>	owing, gas lıft, pi	umpin	ig - Size d	and	d type pump)	)	Well Status	(Pro	d or Shu	t-in)		
Date of Test	Hour	s Tested	Che	oke Size		Prod'n For Test Period		Oil - B	Bbl	·	Gas	s - MCF	ı W	ater - Bb	l	Gas - C	Dil Ratio
Flow Tubing Press.	Casir	ng Pressure		culated 2 ur Rate	24-	Oil - Bbl.		Ga 	as -	- MCF	1	Water - Bbl.		Oil G	avity -	API - (Cor	r.)
29. Disposition o	f Gas (So	ld, used for	·fuel, ven	ted, etc.)		<u>l</u>					上		30. 1	Test Witr	essed I	Ву	
31. List Attachme	ents									<del></del>							
32 If a temporary	y pit was	used at the	well, atta	ch a plat	with th	e location of the	tempo	orary pit.							<del></del>		
33. If an on-site b	-			-			-										
						Latitude						Longitude				NA	D 1927 1983
I hereby certi	fy that i	he inforn	ngtjon s	hown c	on both	h sides of this	forn	ı is true	e c	and compl	ete	to the best o	f my	knowle	edge a	ınd beliej	r
Signature (	ethei	ine	Smith	<b>~</b>		Printed Name Cather	rine S	Smith		Title F	Regi	ulatory		Date	July	25, 2011	
E-mail Addre					com												

DISTRICT I P.O. Box 1980, Hobbs, N.M. 88241-1980 State of New Mexico Energy, Minerals & Natural Resources Department

DISTRICT II 1301 W. Grand Avenue, Artesia, N.M. 88210

DISTRICT III 1000 Rio Brazos Rd., Aztec, N.M. 87410

DISTRICT IV 1220 South St. Francis Dr., Santa Fe, NM 87505 OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87504-2088 Form C-102
Revised October 12, 2005
Instructions on back
Submit to Appropriate District Office
State Lease - 4 Copies
Fee Lease - 3 Copies

☐ AMENDED REPORT


AUNTINGTON ENERGY, LLC    Surface Location				WELL I			CREAGE DED					
32660  CANYON LARGO UNIT  10 CRID No.  10 CANYON ENERGY, LLC  10 Surface Location  Or let no.  11 Bottom Hole  12 Location II Different From Surface  or let no.  12 John or John of Section Township Range Lot Idn  13 Bottom Hole Location II Different From Surface  or let no.  14 John or Jufface  15 John or Jufface  16 John or Jufface  17 John of Section Township Range Lot Idn  18 West from the North/South line Feet from the Rest/West line Count, or let no.  19 John or Jufface  10 ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLI OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  3 1/4" BC.  2 S 87*43" 4" E JOHN OF SURFACE LOCATION LAT: 36:35947" N. (NAD 83) LONG: 107:537185" W. (NAD 27) LAT: 10731'52.4876" W. (NAD 27)  3 1/4" BC.  4 SURFACE LOCATION LAT: 36:2322.0642" N. (NAD 27) LAT: 10731'52.4876" W. (NAD 27) LAT: 1073	'API Nu	umber							-			
*** ORBID No. 208706 HUNTINGTON ENERGY, LLC 6870**  *** HUNTINGTON ENERGY, LLC 6870**  *** HUNTINGTON ENERGY, LLC 6870**  *** Do 24 25-N 7-W 1160 idn Peet from the North/South line Peet from the Best/West line Count, North B90 WEST RIC. 1160 NORTH B90 NORTH B90 WEST RIC. 1160 NORTH B90 WEST RIC.	Property Code	e		<del></del> _		*Property	Name			ь Ж	ell Number	
HUNTINGTON ENERGY, LLC    Surface Location	32660		-			CANYON LA	RGO UNIT		499			
or lot no. Section   Township   Range   Lot lain   Feet from the   North/South line   Seet from the   Best/West line   Count,						•			1	9	Elevation	
or lot no. Sertion Formship Range Let Jan Peet from the North/South line Boo WEST RIO  11 Bottom Hole Location If Different From Surface  12 Bottom Hole Location If Different From Surface  13 Joint or Juffin Peet from the Rest/West line Count, North/South line Feet from the Rest/West line Feet fr	208706				H	JNTINGTON EN	ERGY, LLC	·····			6870'	
D 24 25-N 7-W 1160 NORTH 890 WEST RIO  11 Bottom Hole Location If Different From Surface or lot no. Section Township Range Lot Idn Peet from the North/South line Feet from the East/West line Count, addicated Acres W-320  10 ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLI OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  3 1/4* 8C. S 87*43*47" E 2599.75' (M)  10 S 87*43*47" E 2599.75' (M)						10 Surface	Location					
The bottom Hole Location If Different From Surface or let no. Section Township Range Lot lân Feet from the North/South line Feet from the Bast/West line Count discated Acres W-320  In Allowable Will Be Assigned To This Completion Until All Interests Have Been Consolidation Code  Allowable Will Be Assigned To This Completion Until All Interests Have Been Consolidation Code Been Approved By The Division  Allowable Will Be Assigned To This Completion Until All Interests Have Been Consolidation Code Been Approved By The Division  Allowable Will Be Assigned To This Completion Until All Interests the East of the Interest of Interest	1		1	_	Lot Idn	ł			·	line	County	
adicated Acres W-320  O ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLION OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  S 87-43'47" E 2599.75' (M)  SURFACE LOCATION LAT: 36.35947' N. (NAD 83) LONG: 107.53'185' W. (NAD 83) LONG: 107.53'185' W. (NAD 27) LAT: 107.31'52.4876" W. (NAD 27) LAT: 107.31'52.4876" W. (NAD 27)  S 1/4" BC.  S 1/4" BC.  SURFACE LOCATION LAT: 36.35947' N. (NAD 27) LAT: 107.31'52.4876" W. (NA	D	24	25-N		<u> </u>	<u> </u>	NORTH	890	WEST		RIO ARRIBA	
adicated Acres  W-320  O ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLID OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  JA'S BC.  S 87'43'47" E 2599.75' (M)  SUFFACE LOCATION LAT: 36.38947" N. (NAD 83) LONG: 107.33185" W. (NAD 83) LAT: 36.323'22.0642" N. (NAD 83) LAT: 36'23'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  18 SURVEYOR CERTIFICA  Thereby crifty that the surfamention scortain is frue and comprehend sompathary positing order hareigner entered at the surfamential surfament and a mineral or angular proposed between the proposed between hele location compatible and the surfamential in the surfam				11 Botte	om Hole							
W-320  O ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIOR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  3 1/4" BC. 5 B.L.M. 5 S 8743'4" E 2599.75' (M)  SURFACE LOCATION LAT: 56.38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LONG: 107.53185' W. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  3 1/4" BC. 4 SELM.  24  18 SURVEYOR CERTIFICA J hereby certify that the well toustien shows me or under my supervision, and that the sent may supervision may supervision, and that the sent may supervision may supervision and that the sent may supervision may supervision.  24  18 SURVEYOR CERTIFICA J hereby certify that the well toustien shows me or under my supervision, and that the sent may supervision may supervision and that the sent may supervision may supervision.  24  18 SURVEYOR CERTIFICA J hereby certify that the well toustien shows me or under my supervision.  3 1/4" BC. 4 18 SURVEYOR CERTIFICA J hereby certify that the unit location shows me or under my supervision.  3 1/4" BC. 4 18 SURVEYOR CERTIFICA J hereby certify that the unit location shows me or under my supervision.  3 1/4" BC. 5 BLM. 5 18 SURVEYOR CERTIFICA J hereby certify that the unit location shows me or under my supervision.  3 1/4" BC. 5 BLM. 5 18 SURVEYOR CERTIFICA J hereby certify that the unit location shows me or under my supervision.  3 1/4" BC. 5 BLM. 5 18 SURVEYOR CERTIFICA J hereby certify that the unit location shows me or under my supervision.  3 1/4" BC. 5 BLM. 5 19 SURVEYOR CERTIFICA J hereby certify that the unit location shows me or under my supervision.  3 1/4" BC. 5 BLM. 5 19 SURVEYOR CERTIFICA J hereby certify that the survey me or under my supervision.  4 18 SURVEYOR CERTIFICA J hereby certify that the survey me or under my supervision.  5 BLM. 5 10 SURFACE LOCATION LAT: 107'31'52.4876' W. (NAD 27) LONG: 107'52.4876' W. (NAD 27) LONG: 107'5	L or lot no. S	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West	line	County	
W-320  O ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIOR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  3 1/4" BC. 5 B.L.M.  S 8743'47" E 2599.75' (M)  SURFACE LOCATION LAT: 56.38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LONG: 107.53185' W. (NAD 27) LAT: 10731'52.4876" W. (NAD 27) LAT: 10731'52.4876" W. (NAD 27)  3 1/4" BC. 3 1/4" BC	Dedicated Acres			13 Joint or	lnfill	14 Consolidation	Code	<sup>16</sup> Order No.				
O ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIOR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  3 1/4* BC.  5 B.L.M.  5 B.Y.43*47" E 2599.75' (M)  FD. 3 1/4* BC.  1985 B.L.M.  FD. 3 1/4* BC.  1985 B.L.M.  17  OPERATOR CERTIFIC.  1 larely certify that the information centain interest or unlessed mineral interest in the interest of the least of my least of the												
OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION  3 1/4" BC. 5 B.L.M.  S 87-43'47" E 2599.75' (M)  PD 3 1/4" BC. 1965 B.L.M.  SURFACE LOCATION LAT: 36.38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LAT: 3673'22.2642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  3 1/4" BC.  3 1/4" BC.  SURFACE LOCATION LAT: 3673'22.2642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  Beta Catherine Smith  Printed Name  24  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  Beta Catherine Smith  Printed from field notes of actual surveys was pletted from field notes of actual surveys on runder my supervision, and that the sur nond correct to the best of my knowledge and by the surveys of									· · · · · · · · · · · · · · · · · · ·			
S 87'43'47" E 5 B.L.M.  S 87'43'47" E 1985 B.L.M.  S 1/4" BC.  S 1/4" BC	40 ALLOWAB	BLE W								N CO	NSOLIDATE:	
S B7-43-47" E 2599.75' (M)  S BLM.  S B7-43-47" E 2599.75' (M)  S BLM.  S B7-43-47" E 2599.75' (M)  S BLM.  S BR-43-47" E 2599.75' (M)  S BLM.  S Thereby certify that the infermation contain to belief, and that this organization related to the including the proposed bottom hole location, entirely that the unlessed mineral interest in the including the proposed bottom hole location, entirely that the unlessed mineral or a woluntary positing order hareignes entered to the strength of a woluntary positing agreement contribution.  SURFACE LOCATION  LAT: 36.28947' N. (NAD 83)  LAT: 36.23'22.0642" N. (NAD 27)  LAT: 107.31'52.4876" W. (NAD 27)  LAT: 107.31'52.4876" W. (NAD 27)  LAT: 107.31'52.4876" W. (NAD 27)  S BLM.  S SURVEYOR CERTIFICA  I hereby certify that the uell location shows one or under my supervision, and that the same and correct to the best of my knowledge and belief, and the strength of t	//		//_		/		LEN APPROVED		121014			
SURFACE LOCATION LAT: 36.38947* N. (NAD 83) LONG: 107.53185* W. (NAD 83) LAT: 36'32'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  18 SURVEYOR CERTIFICA  19 SURVEYOR CERTIFICA  10 SURVEYOR CERTIFICA  10 SURVEYOR CERTIFICA  11 SURVEYOR CERTIFICA  12 SURVEYOR CERTIFICA  13 LAT: 36'33'42' N. (NAD 27) LAT: 36'34' BC.  3 1/4" BC.  3 1/4" BC.  3 1/4" BC.  4 SURVEYOR CERTIFICA  1 In revely certify that the well to state or multivated mineral	3 1/4" BC.	ľ							PERATOR	CER	TIFICATION	
belief, and that organization either own interest or unleased mineral interest in the including the proposed bottom hole location, oright to drill this well at this location pursus controct with an owner of such a mineral or interest, or to a columnary pooling order hereigine entered it distinct.  SURFACE LOCATION LAT: 36:38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LAT: 36:38947' N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  18 SURVEYOR CERTIFICA  J hereby certify that the well location shows o was plotted from field roles of actual surveys me or under my supervision, and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and correct to the best of my knowledge and by the supervision and that the sam and the supervision and the supervisi	DO B.L.M.		2599.7	o* (M)	1			I hereby cer	tify that the in	ıformatio	n contained hereir	
SURFACE LOCATION LAT: 36.38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LAT: 36'23'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  19 hereby certify that the well location shows a was plotted from field notes of actual curveyor me or under my supervision, and that the sur and correct to the best of my knowledge and by the surveyor of the surveyor of the best of my knowledge and by the surveyor of the survey	,00				<i>)</i>			is true and	complete to the	e best of	my knowledge an	
SURFACE LOCATION LAT: 36.38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LAT: 36'23'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  18 SURVEYOR CERTIFICA  19 hereby certify that the well location shows a was plotted from field notes of actual curveyor me or under my supervision, and that the sur and correct to the best of my knowledge and by the surveyor of the surveyor of the best of my knowledge and by the surveyor of the survey	12				1			interest or	unleased minera	ıl interes	d in the land	
SURFACE LOCATION LAT: 36:38947' N. (NAD 83) LONG: 107.53185' W. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  24  18 SURVEYOR CERTIFICA Thereby certify that the well location shown o was plotted from field notes of actual surveys me or under my supervision, and that the sam and correct to the best of my knowledge and by the property of	-							including th	e proposed botto	om hale	location or has a	
SURFACE LOCATION LAT: 36.38947' N. (NAD 83) LONG: 107.53185' W. (NAD 83) LAT: 36'23'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  BEL.M.  24  18 SURVEYOR CERTIFICA Was plotted from field notes of actual surveys me or under my supervision, and that the sor and correct to the best of my knowledge and be supervision. The surveys of the surveys me or under my supervision, and that the sor and correct to the best of my knowledge and be supervision. The surveys of the surveys me or under my supervision, and that the sor and correct to the best of my knowledge and be supervision. The surveys of th					1	ĺ		contract wit	han owner of	such a 1	nineral or working	
SURFACE LOCATION LAT: 36.38947' N. (NAD 83) LONG: 107.55185' W. (NAD 83) LAT: 36'23'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  24  18 SURVEYOR CERTIFICA I hereby certify that the uell tention shown a uses pletted from field notes of actual surveys me or under my supervision, and that the sam and correct to the best of my knowledge and the surveys of th	800,					:		compulsory	to a voluntary : pooling order he	pooling d eretojore	igreement or a entered by the	
LAT: 36.38947° N. (NAD 83) LONG: 107.53185° W. (NAD 83) LAT: 36.23'22.0642" N. (NAD 27) LAT: 107'31'52.4876" W. (NAD 27)  18 SURVEYOR CERTIFICA J hereby certify that the well location shown a was plotted from field notes of cardual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b  18 SURVEYOR CERTIFICA J hereby certify that the well location shown a was plotted from field notes of cardual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b  18 SURVEYOR CERTIFICA J hereby certify that the well location shown a was plotted from field notes of cardual surveys and correct to the best of my knowledge and b  18 SURVEYOR CERTIFICA J hereby certify that the well location shown a was plotted from field notes of cardual surveys and correct to the best of my knowledge and b				<del></del>	1			division.				
18 SURVEYOR CERTIFICA  I hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b  NEA 15, 2009  Date of drys  Signature and Sand of Correct  OFESSIONAL Line  18 SURVEYOR CERTIFICA  1 hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b								$   \cap a$	0.	.0		
18 SURVEYOR CERTIFICA  I hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b  NEA 15, 2009  Date of drys  Signature and Sand of Correct  OFESSIONAL Line  18 SURVEYOR CERTIFICA  1 hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b	₹		LAT: 3	6.38947	' N. (NAD	83)		1 / Ha		H	8/10/09	
18 SURVEYOR CERTIFICA  I hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b  NEA 15, 2009  Date of drys  Signature and Sand of Correct  OFESSIONAL Line  18 SURVEYOR CERTIFICA  1 hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b	<del>.4-</del>	-						Signature	ene sorre			
18 SURVEYOR CERTIFICA  I hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b  NEA 15, 2009  Date of drys  Signature and Sand of Correct  OFESSIONAL Line  18 SURVEYOR CERTIFICA  1 hereby certify that the well location shown a was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and b	r		LA1: 3	0 23 22.0 07:31 <sup>3</sup> 52	7042 N. 4876" W	(NAD 27)		Cath	erine S	Smit!		
18 SURVEYOR CERTIFICA  I hereby certify that the well location shown of was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and be not sand of the legislation of	259		, 511. 1	0,0,02	. 10,0 m.	(147.15 27)		Printed 1	Vame			
J hereby certify that the well location shown of was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and by Signature and Sant office should be survey of Signature and Sant office should be should	. V				1				•			
J hereby certify that the well location shown of was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and by Date of bury Rose and Surveyor Signature and Sant of Screen and Surveyor Rose and Surveyor Ros	3 1/4" BC		·····		24			18 S[]	RVEYOR	CER	PIFICATION	
was plotted from field notes of actual surveys me or under my supervision, and that the san and correct to the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the best of my knowledge and by the supervision of the supervision of the best of my knowledge and by the supervision of th	5 B.L.M.				1	.		11				
Date of Survey Signature and Series of Microscopic Surveyors  Signature and Series of Microscopic Surveyors  **Offs Sional Will  **Residual Surveyors  **R								was plotted f	rom field notes	of actua	l surveys made by	
Date of Shryest Signature and Sarti of Michael Shryeston at Shryeston					1							
Date of Shryest Signature and Sarti of Michael Shryeston at Shryeston					,				IIINEA 15	200	20	
18894 LUNG TOPESSIONAL LINE 8894					1	. ]		Date of So	18 A A A A A A A A A A A A A A A A A A A	<del>***</del>		
18894 LUNG TOPESSIONAL LINE 8894					1,			Signature	ma Soul oME	cessonal	Syrveyor:	
8894					И				1 1	''() \		
8894					1	1		\ \ / >>	/ <sup>e</sup> / \ . \	101	1)	
8894								NE GA	(A889A)	No.	五	
8894					1			A STATE OF THE PARTY OF THE PAR	(889A)	lin		
8894									1889A 1-0	Jul 9		
\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \								The state of the s	1889A 1-0	Jul 9	To Silva	
Certificate Number								A STATE OF THE STA	8894 1-C	Jul 9	THE STATE OF THE S	

# **HUNTINGTON ENERGY, LLC**

CANYON LARGO UNIT No. 499, 1160 FNL 890 FWL

SECTION 24, T-25-N, R-7-W. N.M.P.M., RIO ARRIBA COUNTY, NEW MEXICO GROUND ELEVATION: 6870', DATE: JUNE 15, 2009

NAD 83 LAT. = 36.38947° N. LONG. = 107.53185° W. NAD 27 LAT. = 36°23'22.0642" N. LONG. = 107°31'52:4876" W.

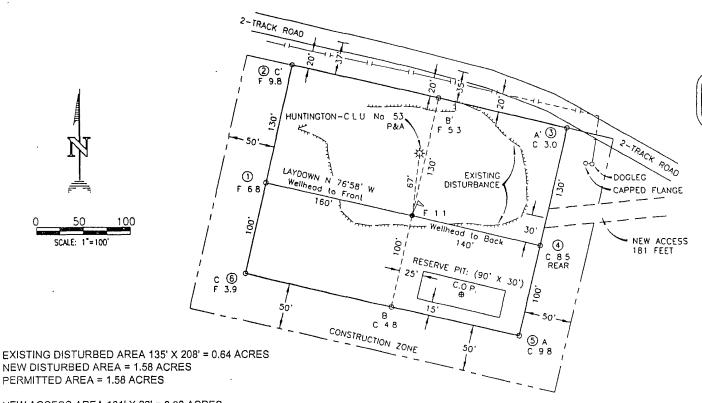

CENTER OF PIT

NAD 83 LAT. = 36.38966° N. LONG. = 107.53182° W. NAD 27 LAT. = 36'23'21.2346" N. LONG. = 107'31'51.8464" W.

NEW ACCESS AREA 181' X 20' = 0.08 ACRES SOIL STORAGE = 0.98 ACRES (SPOIL = 0.00 / TOP SOIL = 0.00 / CONSTRUCTION ZONE = 0.98)

TOTAL PERMITTED AREA = 2.00 ACRES

### NOTES:

- 1) ESTIMATED VOLUMES CALCULATED BY AVERAGE END AREA AT CROSS SECTION SHOWN.
- 2) RESERVE PIT DIKE: TO BE 8' ABOVE DEEP SIDE (OVERFLOW 3' WIDE AND 1' ABOVE SHALLOW SIDE). BLOW PIT: OVERFLOW PIPE HALFWAY BETWEEN TOP AND BOTTOM AND TO EXTEND OVER PLASTIC LINER AND INTO BLOW PIT.

### NOTE:

DAGGETT ENTERPRISES, INC. IS NOT LIABLE FOR UNDERGROUND UTILITIES OR PIPELINES. CONTRACTOR SHOULD CALL UTILITY NOTIFICATION CENTER OF NEW MEXICO TO BE NOTIFIED 48 HOURS PRIOR TO EXCAVATION OR CONSTRUCTION

REVISION	DATE	REVISED BY:
ADDED CONSTRUCTION ZONE	07/31/09	GV
LOCATION RESTAKE	06/23/09	BK.
CORRECTED LAT /LONG.	06/01/09	G.V
ADD C O P./FORMAT CHANGE	08/04/08	B.K.



Daggett Enterprises, Inc.
Surveying and OII Field Services
P. O. Box 510 Formington, NM 87499
Phone (505) 326–1772 Fox (505) 326–6019

NEW MEXICO LS. 8894

DRAWN BY. G.V. | CADFILE HTG083\_PLB

# **Cathy Smith**

From: Cath

Cathy Smith

Sent:

Thursday, April 21, 2011 12:31 PM

To:

'Powell, Brandon, EMNRD'; 'mark\_kelly@nm.blm.gov'

ing to the control of the first for the control of the spherical property of the property of the control of the

Cc:

Alan McNally; David Morales

Subject: Notice of Pit Closure - CLU 499

Notice of Pit Closure per NMOCD pit rule:

Canyon Largo Unit #499
API#: 30-039-30810
Lease # NMSF 078879
NWNW Lot D, 1160' FNL & 890' FWL
Sec 24-25N-7W
Rio Arriba County, NM

Thank you.
Cathy Smith
Huntington Energy, L.L.C.
908 N.W. 71<sup>st</sup> St.
Oklahoma City, OK 73116

(405) 840-9876 ext. 129

Rig Release: 3/14/11

Huntington Energy, L.L.C. Canyon Largo Unit #499 Sec 24, T25N-R7W Rio Arriba Co., NM

### Soil Backfilling and Cover Installation

Upon completion of solidification and testing standards being passed (see attached test results) a minimum of 4 ft of cover is achieved including a suitable layer of material to establish vegetation at the site. All re-contouring of location will match fit shape, line, and texture of the surrounding area.

# Re-Vegetation and Seeding Technique

Seeding shall commence on or about April 1<sup>st</sup>, or the first available growing season barring weather. BLM stipulated seed mixes will be used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover consisting of at least three native plant species, including at least one grass, and maintain that cover through two successive growing seasons. Repeated seeding or planting will be continued until successful growth occurs.

# Temporary Pit Marker

A steel marker will be placed at the center of the on-site burial. The steel marker will not be less than 4" in diameter and be cemented in a 3' hole. Marker shall extend 4' above ground level. Engraved into the marker will be the operator's name, and legal location. This marker shall not be removed. Note: during active operations, a ground level marker will be employed due to safety concerns; upon abandonment, the 4" x 4' marker will be employed.

## **Disposal Facility**

Facility Name: IEI Permit #: NM-010010B



# EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Huntington Energy	Project #:	06111-0002
Sample ID:	Drill Pit Closure	Date Reported:	04-15-11
Laboratory Number:	57900	Date Sampled:	04-14-11
Chain of Custody No:	11566	Date Received:	04-14-11
Sample Matrix:	Soil	Date Extracted:	04-14-11
Preservative:		Date Analyzed:	04-15-11
Condition:	In Plastic Bottle	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

**CLU 499** 

Analyst //

5796 US Highway 64, Farmington, NM 87401

Review

Ph (505)632-0615 Fx (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



# **EPA Method 8015 Modified** Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

# **Quality Assurance Report**

· · · · · · · · · · · · · · · · · · ·					
Client:	QA/QC		Project #:		N/A
Sample ID:	04-15-11 QA/Q	С	Date Reported:		04-15-11
Laboratory Number:	57900		Date Sampled:		N/A
Sample Matrix:	Methylene Chlorid	de	Date Received:		N/A
Preservative:	N/A		Date Analyzed:		04-15-11
Condition:	N/A		Analysis Request	ted:	TPH
JANEST WEST OF STREET	I-Cal Date	l-Cal RF:	C-Cal RF:	% Difference	Accept Range
Gasoline Range C5 - C10	04-15-11	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Diesel Range C10 - C28	04-15-11	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Blank Conc. (mg/L:- mg/Kg	)	Concentration		Detection Limi	ţ
Gasoline Range C5 - C10		ND		0.2	
Diesel Range C10 - C28		ND		0.1	
Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Accept. Range	1
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%	
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%	
Spike Conc. (mg/Kg)	Sample	`Spike Added	Spike Result	% Recovery	Accept Range
				4000/	TT 4050/
Gasoline Range C5 - C10	ND	250	250	100%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 57900-57903

Review

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



# EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

		· ·	
Client:	Huntington Energy	Project #:	06111-0002
Sample ID:	Drill Pit Closure	Date Reported:	04-15-11
Laboratory Number:	57900	Date Sampled:	04-14-11
Chain of Custody:	11566	Date Received:	04-14-11
Sample Matrix:	Soil	Date Analyzed:	04-15-11
Preservative:		Date Extracted:	04-14-11
Condition:	In Plastic Bottle	Analysis Requested:	BTEX
•		Dilution:	10

	Concentration	Det. Limit	
Parameter	(ug/Kg)	(ug/Kg)	

Benzene	5.4	0.9
Delizerie	3,4	0.9
Toluene	45.6	1.0
Ethylbenzene	6.1	1.0
p,m-Xylene	91.6	1.2
o-Xylene	12.0	0.9
Total BTEX	161	

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	112 %
	1,4-difluorobenzene	114 %
	Bromochlorobenzene	103 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

**CLU 499** 

Analyst

Review



# EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A		Project #:	N/A		
Sample ID:	0415BBLK QA/Q0	;	Date Reported:	04-1	15-11	
Laboratory Number:	57901		Date Sampled:	N/A	i	
Sample Matrix:	Soil		Date Received:	N/A	•	
Preservative:	N/A		Date Analyzed:	04-15-11		
Condition:	N/A		Analysis:	BTE	ΞX	
			Dilution:	10		
Calibration and	LCal RF	C-Cal RF:	%Diff.	Blank	સ્ત્ર⊲ Detect.∀ હું ક્ષ્મ	
Detection Limits (ug/L)		Accept Rang	je 0 - 15%	Conc	Limit	
	3.2966E+006	Accept: Rang 3.3033E+006	0 <u>₹ 15%</u> 0.2%	5.23.44	Limit 0.1	
Benzene	3.2966E+006 1.0125E+006	printing of the state of the st	The second district of the second	Conc	harrist (200° detaile and de la comi	
Benzene Toluene		3.3033E+006	0.2%	Conc	0.1	
Detection Limits (ug/L) Benzene Toluene Ethylbenzene p,m-Xylene	1.0125E+006	3.3033E+006 1.0145E+006	0.2% 0.2%	Conc ND ND	0.1 0.1	

Duplicate Conc. (ug/Kg)	Sample Dup	licate	%Diff.	Accept Range	Detect. Limit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	1.5	1.3	13.3%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylene	3.0	3.1	3.3%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample Amo	unt Spiked Spil	ked Sample %	Recovery	Accept Range ;
Benzene	ND	500	598	120%	39 - 150
Toluene	1.5	500	585	117%	46 - 148
Ethylbenzene	ND	500	555	111%	32 - 160
p,m-Xylene	ND	1000	1,190	119%	46 - 148
o-Xylene	3.0	500	580	115%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 57900-57904

Analyst

Review



# EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Huntington Energy	Project #:	06111-0002
Sample ID:	Drill Pit Closure	Date Reported:	04/15/11
Laboratory Number:	57900	Date Sampled:	04/14/11
Chain of Custody No:	11566	Date Received:	04/14/11
Sample Matrix:	Soil	Date Extracted:	04/15/11
Preservative:		Date Analyzed:	04/15/11
Condition:	In Plastic Bottle	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

178

21.6

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: CLU 499

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



Condition:

# EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS QUALITY ASSURANCE REPORT

Analysis Needed:

1,520

TPH

+/- 10%

4.4%

Client: **QA/QC** Project #: N/A Sample ID: QA/QC Date Reported: 04/15/11 Laboratory Number: 4-15-TPH.QA/QC 57900 Date Sampled: N/A Sample Matrix: Freon-113 Date Analyzed: 04/15/11 Preservative: N/A Date Extracted: 04/15/11

N/A

04/15/11

04/15/11

Calibration I-Cal Date C-Cal Date I-Cal RF: % Différence Accept. Range

1,590

Blank Conc. (mg/Kg)

Concentration

Detection Limit

ND

21.6

Duplicate Conc. (mg/Kg)SampleDuplicate% DifferenceAccept. RangeTPH1781723.5%+/- 30%

Spike Conc. (mg/Kg) Sample Spike Added Spike Result % Recovery Accept Range
TPH 178 2,000 1,970 90.4% 80 - 120%

ND = Parameter not detected at the stated detection limit.

References: Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: QA/QC for Samples 57900, 57902, 57905-57907

Review



### Chloride

Client:

**Huntington Energy** 

06111-0002

Sample ID:

**Drill Pit Closure** 

Date Reported:

04/15/11

Lab ID#:

57900

Date Sampled:

Project #:

04/14/11

Sample Matrix:

Soil

Date Received:

04/14/11

Preservative: Condition:

Intact

Date Analyzed: Chain of Custody:

04/15/11 11566

**Parameter** 

Concentration (mg/Kg)

**Total Chloride** 

400

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

**CLU 499** 

Review


5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com


, H


# CHAIN OF CUSTODY RECORD 11566

Client:  Huntington Client Address:	Ene	P	roject Name / I		199								-	ANAL	YSIS .	/ PAR	AME	TERS				
Client Address:  A Llen Client Phone No.:  1-405-767-		С	ampler Name:	ano					TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion		TCLP with H/P		TPH (418.1)	RIDE			Sample Cool	Sample Intact
Sample No./ Sidentification	Sample Date	Sample Time	Lab No.	S	ample /latrix	No./Volume of Containers			TPH (	ВТЕХ	0 0 0	RCRA	Cation	낊	TCLP	PAH	TPH (	CHLORIDE			Sampl	Sampl
Drill Pity	/14		57900	Solid	Sludge Aqueous	3 battle	1 1	_	X	X							X	X			_	N
Closure				Soil Solid	Sludge Aqueous			_														To c
				Soil Solid	Sludge Aqueous				ļ 											_		4
				Soil Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	
			•	Soil Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	•
				Soil Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	
Relinquished by: (Signatur	re)				Date	Time	Re	ceive	<u>a D</u>	(Signa	ature)	1/			_				Da		Tin	- 1
Belinquished by: (Signatur	re)				4-14-11	8:23	Re	cejve	d by:	(Signa (Signa	nture)	Jag	ZLL	'AR			···		14/1	4/11	8	23
Relinquished by: (Signatur	re)						Re	eceive	d by:	(Signa	ature)											

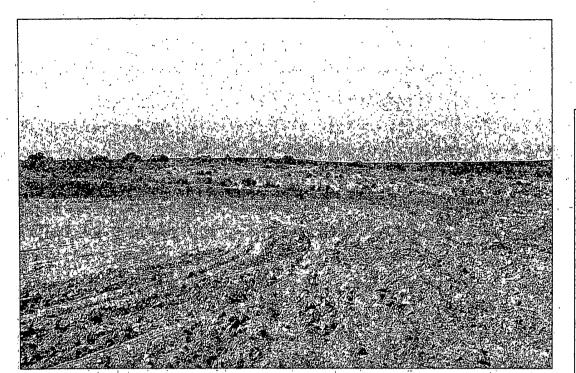



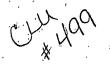

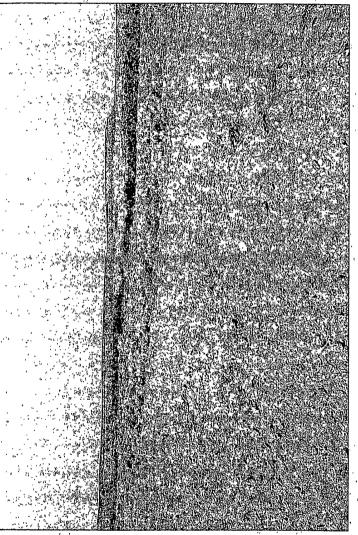

# Canyon Largo Unit #499 Huntington Energy, L.L.C. San Juan Basin-Canyon Largo Unit Pit Closure Plan

In accordance with Rule 19 15.17 12 NMAC the following information describes the closure requirements of temporary pits on Huntington Energy, L.L.C (HE) locations. This is HE's standard procedure for all temporary pits. A separate plan will be submitted for any temporary pit which does not conform to this plan

All closure activities will include proper documentation and be available for review upon request and will be submitted to OCD within 60 days of closure of pit. Closure report will be filed on C-144 and include the following:

- Details on Capping and Covering, where applicable.
- Plot Plan (Pit Diagram)-C102 w/pit on diagram-Submitted
- Inspection Reports-attached
- Sampling Results-Envirotech-Submitted with C-144 Pit Closure
- C-105- Submitted with C-144 Pit Closure
- Copy of Deed Notice will be filed with County Clerk- N/A

### General Plan:

- All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division-approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves. The facilities to be used for liquids will be IEI NM-010010B and IEI will be used for solids (#01001010B). All recovered liquids were disposed of at Basin Disposal and solids were sent to IEI.
- The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19 15.17.13 are met **Pit was closed using onsite burial.**
- The surface owner shall be notified of HE's closing of the temporary pit Closure notification was sent via emailt o BLM/NMOCD-certified mail not required for Federal Land and BLM/NMOCD.
- Within 6 months of the rig off status occurring, HE will ensure that the temporary pits are closed, re-contoured and reseeded. **Compliant with rule.**
- Notice of Closure will be given prior to closure to the Aztec Division office between 72 hours and one week via email, or verbally. The notification of closure will include the following:
  - Operator's name
  - ii Location by Unit Letter, Section, Township, and Range, Well name and API number.

    Notification sent filed with C-144 Pit Closure.
- 6 Liner of temporary pit shall be removed above "mud level" after stabilization Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner Care will be taken to remove all of the liner. All excessive liner will be disposed of at the San Juan County Landfill located on CR 3100. <a href="Liner was removed above "mud level">Liner was removed above "mud level"</a>. Liner was removed by manually cutting liner at mud level 7 removing all remaining liner. All excessive liner was disposed of at Landfill.
- 7. Pit contents shall be mixed with non-waste containing earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents. Pit contents were mixed with non-waste, earthen material that is safe & stable. The solidification process used a combination of natural drying and mechanically mixing. The mixing ratio was approximately 3:1.
- A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.13(B)(1)(b). In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i e, dig and haul A five point composite sample was taken of the pit using sampling tools. All samples were tested per Subsection B 19.15.17.1 3(B)(1)(b). Results filed with C-144.

Components	Test Method	Limit (mg/kg)
Benzene	EPA SW-846 8021B or 8260B	0.2
BTEX	EPA SW-846 8021B or 8260B	50
TPH	EPA SW-846 418.1	2500
GRO/DRO	EPA SW-846 8015M	500
Chlorides	EPA 300.1	1000/500

- 9. Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails, HE will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing so, confirmation sampling will be conducted to ensure a release has not occurred. Pit material passed testing standards. The pit was then backfilled with compacted, non-waste containing earthen material.
- 10. During the stabilization process, if the liner is ripped by equipment, the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired, then all contents will be excavated and removed. <u>Liner was not damaged in the pit closure.</u>
- 11. Dig and Haul Material will be transported to IEI (Permit # 010010B). Not required.
- 12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Reshaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be placed in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape. Pit area was re-contoured to match fit, shape, line form and texture of surroundings. Re-contour is uniform in appearance with smooth surface natural landscape.
- 13. Notification will be sent to the OCD when the reclaimed area is seeded. <u>C-144 pit Closure</u>
  <u>Notice filed 7/25/2011</u>
- 14. HE shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM stipulated seed mixes will be used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (unimpacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeated seeding or planting will be continued until successful vegetative growth occurs.

Туре	Variety or Cultivator	PLS/A
Western Wheatgrass	Arriba	3.0
Indian Ricegrass	Paloma or Rimrock	3.0
Slender Wheatgrass	San Luis	2.0
Crested Wheatgrass	Hy-crest	3.0
Bottlebrush Squirreltail	Unknown	2.0
Four-wing Saltbrush	Delar	0.25

Species shall be planted in pounds of pure live seed per acre: Present Pure Live Seed (PLS) = Purity X Germination/100 Two lots of seed can be compared on the basis of PLS as follows:

Source No. One (poor quality)

Purity

50 percent

Germination

40 percent

Percent PLS

20 percent

5 lb bulk seed required to make

Source No. two (better quality)

Purity

80 percent

Germination

63 percent

Percent PLS

50 percent

2 lb bulk seed required to make

1 lb PLS 1 lb PLS

# The seeding above was used in 7/2011. After two successive growing seasons, HE will check for vegetative growth. If not successful, repeated seeding will be done.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and Number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location. Steel marker was installed in the temporary pit, no less than four inches in diameter, cemented in a hole, 3 feet deep in center. Marker is flush with the ground to allow access of the active well pad. The top of the marker contains a welded steel 12" square plate that indicates the onsite burial of the temp pit. Operator name, Lease Name, Well Name & number, Section, Township and Range are all listed on the plate as an onsite burial location.

# HE Pit Inspection Log:

# **CLU 499**

API#: 30-039-30810

Date	Visual Inspection
Drilling: 3/7/11-3/14/11	ОК
Weekly Insp	
3/7-3/14	OK
3/15-3/22	OK
3/23-3/30	OK
3/31-4/7	ОК
4/8-4/15	OK
4/16-4/23	OK
4/24-5/1	ОК
5/2-5/9	OK
5/10-5/17	OK
5/18-5/25	OK
5/26-6/2	ОК
6/3-6/10	OK
6/11-6/18	OK
6/19-6/26	OK
6/27-7/4	OK
7/5-7/12	OK
7/13-7/16	ОК

Closed pit: 7/16/10

David Morales, Huntington Energy

# 845