

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Sundry Notices and Reports on Wells

1. Type of Well

Oil Well

2. Name of Operator

Central Resources, c/o NMOCD Aztec District Office

3. Address & Phone No. of Operator

1000 Rio Brazos Road, Aztec, NM 87410 505-334-6178

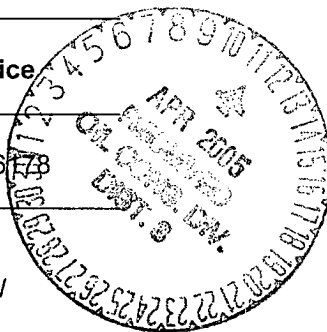
4. Location of Well, Footage, Sec., T, R, M

660' FSL and 660' FWL, Section 13, T-31-N, R-17-W

2005 APR 6 PM 12 04

RECEIVED

070 FARMINGTON NM

**5. Lease Number**

BIA #14-20-603-2022

6. If Indian, All. or**Tribe Name**

Navajo

7. Unit Agreement Name

Horseshoe Gallup

8. Well Name & Number

HSGU #81

9. API Well No.

30-045-10716

10. Field and Pool

Horseshoe Gallup

11. County & State

San Juan County, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA**Type of Submission**☐ Notice of Intent☒ Subsequent Report☐ Final Abandonment**Type of Action**☒ Abandonment☐ Recompletion☐ Plugging Back☐ Casing Repair☐ Altering Casing☐ Other -☐ Change of Plans☐ New Construction☐ Non-Routine Fracturing☐ Water Shut off☐ Conversion to Injection**13. Describe Proposed or Completed Operations**

A-Plus Well Service Plugged and Abandoned the above well NMSA 1978, Section 13-1-127, Purchase Agreement: 415210700028; Purchase Document: 05-199-000321.

1/27/05 MOL and RU rig. Dig out bradenhead. Check pressures: 0# tubing, 100# casing, 0# bradenhead.

1/28/05 NU BOP. PU 46 joints A+ workstring and round trip 5.5" casing scraper to 1454'. TIH with 5.5" DHS CR and set at 1454'. Sting out of CR. Circulate casing clean with 38 bbls of water. Pressure test casing to 500#, held OK. SI well.

1/31/05 Plug #1 with CR at 1454', spot 29 sxs Type III cement (38 cf) inside the 5.5" casing above the CR up to 1175' to isolate the Gallup interval. TOH and LD tubing. Perforate 3 squeeze holes at 208'. Circulate casing and bradenhead annulus with 20 bbls of water. Circulate clean with an additional 20 bbls of water. Plug #2 with 70 sxs Type III cement (92 cf) from 208' to surface, circulate good cement out bradenhead. ND BOP. Dig out and cut off wellhead. Found cement at the surface in the 5.5" casing and in the annulus. Mix 10 sxs cement to fill casing and install P&A marker. RD and MOL. H. Villanueva, NMOCD was on location.

SIGNATURE

William F. Clark
William F. Clark

Contractor

January 31, 2005

(This space for Federal or State Office use)

APPROVED BY

Title

CONDITION OF APPROVAL, if any:

ACCEPTED FOR RECORD

APR 08 2005

NMOCD

FARMINGTON FIELD OFFICE
BY *Sum*