District & 1625 N French Dr., Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S St Francis Dr., Santa Fc, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

1/	29
//	- ,

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
rlease be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the nvironment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
Operator: WILLIAMS PRODUCTION COMPANY, LLC OGRID # 120782
Address PO Box 640 Aztec, NM 87410
Facility or well name: ROSA UNIT #031B
API Number 3003926579 OCD Permit Number
Section 17D Township 31N Range 05W County RIO ARRIBA
Latitude <u>36 90523999999999</u> Longitude <u>107 39306999999999</u> NAD <u>1983</u> Surface Owner <u>FEDERAL</u>
Pit: Subsection F or G of 19 15.17.11 NMAC Temporary □ Drilling □ Workover □ Permanent □ Emergency □ Cavitation □ P&A □ Lined □ Unlined Liner type Thickness
Closed-loop System: Subsection H of 19 15 17 11 NMAC Type of Operation
Secondary containment with leak detection Visible sidewalls and liner Visible sidewalls and liner Visible sidewalls and liner Miles Miles
Submittal of an exception request is required Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval

Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution or church) Four foot height, four strands of barbed wire evenly spaced between one and four feet Alternate Please specify						
Netting: Subsection E of 19 15.17 11 NMAC (Applies to permanent pits and permanent open top tanks) Screen Netting Other Monthly inspections (If netting or screening is not physically feasible)						
Signs: Subsection C of 19 15 17 11 NMAC ☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers ☐ Signed in compliance with 19 15.3 103 NMAC						
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval	office for					
Siting Criteria (regarding permitting): 19 15 17 10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the approoffice or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dry above-grade tanks associated with a closed-loop system.	priate district pproval.					
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No					
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No					
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☐ No ☐ NA					
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to permanent pits) - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☐ No ☐ NA					
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application - NM Office of the State Engineer - iWATERS database search, Visual inspection (certification) of the proposed site	Ycs No					
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality	☐ Yes ☐ No					
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No					
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No					
 Within an unstable area Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources; USGS, NM Geological Society, Topographic map 	☐ Yes ☐ No					
Within a 100-year floodplain - FEMA map	☐ Yes ☐ No					

Temposary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17 9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17 9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19.15 17 13 NMAC
Previously Approved Design (attach copy of design) API Number or Permit Number
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17.9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17.9 NMAC and 19 15 17 13 NMAC
Previously Approved Design (attach copy of design) API Number
Previously Approved Operating and Maintenance Plan API Number (Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19 15 17 9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19 15.17 11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19 15.17 11 NMAC Leak Detection Design - based upon the appropriate requirements of 19 15 17 11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17 11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15 17 13 NMAC
Proposed Closure: 19 15 17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type Drilling Workovei Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative Proposed Closure Method Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19 15 17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. ☐ Protocols and Procedures - based upon the appropriate requirements of 19.15 17 13 NMAC ☐ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15 17 13 NMAC ☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) ☐ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC ☐ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15.17 13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground S Instructions: Please indentify the facility or facilities for the disposal of liquids, a facilities are required.		
	Disposal Facility Permit Number	
Disposal Facility Name		
Will any of the proposed closed-loop system operations and associated activities occ ☐ Yes (If yes, please provide the information below) ☐ No		
Required for impacted areas which will not be used for future service and operation Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	requirements of Subsection H of 19.15.17 13 NMAC of 19.15 17.13 NMAC	2
Siting Criteria (regarding on-site closure methods only): 19 15 17 10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the comprovided below. Requests regarding changes to certain siting criteria may require considered an exception which must be submitted to the Santa Fe Environmental demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for	e administrative approval from the appropriate disti Bureau office for consideration of approval. Justi	ict office or may be
Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data	obtained from nearby wells	☐ Yes ☑ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data	obtained from nearby wells	☐ Ycs ☒ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data	obtained from nearby wells	☐ Yes ☐ No ☑ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other sign lake (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site	ificant watercourse or lakebed, sınkhole, or playa	☐ Yes ☑ No
Within 300 feet from a permanent residence, school, hospital, institution, or church Visual inspection (certification) of the proposed site; Aerial photo; Satellite		☐ Yes ☒ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring the State Engineer - iWATERS database; Visual inspection (or	oring, in existence at the time of initial application	☐ Yes ⊠ No
Within incorporated municipal boundaries or within a defined municipal fresh wate adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approve	·	☐ Yes ☒ No
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visua	l inspection (certification) of the proposed site	☐ Yes ☑ No
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining	and Mineral Division	☐ Yes ⊠ No
Within an unstable area - Engineering measures incorporated into the design, NM Burcau of Geology Society, Topographic map	& Mineral Resources, USGS, NM Geological	☐ Yes ⊠ No
Within a 100-year floodplain - FEMA map		☐ Yes ☑ No
On-Site Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the ap Construction/Design Plan of Temporary Pit (for in-place burial of a drying pa Protocols and Procedures - based upon the appropriate requirements of 19 15 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of 19 Disposal Facility Name and Permit Number (for liquids, drilling fluids and d Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	surements of 19 15 17.10 NMAC Subsection F of 19 15 17 13 NMAC propriate requirements of 19 15.17 11 NMAC ad) - based upon the appropriate requirements of 19 17.13 NMAC urements of Subsection F of 19.15.17 13 NMAC Subsection F of 19 15 17 13 NMAC rill cuttings or in case on-site closure standards cann 1 of 19 15 17.13 NMAC T of 19 15 17.13 NMAC	15 17 11 NMAC

Operator Application Certification: I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief	
Name (Print) Title	
Signature Date	
c-mail address: Telephone.	
OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment)	
OCD Representative Signature: Approval Date: 5/30/2012	
Title: OMD (auce Office) OCD Permit Number:	
21.	
Closure Report (required within 60 days of closure completion): Subsection K of 19 15.17 13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed.	•
☐ Closure Completion Date:6/8/2010	
Closure Method: Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain	
23.	
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more that	
two facilities were utilized.	"
Disposal Facility Name Disposal Facility Permit Number	_
Disposal Facility Name Disposal Facility Permit Number	_
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate compliance to the items below) No	
Required for impacted areas which will not be used for future service and operations Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique	
24	$\overline{}$
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached.	
Proof of Closure Notice (surface owner and division)	
☐ Proof of Deed Notice (required for on-site closure) ☐ Plot Plan (for on-site closures and temporary pits)	
☐ Confirmation Sampling Analytical Results (if applicable)	
Waste Material Sampling Analytical Results (required for on-site closure)	
☐ Disposal Facility Name and Permit Number ☐ Soil Backfilling and Cover Installation	
Re-vegetation Application Rates and Seeding Technique	
Site Reclamation (Photo Documentation) On-site Closure Location. Latitude Longitude NAD	
25	
Operator Closure Certification:	
I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.	
Name (Print) Vancssa Fields TitleEH&S Coordinator	
Signature	
e-mail addressvanessa fields@williams com Telephone505-634-4209	



Explanation & Production FCI Box 640 Aztec INM 61137 505/634 4219 505/634 4214 Fax

March 10, 2009

Mr Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure

Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co. LLC

Pursuant to Rule 19.15-17-13 NMAC, this correspondence is to notify the Bureau of Land Management, Farmington Field Office, of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico - Closure will follow the plan included with this correspondence

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted.

Holly C #erkins EH&S Specialist

Encl Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets Below-Grade Tank Closure Plan

cc Environmental Fig.

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
JOKY MOT					- KILO		
COX CANYON UNIT #001	3004511397	BLANCO MV	16N	32N	11W	BG1	DBL WALL STEFL FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #001A	3004522086	BLANCO MV	16C	3211	11W	BGT	HIDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #001B	3004530791	PLANCO MV	16L	32N	11W	BGT	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16E	3214	1 1 VV	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #003	3004511495	BLANCO MV	91	32N	1 1 V V	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BLANCO MV	9P	32N	11W	BGI	DBL WALL STEEL
COX CANYON UNIT #003B	3004530871	BLANCO MV	9.1	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #004A	3004522093	BLANCO MV	215	32N	11W	BGI	OBL WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	211	3211	1 1 W	BGT	DBI WALI STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	11W	BGI	DBI WALL STEFL
COX CANYON UNIT #005A	3004522094	BLANCO MV BASIN DK /	210	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #005B	3004532142	BLANCO MV	211/	32N	1 I W	BGT	DBI WALL STEEL
COX CANYON UNIT #005C	3004533493	BI ANCO MV	218	3211	11W	BG1	DBI WALI STEEL
COX CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #006A	3004522095	BLANCO MV	161	3214	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006B	3004532693	BLANCO MV	16B	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006C	3004532733	BLANCO MV	160	32N	11W	BG1	DBI WALI STEEL
COX CANYON UNIT #007	3004511455	BLANCO MV	17G	32N	11W	FGP	DBI WALI STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	3211	11W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #008	3004511492	BLANCO MV	18	32N	11W	BGI	HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	1711	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #008B	3004532080	BLANCO MV	8P	32N	11VV		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #008C COX CANYON UNIT #009A	3004531187	BLANCO MV	17P	32N	11W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
COM COX CANYON UNIT #009B	3004522092	BLANCO MV BASIN DK /	20D	32N	11W		HDPE SECONDARY LINER
COM	3004533926	BLANCO MV BASIN DK /	20B	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #009C	3003933851	BL ANCO MV	201	3211	11W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #013	3004521489	BLANCO PC	20A	3214	11W		HDPE SECONDARY LINER

•

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	
COX CANYON UNIT #023 COM	3004522537	BLANCO PC	17C	32N	111	BG1	FIBERGLASS TANK WBANDED 20-n HDPE SECONDARY LINER
COX CANYON UNIT #025	3004522572	BLANCO PC	90	32N	111/	BG1	FIBERGLASS TANK WBANDED 20-0 HDPE SECONDARY LINER
COX CANYON UNIT #200	3004527878	BASIN FIC	બ	32N	11W	BG1	FIBERGLASS TANK WBANDED 20 n HDPE SECONDARY LINER
COX CANYON UNIT #200A	3004532126	BASINFIC	90	32N	11W	BG1	FIBERGLASS TANK WIBANDED 20-6 HDPE SECONDARY LINER
COX CANYON UNIT #203	3004527872	BASIN FTC	17A	32N	111/	BGT	FIBERGLASS TANK W/BANDED 20-n HDPE SECONDARY LINER
MADDOX #001	3004511487	BLANCO MV	10N	32N	11W	BG1	DBL WALL STELL
MADDOX #001A	3004523539	BLANCO MV	10P	32N	11W	BGI	DBI WALL STEEL
NM 32-11 #001	3004511309	BI ANCO MV	200	32N	11W	вGТ	DBL WALL STEEL
NM 32-11 #001B COM	3004532024	BASIN DK / BLANCO MV	20J	32N	11W	BGT	DBL WALL STEEL
NM 32-11 #0010 COM	3004532804	BASIN DK / BLANCO MV	201	32N	11W	BG1	DBL WALL STEEL
NM 32-11 #002 COM	3004511380	BLANCO MV	19A	3214	111/	BG1	FIBERGLASS TANK WBANDED 20-11 HDPE SECONDARY LINER
NM 32 11 #002A COM	3004529017	BLANCO MV	190	3214	11W	BGT	DBI WALL STEEL
NM 32-11 #002B COM	3004532670	BLANCO MV	191	3214	11W	BGT	DBI WALL STEFI
NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11W	BG1	DBI WALL STEEL
ROSA UNIT #001 SWD	3003927055	SWD BASIN DK /	231	31N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #001E	3003925411	BI ANCO MV	1117	3110	06 V V		HDPE SECONDARY LINER
ROSA UNIT #005A	3003925407	BLANCO MV / ROSA PC BASIN DK /	26P	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #005B	3003926927	BLANCO MV	26B	311	OGW	BGI	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 n
ROSA UNIT #005Y	3003926078	BLANCO MV	26H	31N	06/\		HDPE SECONDARY LINER FIBERGI ASS TANK W/BANDED 20-m
ROSA UNIT #008	3003907944	ROSA PC BLANCO MV /	26M	31N	OOW	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #008	3003907944	ROSA PC BLANCO MV /	26M	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #006A	3003925430	ROSA PC	26D	3111	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #008C	3003926944	BLANCO MV	26N	31N	W80	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 n
000# TINU A2O	3003907975	BLANCO MV BASIN DK /	11K	31N	06W		HDPE SECONDARY LINER
AGOUR TINU AGOS	3003925584	BLANCO MV	11C	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
1058 TIND A201	3003927042	BLANCO MV	11E	3111	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 n
'OSA UNIT #010B	3003926556	BLANCO MV	1311	31N	06W		HDPE SECONDARY LINER
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	W80	BG7	DBL WALL STEEL
OSA UNIT #0100	3003926556	BI ANCO MV	1311	31N	06W	BG1	DBL WALL STEEL

WELLS W/FEDERAL							
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #012A	3003925900	BLANCO MV / ROSA PC BASIN DK /	15J	31N	06W	FG1	DBI WALL STEFT FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #012B	3003926555	BLANCO MV	15P	31N	06/4	BGT	HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15/4	3110	06/V	SGT	SINGLE WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013	3003907936	BI ANCO MV	31G	3111	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #013A	3003926298	BLANCO MV BASIN DK /	31F	31 N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	(15Vv	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPF SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #014A	3003926280	BLANCO MV BASIN DK /	23P	31N	()6VV		HDPE SECONDARY LINER
ROSA UNIT #014C	3003930132	BLANCO MV	23H	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #015	3003907946	BLANCO MV	2911	31N	05W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016	3003907963	BLANCO MV	14N	3111	06VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #016A	3003925496	BLANCO MV	14C	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016B	3003926218	BLANCO MV	14M	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #017A	3003926272	BLANCO MV BASIN DK /	200	31N	05W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #017B	3003926971	BLANCO MV BLANCO MV /	200	31N	05W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC BLANCO MV /	22H	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #018A	3003925436	ROSA PC	22P	31N	06VV	SGI	DBI, WALL STEEL
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #019B	3003926560	BLANCO MV	241	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBI WALI STEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06VV		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSÁ UNIT #020A	3003925495	BLANCO MV	14()	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #020B	3003926220	BLANCO MV	14A	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #021A	3003926121	BLANCO MV	23C	3111	06W		HDPE SECONDARY LINER
ROSA UNIT #021B	3003926554	BLANCO MV	23K	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #02;	3003907971	BLANCO MV	18A	31N	05W		HDPE SECONDARY LINER

•

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	T.WN	RNG	PII TYPE	CONSTRUCTION MATERIAL
Production countries and the second s		The second secon	-			**************************************	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #022A	3003926390	BLANCO MV	18C	311/	0574	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #023	3003907942	BLANCO MV	29M	31N	05Vv		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023B	3003926553	BLANCO MV	29E	31N	05W	PG1	HDPE SECONDARY LINER
ROSA UNIT #023C	3003927609	BASIN DK / BLANCO MV	291	31N	05W	BGT	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #024	3003907933	BLANCO MV	32M	31N	05W		FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #024A	3003925568	BASIN DK / BLANCO MV	32E	31N	05Vv	SGT	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mill
ROSA UNIT #024B	3003926630	BLANCO MV BASIN DK /	32N	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #024C	3003926968	BLANCO MV BASIN DK /	32C	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #026A	3003925580	BI ANCO MV	32O	31N	05W	SGI	DBL WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W		DBI WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #029	3004511136	BLANCO MV BASIN DK /	32H	32N	VVðO		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
POSA UNIT #029B	3004530709	BLANCO MV BASIN DK /	32B	32N	0674		HDPE SECONDARY LINER
ROSA UNIT #029M	3004529584	BLANCO MV BASIN DK /	321	3211	Wan		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #030 COM	3003925570	BLANCO MV	120	31N	0674	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #030A	3003926068	BLANCO MV	121/1	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #030B	3003926601	BLANCO MV	121	3110	06W		HDPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BLANCO MV	12P	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05Vv	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #031A	3003926346	BLANCO MV	171	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #0318	3003926579		1/D	_31N	05\Vv	_ BG1 .	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #031C	3003926578	BLANCO MV BLANCO MV /	17N	3111	05W	,	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #032	3003925389	ROSA PC BLANCO MV /	2111	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #032A	3003925417	ROSA PC	215	3111	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #032B	3003926771	BASIN DK / BLANCO MV	21G	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #032C	3003927240	BASIN DK / BLANCO MV	21F	31N	06W		FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034	3003907984	BL ANCO MV	36B	3211	06W		HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BI ANCO MV	361	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #034A	3003926119	BI ANCO MV	364	32N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #0345	3003926629	BLANCO MV	36,1	32N	06W_		HDPE SECONDARY LINER

ŧ

į

WELLS W/FEDERAL SURF MG1	API	FMT	SEC	TWN	RNG	PIT TYPE	
							FIBERGLASS TANK W/BANDED 20-nul
ROSA UNIT #034C	3003926969	BLANCO MV	36H	4211	06W	BG1	HUPE SECONDARY LINER
ROSA UNIT #035X	3004510996	BLANCO MV	5K	3114	()(s\/v	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #036	3003907977	BLANCO MV	1111	3114	oevv	E61	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #036C	3003930182	BLANCO MV	11G	3111	06W	BGT	HDPF SECONDARY LINER
ROSA UNIT #041	3003907981	BLANCO MV	5K	31N	05W	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #041B	3003927014	BASIN DK / BLANCO MV	49	31N	05 V V	BGT	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	W80	BG1	DBI WALL STEFI
ROSA UNIT #044A	3003926161	BI ANCO MV	35E	32N	06W	SGT	SINGLE WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	OGW	SGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06W	BGT	HDPF SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #045	3003923013	BLANCO MV BASIN DK /	Me	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #046A	3003926986	BLANCO MV	8O	3111	05W	BGI	HDPF SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #055	3003920923	BASIN DK	341	31N	05VV		HDPE SECONDARY LINER
ROSA UNIT #059 DK	3003923270	BASIN DK	2514	31N	06W		DBL WALL STEFL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06Vv	BGT	HDPF SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	(16Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05₩	BGT	DBL WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	3111	05W	SGI	DBI WALL STEEL
ROSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	()5W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #066	3003921758	BASIN DK BASIN DK /	131	31N	06//		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #066M	3003925747	BI ANCO MV	13F	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #072	3003925509	BLANCO MV	61	31N	05W	•	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #075	3004529895	BLANCO MV	101	31N	06VV		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #075A	300 4529854 \	BLANCO MV DK/UNDES	4C)	31N	()6W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #07 ⁷	3003922538	GL/BLANCO	331	31N	05W	BG7	HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
		BASIN DK /					
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK /	22K	3111	Wau	BGT	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV /	22K	31N	06W	SG1	DBL WALL SIFEL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	22F	5414	06W	BG1	DBI WALL STEEL
ROSA UNIT #079B	3003926920	BI ANCO MV	22C	3110	06/\	BGT	DBI WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #080	3003922537	BLANCO MV	вĸ	31N	05VV		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #080A	3003926413	BLANCO MV	8f	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	0517	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085A	3003926314	BLANCO MV	20C	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #085B	3003930130	BLANCO MV	20D	3111	05W	BG1	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI	12W	31N	()4W	SGI	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	BLANCO MV / ROSA PC	8F	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #089	3003922782	BLANCO MV	34A	32N	06VV		HDPE SECONDARY LINER
ROSA UNIT #089A	3003925512	BLANCO MV	34()	3214	06W		FIBERGLASS TANK w'BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	PLANCO MV	341	3211	06W	BGI	DBI WALL SIFFI
ROSA UNIT #089C	3003926674	BLANCO MV	34G	3214	0644		SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	ა3G	3211	0674		HDPE SECONDARY LINER
KOSA UNIT #090A COM	3004529259	BLANCO MV	33G	3514	06\V		DBI WALL STEEL FIBERGLASS TANK wBANDED 20-mil
ROSA UNIT #091	3003922780	BLANCO MV	35H	32N	06W		HDPE SECONDARY LINER
ROSA UNIT #091A	3003925790	BLANCO MV	35O	32N	06W	SGT	DBI WALL STEEL
ROSA UNIT #091B	3003926684	BLANCO MV	35P	32N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #091C	3003926991	BI.ANCO MV	35G	32N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #098	3003923265	BASIN DK / GL BASIN DK /	23L	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #100B	3003929547	BLANCO MV	210	31N	06W	BG1	DBI WALI STEEL
ROSA UNIT #100C	3003929851	BLANCO MV	21K	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #100E	3003925135	BLANCO MV / ROSA PC	211	31N	0677	SG1	SINGLE WALL STEEL
COSA UNIT #101M	3003925577	BLANCO MV	24F	31N	06W	BGT	DBL WALL STEEL
OSA UNIT #108	3003923506	BASIN DK / GL	7G	3114	05W	BG1	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER

•

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	PNG	PIT TYPE	CONSTRUCTION MATERIAL
			<u> </u>		MIG		CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925143	BASIN DK	18N	31N	0517	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #125	3003925144	BLANCO MV	13B	3111	0617	BG1	HDPE SECONDARY LINER
ROSA UNIT #125C	3003929843	BLANCO MV BASIN DK /	13G	31N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #125L	3003925526	BLANCO MV	13J	31N	06VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34E	32N	06W	5G1	DBL WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06W	BGI	DBI WALL STEEL
ROSA UNIT #137	3003925410	BLANCO MV	31K	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	BLANCO MV / ROSA PC	311	31N	05W	BG1	DBI WALL STEEL
ROSA UNIT #137B	3003927002	BLANCO MV	31P	31N	05W	BG1	FIBERGLASS TANK w/BANDED 20-mil HDFE SECONDARY LINER
ROSA UNIT #138	3004529147	BLANCO MV / ROSA PC	171	31N	06W	BGT	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNII #136A	3004529134	BLANCO MV / ROSA PC	17H	3111	06W	BG1	DBI WALL STEFI
ROSA UNIT #138B	3004532168	BLANCO MV	1/1-1	3111	06W	BG1	DBI WALL STEFI
ROSA UNIT #139A	3004529600	BLANCO MV	17M	31N	06W	BG1	DPI WALL STEEL
ROSA UNIT #14()	3003925435	ROSA PC	22K	31N	06W	BGT	DBL WALL STEFL
ROSA UNIT #144	3003925421	ROSA FC	26A	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	161	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W	BG1	FIBERGLASS TANK WBANDLD 20 mil- HDPC SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	05W	BG1	DBI WALL STEFI
ROSA UNIT #148	3003925493	BASIN DK	20		06W		DBI WALL STEEL
ROSA UNIT #148A	3003925776	BLANCO MV	2N	31N	06W	BGT	DBI WALL STEEL
						, -	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W	BG1	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	12F	3111	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #149B	3003926599	BLANCO MV	12E	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #150	3004529229	BI ANCO MV	32F	32N	06W	BGI	HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BLANCO MV BASIN DK /	32M	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #150B	3004530874	BLANCO MV	32D	32N	06W	BG1	DBI WALI STEEL
ROSA UNIT #150C	3004532157	BLANCO MV	32K	3214	06W	BGT	DBL WALL STEEL
ROSA UNIT #15	3004529267	BLANCO MV	33C	32N	06W	BG1	DBL WALL STEEL

. .

WELLS WIFEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
30111 11101					ICIO		. CONTINUE MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	331	32N	0614	BGI	OBI WALL STEEL
ROSA UNIT #151C	3004532196	BLANCO MV	3514	32N	06\ ′ v	EG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #152B	3003926631	BLANCO MV	36C	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	06VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #153	3003925524	BLANCO MV	170	31N	05VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #153A	3003926329	BLANCO MV BASIN DK /	17A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #153B	3003927603	BI ANCO MV	171	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	714	31N	05VV	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #154A	3003926274	BLANCO MV	7P	3111	e5W	BGI	HDDE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #156	3004529661	BLANCO MV	9A	3114	06W	BG1	HOPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #156A	3004529640	BLANCO MV BASIN DK /	91	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BLANCO MV	190	31N	05W	RGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3110	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #15C	3003930111	BLANCO MV BLANCO MV /	29G	31N	05W	RGT	HDPE SECONDARY LINER
ROSA UNIT #160	3003925890	ROSA PC	250	31N	06V/	BG1	DBI WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV BASIN DK /	25N	31N	W80	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #160B	3003926962		251	31N	06VV	BGT	HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W	BG1	DBI WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #162	3003926069	BLANCO MV	30K	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BL ANCO MV	30P	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #163	3003926345	BI ANCO MV	24G	31N	06W	BGI	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #163A	3003926336	BLANCO MV	240	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	31N	06W	5G1	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV BASIN DK /	24J	31N	06W	SG1	SINGLE WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #164	3003926151	BLANCO MV	1J	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #164A	3003926080	BLANCO MV	1J	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #164L	3003927242	BASIN DK / BLANCO MV	1 J	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER

, ,

WEL'LS W/FEDERAL	na non regiona against resistant e service a commercia a conquessorie e com service					***********	akonkon govanna vetteri kittishterise sijansa terini eneman interprija embali govany sadanah esia magazana
SURF MGT	API	FM1	SEC	IWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
DOGA LIBIII MARE		BLANCO MV /	43.45.45				
ROSA UNIT #165	3003926070	ROSA PC	25F	3110	06W	BGT	DBI WALL STEEL
ROSA UNIT #165A	3003926150	BLANCO MV	25B	31N	OGVV	8G1	FIBERGLASS TANK w/BANDED 20 mil- HDPE SECONDARY LINER
	300007 0170	BASIN DK /	2 (1)	3114	OUVV	001	THE SECONDARY ENGIN
ROSA UNIT #165B	3003926557	BLANCO MV	25E	31N	06\V	BG1	DBI WALL STEEL
		BASIN DK /					
ROSA UNIT #165C	3003926961	BLANCO MV	25G	31N	06W	BG1	DBL WALL STEEL
ESCOLO A LIBERT MACO							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #166A	3003926282	BLANCO MV	30F	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDFE SECONDARY LINER
	3003870202	DE ANÇO KIV	301	2114	UUV	וטם	FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #167A	3004529886	BLANCO MV	8A	31N	06Vv	BGT	HDPF SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	3111	06W	BG1	DBI WALL STEEL
D004 11111 114004							
ROSA UNIT #169A	3003926149	BLANCO MV	3.1	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #1690	3003927717	BLANCO MV	21/4	31IV	06Vv	BGI	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
	3003021111	DEALGO WY	2 101	SHIN	OOVV	ВОТ	THE SECONDARY CHICK
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06VV	BGT	DRI WALL STEEL
ROSA UNIT #171	3003926286	BLANCO MV	iG	31N	05W	BG1	DBL WALL STEEL
B444 1444							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #171A	3003926389	BLANCO MV	76	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #171B	3003927013	BLANCO MV	6b	2.481	06161	001	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
INOSA OIVIT #171B	3003927013	DI ANCO MV	t)t/	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #180B	3004533134	BLANCO MV	91	3111	06W	BG1	DBL WALL STEEL
ROSA UNIT #180C	3004593191	BLANCO MV	9E	3110	OGVV	BG1	DBI WALL STEEL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	06VV	BG1	DBL WALL STEEL
1007 0111 #101	3003820403	DI ANGO WV	TIN	2114	OUAA		FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #181A	3003926312	BLANCO MV	15A	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #181C (shared							FIBERGLASS TANK w/BANDED 20 mil
w/169C)	3003927714	BLANCO MV	2M	31N	06W	BGT	HDPE SECONDARY LINER
D004 1447 4400		D. A. 1614 . A. 1					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #182	3003926283	BLANCO MV	18N	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BG1	DBL WALL STEEL
7.007.70.07.77.7027.1	5000020202	EAT TOO III	101	SIII	0.000	LX71	THE WARE CICE
ROSA UNIT #182C	3003930180	BLANCO MV	18F	31N	05W	SGT	SINGLE WALL STEFL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W		HDPE SECONDARY LINER
DOOA LIAUT HADA		DI ANICO MA	4.65.65		05141		FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #183A	3003926386	BLANCO MV	19F	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #183B	3003930087	BLANCO MV	19B	31N	05W	BGT	DBL WALL STEEL
	20000000	BASIN DK /		0.114		501	
ROSA UNIT #185B	3004532734	BLANCO MV	16F	31N	06W	BG1	DBL WALL STEFL
ROSA UNIT #185C	3004534484	BLANCO MV	16F	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #18¢	2002020402	DLANCO MA	0.10	(144)	11111	rou	FINI MALL CITTI
TUSA UNIT # 18:	3003930186	BLANCO MV	21G	3114	05W	BG1	DBL WALL STEEL

. .

WELLS W/FEDERAL SURF MG1	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	300 392444 1	BASINTIC	31N	3114	05Vv	SGT	SINGLE WALL STEEL
ROSA UNU #335A	3003930222	BASINFIC	05.1	3111	(J5VV	SG1	SINGLE WALL STEEL

,

Fields, Vanessa

From:

Meador, Tasha

Sent:

Monday, August 16, 2010 2:06 PM

To:

Fields, Vanessa

Subject:

FW: Request for Review Pit Closure Plans - Rosa 152, 152C,34B, 34C, 31B, 108

Tasha Meador

EH&S Coordinator
Williams Exploration & Production

721 S Main Aztec, NM Office: 505-634-4200 Direct:505-634-4241

Direct:505-634-4241 Fax: 505-634-4205

tasha.meador@williams.com

From: Lane, Myke

Sent: Monday, March 01, 2010 7:38 AM

To: 'Jones, Brad A., EMNRD'

Cc: Powell, Brandon, EMNRD; Meador, Tasha; Basye, Matt

Subject: Request for Review Pit Closure Plans - Rosa 152, 152C,34B, 34C, 31B, 108

Brad:

We need to take the following below grade tanks out of service, and we would like to close this existing BGTs. We request your review to allow closure.

WELLSITE	API	FMT	SEC	TWN	RNG
Rosa #152	3003925494	BLANCO MV	36E	32N	06W
Rosa #152C	3003927635	BLANCO MV	36L	32N	06W
Rosa #034B	3003926629	BLANCO MV	36J	32N	06W
Rosa #034C	3003926969	BLANCO MV	36H	32N	06W
Rosa.#031B	3003926579	BLANCO MV	17D_	31 <u>N</u>	05W ?
Rosa #108	, 3003923506	BLANCO DK	07G	31N	05W

Please contact me if there are any problems or you request additional information. Thanks for your consideration

District I 1625 N₄French Dr., Hobbs, NM 88240 District II 1301 W Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S St Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back

Form C-141 Revised October 10, 2003

side of form

Release Notifica	tion and Corrective Act	ion	
	OPERATOR		Final Report
PRODUCTION LLC	Contact Vanessa Fields		

Name of Co	mpany `	WILLIAMS	PRODU	CTION, LLC		Contact Vanessa Fields						
Address		P.O BOX 6	40, AZTI	EC, NM 87410		Telephone No. (505) 634-4209						
Facility Na	ne Rosa U	nıt #031B				Facility Type Well Site						
Surface Ow	mer Feder	1		Mineral Ow	mor				Lease N	Jo.		
Surface Ow	ici redera	11		Willeral Ow	/IICI				Lease	NO.		
				LOCAT	[OI]	N OF REI	LEASE					
Unit Letter	Section	Township	Range	Feet from the	North/	South Line	Feet from the	East/	West Line	County		
D	17	31N	05W									
			Latitu	ide 36.905239		Longitude	-107.393069)				
		•				OF REL			_			
Type of Rele	ase No Rel	ease Detected					Release NA		Volume F	Recovered NA		
Source of Re						Date and F	lour of Occurrence	ce	Date and	Hour of Discovery NA		
Was Immedi	ate Notice (If YES, To	Whom?					
			Yes L	No Not Req	uired	NA						
By Whom?						Date and I						
Was a Water	course Read			1		1	olume Impacting	the Wat	ercourse			
			Yes 🗵	No		NA						
If a Waterco	If a Watercourse was Impacted, Describe Fully *											
NA	NA .											
Describe Cau	se of Probl	em and Reme	dial Action	n Taken.*								
i												
NA												
	a Affected	and Cleanup A	Action Tak	en.*								
NA												
I hereby cort	fy that the	information a	ven above	is true and comple	te to t	he hest of my	knowledge and u	ındarete	and that nur	suant to NMOCD rules and		
										eases which may endanger		
										eve the operator of liability		
should their	perations h	nave failed to a	adequately	investigate and ren	nediat	e contaminati	on that pose a thr	eat to g	round water	, surface water, human health		
				tance of a C-141 re	port d	oes not reliev	e the operator of	respons	sibility for c	ompliance with any other		
federal, state	, or local la	ws and/or regu	ılati y ns									
	- 1						<u>OIL CON</u>	<u>SER\</u>	<u>/ATION</u>	<u>DIVISION</u>		
Signature)ar			>								
Signature		600 B			-	A 1.1	D					
Printed Name	Printed Name Vanessa Fields						District Supervis	or.				
Title EH&S	Coordinate	or				Approval Date E			Expiration Date			
E mo!! A d 1	nag Vance	n fiolds@!!!	ioma com		- }	Conditions of Approval			1			
E-mail Addre	ess vaness	sa fields@will	iams com			Conditions of	ı Approvai			Attached		
Date: 10-	19-10		Pho	ne (505) 634-4209)							

^{*} Attach Additional Sheets If Necessary

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
 under these conditions will be closed within 60 days of cessation of the BGT's
 operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

- solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.
- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Jesting Methods	Closvie limits (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	- 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

- (1) Method modified for solid waste.
- $^{(2)}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.
- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.I NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports
- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
 under these conditions will be closed within 60 days of cessation of the BGT's
 operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.I(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

- solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9,712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.
- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	lesting Methods	Closure Limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	- 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

⁽¹⁾ Method modified for solid waste.

- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

⁽²⁾ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin-Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:


- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs


Components:	Nesling Melhods	Glosuje timits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 8015 M(Full Range)*	100
	or Method 418.1	
Chlorides	EPA SW-846 Method 300.1	250

^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-approved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

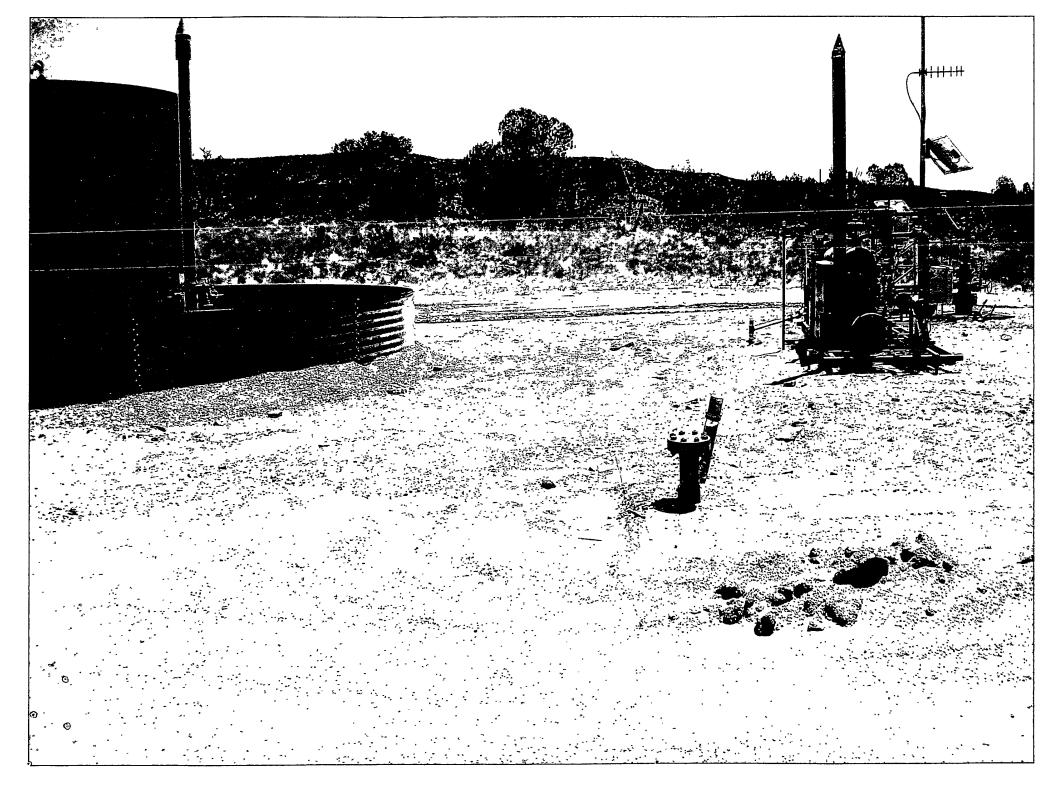

Williams Production Rosa 31 B Mesaverde/Dakota Sec 17 T 31 N R 6 W

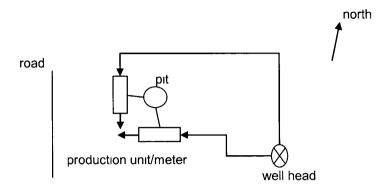

rsetifer

	_						eak detec	k detection		
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
Aug-08	ROSA UNIT #031	04-61	Mesa Verde	FIBERGLASS	BGT					
9/22/2008	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	3.5"	1'8"	None
10/31/2008	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	1.5"	10"	None
10/31/2008	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner		1.5"	10"	None
1/2/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	_y	41"	3"	
1/26/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	47"	3"	
2/2/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у			
3/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у			
4/28/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	1.75	43.5	
5/29/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	1	64	
6/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	1.5"	35"	
7/30/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	YES	1.75"	44"	

						Liner			Pit	
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
8/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	YES	1.75"	12"	
9/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	YES	2"	28"	
10/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	1.75"	45"
11/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	1.75"	45"
12/1/2009	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	3"	30.5"
1/1/2010	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	2"	45"
2/1/2010	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	12"	65"
3/1/2010	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	4.75"	19.5"
4/1/2010	ROSA UNIT #031B	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	2"	37"

, . , .



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Williams	Project #:	04108-0136
Sample ID:	Rosa 31B	Date Reported:	06-08-10
Laboratory Number:	54587	Date Sampled:	06-03-10
Chain of Custody No:	9428	Date Received:	06-04-10
Sample Matrix:	Soil	Date Extracted:	06-04-10
Preservative:		Date Analyzed:	06-05-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	1.3	0.2
Diesel Range (C10 - C28)	2.0	0.1
Total Petroleum Hydrocarbons	3.3	0.2

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Analyst

5796 US Highway 64. Farmington. NM 87401 Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc com envirotech-inc com



EPA Method 8015 Modified Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

Quality Assurance Report

Client:	QA/QC	Project #.	N/A
Sample ID:	06-05-10 QA/QC	Date Reported:	06-08-10
Laboratory Number:	54576	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	06-05-10
Condition:	N/A	Analysis Requested:	TPH

CALL TO SECURE STATE OF THE SECURE	- CaliDate	# IFGELIRE	Cicalina	% Difference	Accept Range
Gasoline Range C5 - C10	05-07-07	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Diesel Range C10 - C28	05-07-07	9.9960E+002	1.0000E+003	0.04%	0 - 15%

Blank Conc. (mg/L_inig/Kg)	Concentration (*)	Delection Elmit
Gasoline Range C5 - C10	ND	0.2
Diesel Range C10 - C28	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

Duplicate Conc. (mg/Kg)	Sámple	2 Duplicate	% Difference	Accept Range
Gasoline Range C5 - C10	3.3	2.7	18.4%	0 - 30%
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%

Spike Gone (mg/kg)	Sample	Spike Added	Spike Result	, c% Recevery	Accept Range
Gasoline Range C5 - C10	3.3	250	252	99.5%	75 - 125%
Diesel Range C10 - C28	ND	250	242	96.7%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments: QA/QC for Samples 54576-54578, 54582-54588.



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Williams	Project #:	04108-0136
Sample ID:	Rosa 31B	Date Reported:	06-08-10
Laboratory Number:	54587	Date Sampled:	06-03-10
Chain of Custody:	9428	Date Received:	06-04-10
Sample Matrix:	Soil	Date Analyzed:	06-04-10
Preservative:		Date Extracted:	06-04-10
Condition:	Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Ponyone	4.4	0.0	
Benzene Toluene	1.1 19.2	0.9 1.0	
Ethylbenzene	18.8	1.0	
p,m-Xylene	446	1.0	
o-Xylene	85.9	0.9	
Total BTEX	571		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	103 %
	1,4-difluorobenzene	101 %
	Bromochlorobenzene	107 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A	Project #.	N/A
Sample ID:	0604BBLK QA/QC	Date Reported:	06-08-10
Laboratory Number:	54576	Date Sampled:	N/A
Sample Matrix:	Soil	Date Received:	N/A
Preservative:	N/A	Date Analyzed.	06-04-10
Condition:	N/A	Analysis:	BTEX

Calibration and Detection Limits (uglis)	FGAIRF	or cacaline Accept Rain	A CONTRACTOR OF THE PARTY OF TH	Cone	Detect Detect
Benzene	1.2613E+006	1.2638E+006	0.2%	ND	0.1
Toluene	1.1630E+006	1.1654E+006	0.2%	ND	0.1
Ethylbenzene	1.0450E+006	1.0471E+006	0.2%	ND	0.1
p,m-Xylene	2.5909E+006	2 5961E+006	0.2%	ND	0.1
o-Xylene	9.6855E+005	9.7050E+005	0.2%	ND	0.1

Duplicate Cone. (uq/Kg)	sa Sample and Sample	pjeate	्र १४४ <u>०)स</u> ्	Acepto Range	Peter Limit
Benzene	2.6	2.4	7.7%	0 - 30%	0.9
Toluene	5.4	4.2	22.2%	0 - 30%	1.0
Ethylbenzene	3.3	2.4	27.3%	0 - 30%	1.0
p,m-Xylene	4.8	3.6	25.0%	0 - 30%	1.2
o-Xylene	3.7	2.9	21.6%	0 - 30%	0.9

Spike Conc. (ug/Kg),	Sample Amo	wnispiked Spi	ed Sample)	% Receivery	'Accept Range
Benzene	2.6	50.0	48.6	92.4%	39 - 150
Toluene	5.4	50.0	50.5	91.2%	46 - 148
Ethylbenzene	3.3	50.0	50.2	94.1%	32 - 160
p,m-Xylene	4.8	100	100	95.5%	46 - 148
o-Xylene	3.7	50.0	50.6	94.2%	46 - 148

ND - Parameter not detected at the stated detection limit.

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996

Comments: QA/QC for Samples 54578, 54582-54585, 54576 and 54586 54588,

Analyst

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc com envirotech-inc com

EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Williams	Project #:	04108-0136
Sample ID:	Rosa 31B	Date Reported:	06-08-10
Laboratory Number:	54587	Date Sampled:	06-03-10
Chain of Custody No:	9428	Date Received:	06-04-10
Sample Matrix:	Soil	Date Extracted:	06-04-10
Preservative:		Date Analyzed:	06-04-10
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

107

13.5

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:



EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:	QA/QC	Project #:	N/A
Sample ID:	QA/QC	Date Reported:	06-08-10
Laboratory Number:	06-04-TPH.QA/QC 54564	Date Sampled:	N/A
Sample Matrix:	Freon-113	Date Analyzed:	06-04-10
Preservative:	N/A	Date Extracted:	06-04-10
Condition:	N/A	Analysis Needed:	TPH

Calibration 1-Cal Date	C-Cal Date	I-Cal RF: C-	Cal RF: %	Difference	Accept. Range
06-03-10	06-04-10	1,690	1,770	4.7%	+/- 10%

Blank Conc. (mg/kg) TPH	ncentration ND	Ó	etection Limit	
Duplicate Conc. (mg/Kg)	Sample : 47.2	Duplicate % 56.7	Difference 7.7 20.1%	Accept Range +/- 30%

Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept Range
TPH	47.2	2,000	1,860	90.9%	80 - 120%

ND = Parameter not detected at the stated detection limit.

References: Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: QA/QC for Samples 54564, 54522, 54523, 54576, 54586, 54587, 54578.

Analyst



Chloride

Client: Williams Project #: 04108-0136 Sample ID: Rosa 31B Date Reported: 06-08-10 Lab ID#: 54587 Date Sampled: 06-03-10 Sample Matrix: Soil Date Received: 06-04-10 Preservative: 06-07-10 Date Analyzed: Condition: Chain of Custody: 9430 Intact

Parameter Concentration (mg/Kg)

Total Chloride 10

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Reference:

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

09428

CHAIN OF CUSTODY RECORD

Client:			CHA	AIN	IOF	CU	5		D	Y	₹E		O	KL)				U ツ	4 2	Ŏ		
Client:			Project Name / 1	Location	1:									ANAL	YSIS	/ PAF	AME	TERS	,				•
Willeam	<u> </u>		Rusa. Sampler Name:	31B																			
Client Address:]	Sampler Name:						5)	21)	6												
Client Address: 1215. Maen Client Phone No.:	<i>)</i>		Math Client No.:	Ba	Seple				TPH (Method 8015)	BTEX (Method 8021)	826	RCRA 8 Metals											
Client Phone No.:			Client No.:						g g	l ğ	ğ	eta	jë P				=	Ш				ᅙ	act
1034-4219			OV	10%	3-01	36			Wet	(Re	Met	8 8	Cation / Anion		TCLP with H/P		TPH (418.1)	CHLORIDE				Sample Cool	Sample Intact
Sample No./	Sample	Sample	Lab No.	5	Sample	No./Volume	Pre	servativ		X	ပ္ခ	A.	ţi		٩	<u>+</u>) I	밀				ğ.	m jg m
Identification	Date	Time	Lab No.	-	Matrix	of Containers	HgC1,	на	<u> </u>	B B	8	8	S	윤	12	PAH	<u> </u>	ᅙ				Sa	
P08231B	000	12:30	54587	Solid	Sludge Aqueous	1/402			X	X				1			X	X				7	Y
				Soil Solid	Sludge Aqueous	100																	
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
			#	Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
		,		Soll Solid	Sludge Aqueous																		
Relinquished by: (Signature) Relinquished by: (Signature)	ature)	ada	•		Date Pullo	7.00	F	Receiv	ed by:	(Signa	ature)									1	ate H/ID	3	me (2/)
Relinquished by: (Signature)	ature)	<i>)</i>				1.00	F	Receiv	ed by:	(Signa	ature)	· · · · · · ·											<i>T_/_</i>
Relinquished by: (Signa	ature)						F	Receiv	ed by:	(Signa	ature)										-		
			, 		<u> </u>	— -			. 1		_ 8_									<u> </u>		<u> </u>	***********



envirotech **Analytical Laboratory**

5796 US Highway 64 • Farmington, NM 87401 • 505-632-0615 • lab@envirotech-inc.com

DIST. 3

Williams Production Co., LLC San Juan Basin: New Mexico Assets Below-Grade Tank Removal

Closure Report

Well: (Rosa Unit#031B)
API No: 30-03926579

Location: D-S17-T31N-R05W, NMPM

In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

Prior to initiating any BGT Closure except in the case of an emergency, WPX will
review County Tax Records for the current landowner of record. The landowner of
record will be notified of the intent to closure the BGT by certified mail and a copy of
this notification will be included in the closure report. In the case of an emergency,
the landowner of record will be notified as soon as practical.

<u>Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.</u>

- Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

<u>Aztec District office was notified of Williams E&P intent to close on (08/16/2010). Email attached.</u>

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the Rosa Unit#031B separator and piped all liquids to the Produced Water Storage Tank.

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled to the Rosa Unit disposal wells listed</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

 The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

		 	
Components	Testing Methods	Closure Limits (mg/Kg)	Sample Results (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	ND	ND
BTEX	EPA SW-846 Method 8021B or 8260B	ND	ND
TPH	EPA SW-846 Method 418.1(1)	100	107
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	10

⁽¹⁾ Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area remains in use for production operations.

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical
 Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation