District I
1625 N French Dr , Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

### State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office. For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

131	
102	Propos
10	Type of action:

Pit, Closed-Loop System, Below-Grade Tank, or			
Proposed Alternative Method Permit or Closure Plan Application			
Type of action:    Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method   Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method   Modification to an existing permit			
Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system,			
below-grade tank, or proposed alternative method  Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request			
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the			
environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.			
Operator: XTO Energy, Inc. OGRID #: 5380			
Address: -382 Road 3100 Aztec, NM 87410			
Facility or well name: KUTZ J FEDERAL #2E			
API Number: 3004530755 OCD Permit Number:			
U/L or Qtr/Qtr Section 06I Township 27N Range 10W County: San Juan			
Center of Proposed Design: Latitude 36.60083 Longitude 107.93167 NAD: 1927 1983			
Surface Owner: Federal State Private Tribal Trust or Indian Allotment			
2.  Pit: Subsection F or G of 19.15.17.11 NMAC  RCVD JUN 25 '12			
Temporary: Drilling Workover OIL CONS. DIV.			
Permanent Emergency Cavitation P&A			
Lined Unlined Liner type: Thicknessmil LLDPE HDPE PVC Other			
String-Reinforced			
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D			
3.			
Closed-loop System: Subsection H of 19.15.17.11 NMAC			
Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent)			
Drying Pad Above Ground Steel Tanks Haul-off Bins Other			
☐ Lined ☐ Unlined Liner type: Thickness mil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other			
Intent)  Drying Pad			
4.			
Nelow-grade tank: Subsection I of 19.15.17.11 NMAC   Volume: 120			
Volume: 120 bbl Type of fluid: Produced Water			
Tank Construction material: Steel			
Secondary containment with leak detection  Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off			
Visible sidewalls and liner Wisible sidewalls only Wisible Sidewalls, vaulted, automatic high level shut off			
Liner type: Thicknessmil			
S.			
Alternative Method:  Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.			
Submittan of an exception request is required. Exceptions must be submitted to the Santa re Environmental Bureau office for consideration of approval.			

Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)  Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution or church)  Four foot height, four strands of barbed wire evenly spaced between one and four feet  Alternate. Please specify		
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)  Screen Netting Other  Monthly inspections (If netting or screening is not physically feasible)		
8.  Signs: Subsection C of 19.15.17.11 NMAC  ☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers  ☐ Signed in compliance with 19.15.3.103 NMAC		
Administrative Approvals and Exceptions:  Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.  Please check a hox if one or more of the following is requested, if not leave blank:  Administrative approval(s): Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau of consideration of approval.  Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	ffice for	
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to drying above-grade tanks associated with a closed-loop system.	priate district proval.	
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☒ No	
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes 🖾 No	
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  (Applies to temporary, emergency, or cavitation pits and below-grade tanks)  - Visual inspection (certification) of the proposed site; Acrial photo; Satellite image	☐ Yes ☒ No ☐ NA	
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  (Applies to permanent pits)	☐ Yes ☐ No ☑ NA	
- Visual inspection (certification) of the proposed site; Aerial photo; Satellite image  Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.  - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ⊠ No	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ⊠ No	
Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes 🛛 No	
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☒ No	
Within an unstable area.  - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	☐ Yes ⊠ No	
Within a 100-year floodplain FEMA map	☐ Yes ⊠ No	

Form C-144 Oil Conservation Division Page 2 of 5

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19 15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC  Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC  Design Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC
Previously Approved Design (attach copy of design) API Number: or Permit Number:
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9  Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC  Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC  Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design)  API Number:
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC   Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.   Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC   Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC   Climatological Factors Assessment   Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC   Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC   Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC   Quality Control/Quality Assurance Construction and Installation Plan   Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC   Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC   Nuisance or Hazardous Odors, including H <sub>2</sub> S, Prevention Plan   Gil Field Waste Stream Characterization   Monitoring and Inspection Plan   Erosion Control Plan   Erosion Control Plan   Erosion Control Plan   Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Proposed Closure: 19.15.17 13 NMAC  Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.  Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative  Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.  ☐ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC ☐ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC ☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) ☐ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC ☐ Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: (19.15.17.13. Instructions: Please indentify the facility or facilities for the disposal of liquids, drilling fluids and drill cuttings. Use attachment if facilities are required.	D NMAC) more than two		
Disposal Facility Name: Disposal Facility Permit Number:			
Disposal Facility Name: Disposal Facility Permit Number:			
Will any of the proposed closed-loop system operations and associated activities occur on or in areas that will not be used for future ser Yes (If yes, please provide the information below) No	·		
Required for impacted areas which will not be used for future service and operations.  Soil Backfill and Cover Design Specifications based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC  Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC	С		
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sou provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate disting considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. Just demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for guidance.	rict office or may be		
Ground water is less than 50 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No		
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA		
Ground water is more than 100 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No		
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No		
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	Yes No		
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.  - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site	☐ Yes ☐ No		
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended  - Written confirmation or verification from the municipality; Written approval obtained from the municipality	Yes No		
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ Ņo		
Within the area overlying a subsurface mine.  - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	Yes No		
Within an unstable area.  - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	Yes No		
Within a 100-year floodplain FEMA map	Yes No		
Son-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.    Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC   Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC   Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19.15.17.11 NMAC   Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19.15.17.13 NMAC   Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC   Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC   Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC   Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cannot be achieved)   Soil Cover Design - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC   Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC			

Operator Application Certification:  I hereby certify that the information submitted with this application is true, accur	rate and complete to the host of my knowledge and holiaf
1	Title: Environmental Representative
i/ ~ ( ) // ·	Date:August 19, 2008
e-mail address:kim_champlin@xtoenergy.com	Telephone:(505) 333-3100
OCD Approval: Permit Application (including closure plan) Closure	lan-fordy M C OCD Conditions (see attachment)
OCD Representative Signature: Band Fill	Sompliance Street
Title: Enviro/spec	OCD Parmit Number:
Closure Report (required within 60 days of closure completion): Subsection Instructions: Operators are required to obtain an approved closure plan prior to The closure report is required to be submitted to the division within 60 days of to section of the form until an approved closure plan has been obtained and the cl	to implementing any closure activities and submitting the closure report. The completion of the closure activities. Please do not complete this Tosure activities have been completed.
	☑ Closure Completion Date: 4/18/17
22. Closure Method:  Waste Excavation and Removal On-Site Closure Method Alternated If different from approved plan, please explain.	ative Closurc Method   Waste Removal (Closed-loop systems only)
Closure Report Regarding Waste Removal Closure For Closed-loop Systems Instructions: Please indentify the facility or facilities for where the liquids, dril two facilities were utilized.  Disposal Facility Name:	lling fluids and drill cuttings were disposed. Use attachment if more than
Disposal Facility Name:	Disposal Facility Permit Number:
Were the closed-loop system operations and associated activities performed on or  Yes (If yes, please demonstrate compliance to the items below) No	
Required for impacted areas which will not be used for future service and operation     Site Reclamation (Photo Documentation)     Soil Backfilling and Cover Installation     Re-vegetation Application Rates and Seeding Technique	ions:
24. Closure Report Attachment Checklist: Instructions: Each of the following it	tems must be attached to the closure report. Please indicate, by a check
mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and division)	ons must be unucled to the closure reports. I touse muteure, by a cheen
☐ Proof of Deed Notice (required for on-site closure) ☐ Plot Plan (for on-site closures and temporary pits) ☑ Confirmation Sampling Analytical Results (if applicable) ☐ Waste Material Sampling Analytical Results (required for on-site closure)	
Disposal Facility Name and Permit Number  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Technique  Site Reclamation (Photo Documentation)	•
On-site Closure Location: Latitude Longit	tude NAD: ☐1927 ☐ 1983
Operator Closure Certification:  I hereby certify that the information and attachments submitted with this closure is belief. I also certify that the closure complies with all applicable closure requirements.	ments and conditions specified in the approved closure plan.
Name (Print): Logan Hixon	
Signature: Jogu	, • · · · · · · · · · · · · · · · · · ·
e-mail address: LAGALA . Hi You O VTO enosgy ("AM	Telephone: 5(15) 333 3683

<u>District I</u> 1625 N. French Dr , Hobbs, NM 88240 District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410 1220 S St Francis Dr, Santa Fe, NM 87505

### State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back

Form C-141

Revised October 10, 2003

side of form

# Release Notification and Corrective Action

	OPERATOR		Report Final Repo	
Name of Company: XTO Energy, Inc.	Contact: Logan Hixon			
Address: 382 Road 3100, Aztec, New Mexico 87410 Telephone No.: (505) 333-3683				
Facility Name: Kutz J Federal #2E (30-045-30755)	Facility Type: Gas Well			
Surface Owner: Federal Land Mineral Owner	:	Lease No	o.: NMSF-077384	
LOCATIO	ON OF RELEASE	-		
		st/West Line	County	
I 6 27 N 10W 1645	FSL 1160	FEL	San Juan	
Latitude: N <u>36*.600</u>	83 Longitude: W-107*.93167			
NATURI	E OF RELEASE		,	
Type of Release: Produced Water	Volume of Release: Unknown		ecovered: None	
Source of Release: BGT	Date and Hour of Occurrence: Unknown	Date and I- January 5,	lour of Discovery. 2012	
Was Immediate Notice Given? ☐ Yes ☐ No ☒ Not Required	If YES, To Whom?			
By Whom?	Date and Hour:			
Was a Watercourse Reached?	If YES, Volume Impacting the W	/atercourse.		
☐ Yes ☒ No				
If a Watercourse was Impacted, Describe Fully.*				
Describe Cause of Problem and Remedial Action Taken.* The below grade tank was taken out of service at the Kutz J Federal #2E	E wall site due to the plugging on shor	adonina of this	wall sita. A camposita sample	
was collected beneath the location of the on-site BGT, and submitted fo				
BTEX via USEPA Method 8021, and for total chlorides. The sample ret	turned results below the 'Pit Rule' spi	Il confirmation	standards for Benzene, Total	
BTEX and the total chlorides, but above the 'pit rule' standards for TPH	I, confirming that a release has occurr	ed at this locati	on.	
Describe Area Affected and Cleanup Action Taken.*				
Based on TPH results of 257 PPM via USEPA Method 418.1, it has been confirmed that a release had occurred at this location.				
I hereby certify that the information given above is true and complete to	the best of my knowledge and under	stand that pursu	ant to NMOCD rules and	
regulations all operators are required to report and/or file certain release				
public health or the environment. The acceptance of a C-141 report by should their operations have failed to adequately investigate and remedi				
or the environment. In addition, NMOCD acceptance of a C-141 report				
federal, state, or local laws and/or regulations.	OH CONCE	NI A TRIONI	DHAGION	
	OIL CONSEI	<u> KVAHON</u>	DIVISION	
Signature: Logan History				
Approved by District Supervisor.				
Printed Name: Logan Hixon		1		
Title: Environmental Technician	Approval Date: Expiration Date:			
E-mail Address: Logan_Hixon@xtoenergy.com	Conditions of Approval:		Attached	
Date: 6/77/1/2 Phone: 505-333-3202				

# XTO Energy Inc. San Juan Basin Below Grade Tank Closure Report

Lease Name: Kutz J Federal #2E

API No.: 30-045-30755

Description: Unit I, Section 6, Township 27N, Range 10 W, San Juan County

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure requirements of below-grade tanks on XTO Energy Inc. (XTO) locations. This is XTO's standard procedure for all below-grade tanks. A separate plan will be submitted for any below-grade tank which does not conform to this plan.

#### **General Plan**

1. XTO will close below-grade tanks within the time periods provided in 19.15.17.13 NMAC, or by an earlier date that the division requires because of imminent danger to fresh water, public health or the environment.

Closure Date is June 18, 2012

2. XTO will close a below-grade tank that does not meet the requirements of Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC or is not included in Paragraph (5) of Subsection I of 19.15.17.11 NMAC within five years after June 16, 2008, if not retrofitted to comply with Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC.

Closure Date is June 18, 2012

3. XTO will close a permitted below-grade tank within 60 days of cessation of the below-grade tank's operation or as required by the transitional provisions of Subsection B of 19.15.17.17 NMAC in accordance with a closure plan that the appropriate division district office approves. The closure report will be filed on form C-144.

Required C-144 Form is attached to this document.

4. XTO will remove liquids and sludge from below-grade tanks prior to implementing a closure method and will dispose of the liquids and sludge in a division-approved facility. Approved facilities and waste streams include:

Envirotech Permit No. NM01-0011 and IEI Permit No. NM 01-0010B

Soil contaminated by exempt petroleum hydrocarbons

Produced sand, pit sludge and contaminated bottoms from storage of exempt wastes

Basin Disposal Permit No. NM01-005 Produced water

All liquids and sludge were removed from the tank prior to closure activities.

5. XTO will remove the below-grade tank and dispose of it in a division approved facility or recycle, reuse, or reclaim it in a manner that the appropriate division district office approves. XTO has removed the below grade tank, and will dispose of it at a division approved facility, or recycle, reclaim or reuse it in a manner that is approved by the division.

6. XTO will remove any on-site equipment associated with a below-grade tank unless the equipment is required for some other purpose.

All equipment has been removed due to the plugging and abandoning of the Kutz J Federal #2E well site.

At a minimum 5 point composite sample will be collected along with individual grab samples from any area that is wet, discolored or showing other evidence of a release. Samples will be analyzed for BTEX, TPH and chlorides to demonstrate that the benzene concentration, as determined by EPA SW-846 methods 8021B or 8260B or EPA method that the division approves, does not exceed 0.2 mg/kg; total BTEX concentration, as determined by EPA SW-846 methods 8021B or 8260B or other EPA method that the division approves, does not exceed 50 mg/kg; the TPH concentration, as determined by EPA method 418.1 or other EPA method that the division approves, does not exceed 100mg/kg; and the chloride concentration, as determined by EPA method 300.1 or other EPA method that the division approves, does not exceed 250 mg/kg, or the background concentration, whichever is greater. XTO will notify the division of its results on form C-141.

A five point composite sample was taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

Components	Test Method	Limit (mg/Kg)	Results
Benzene	EPA SW-846 8021B or 8260B	0.2	< 0.2 mg/Kg
BTEX	EPA SW-846 8021B or 8260B	50	< 50.0 mg/kg
ТРН	EPA SW-846 418.1	100	257 mg/Kg
Chlorides	EPA 300.1	250 or background	120 mg/Kg

8. If XTO or the division determines that a release has occurred, XTO will comply with 19.15.3.116 NMAC and 19.15.1.19NMAC as appropriate.

Due to TPH results of 257 PPM, a release has been confirmed for this location. A C-141 Release Notification form will be sent outlining any remediation activities taken regarding this release.

9. If the sampling program demonstrates that a release has not occurred or that any release does not exceed the concentrations specified in Paragraph (4) of Subsection E of 19.15.17.13 NMAC, XTO will backfill the excavation with compacted, non-waste containing, earthen material; construct a division prescribed soil cover; recontour and re-vegetate the site.

The pit cellar was backfilled using compacted, non-waste containing earthen material, with a division prescribed soil cover.

- 10. Notice of Closure operations will be given to the Aztec Division District III office between 72 hours and one week prior to the start of closure activities via email or verbally.

  The notification will include the following:
  - i. Operator's name
  - ii. Well Name and API Number
  - iii. Location by Unit Letter, Section, Township, and Range

Notification was provided to Mr. Brandon Powell with the Aztec office of the OCD via email on January 4, 2012; see attached email printout. Due to an unforeseen delay in plugging and abandonment schedule, notification was sent earlier than anticipated scheduling.

The surface owner shall be notified of XTO's proposal to close the BGT as per the approved closure plan using certified mail, return receipt requested.

The surface owner was notified on January 4, 2012 via email. Email has been approved as a means of surface owner notification to the BLM by Brandon Powell, NMOCD Aztec Office. Due to an unforeseen delay in plugging and abandonment schedule, notification was sent earlier than anticipated scheduling.

11. Re-contouring of location will match fit, shape, line, form and texture of the surrounding area. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be placed in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The location has been recontoured to match the above specifications.

12. A minimum of 4 feet of cover shall be achieved and the cover shall include 1 foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater.

The site has been backfilled to match these specifications.

- 13. XTO will seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM or Forest Service stipulated seed mixes will be used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs.

  Site will be reclaimed pursuant to the BLM MOU.
- 14. All closure activities will include proper documentation and be available for review upon request and will be submitted in closure report form to OCD within 60 days of closure of the below-grade tank. Closure report will be filed on form C-144 and incorporate the following:
  - i. Proof of closure notice to division and surface owner; attached
  - ii. Details on capping and covering, where applicable; per OCD Specifications
  - iii. Inspection reports; attached
  - iv. Confirmation sampling analytical results; attached
  - v. Disposal facility name(s) and permit number(s); see above
  - vi. Soil backfilling and cover installation; per OCD Specifications
  - vii. Re-vegetation application rates and seeding techniques, (or approved alternative to re-vegetation requirements if applicable); **Per BLM MOU.**
  - viii. Photo documentation of the site reclamation, attached



## EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	XTO	Project #:	98031-0528
Sample ID:	BGT Closure	Date Reported:	01-05-12
Laboratory Number:	60725	Date Sampled:	01-04-12
Chain of Custody No:	13121	Date Received:	01-04-12
Sample Matrix:	Soil	Date Extracted:	01-04-12
Preservative:	Cool	Date Analyzed:	01-05-12
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ИД	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

Kutz J Federal #2E

Analyst

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com aboratory@envirotech-inc.com



## y EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

## **Quality Assurance Report**

Client:	QA/QC	Project #:	N/A
Sample ID:	01-05-12 QA/QC	Date Reported:	01-05-12
Laboratory Number:	60725	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	01-05-12
Condition:	N/A	Analysis Requested:	TPH

	I-Cal Date	I-Cal RF	C-Cal RF: . %	Difference	Accept: Range
Gasoline Range C5 - C10	40913	9.996E+02	1.000E+03	0.04%	0 - 15%
Diesel Range C10 - C28	40913	9.996E+02	1.000E+03	0.04%	0 - 15%

Blank Conc. (mg/L - mg/Kg)	% Concentration : :: to	Detection Limit
Gasoline Range C5 - C10	3.49	0.2
Diesel Range C10 - C28	6.38	0.1

Duplicate Conc. (mg/Kg)	Sample Sy	Duplicate , (s	ω' % Difference :	Range
Gasoline Range C5 - C10	ND	ND	0.00%	0 - 30%
Diesel Range C10 - C28	ND	ND	0.00%	0 - 30%

Spike Conc. (mg/Kg)	Sample 🔻	Spike Addêd	Spike Result	% Recovery	Accept Range
Gasoline Range C5 - C10	ND	250	220	87.9%	75 - 125%
Diesel Range C10 - C28	DИ	250	235	93.8%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 60725-60728.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Analyst

Ph (505) 632-0615 Fx (505) 632-4865

Ph (970) 259-0615 Fr (800) 362-1879



#### **EPA METHOD 8021** AROMATIC VOLATILE ORGANICS

Client:	хто	Project #:	98031-0528
Sample ID:	BGT Closure	Date Reported:	01-05-12
Laboratory Number:	60725	Date Sampled:	01-04-12
Chain of Custody:	13121	Date Received:	01-04-12
Sample Matrix:	Soil	Date Analyzed:	01-05-12
Preservative:	Cool	Date Extracted:	01-04-12
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

		· · · · · · · · · · · · · · · · · · ·	
		Det.	
	Concentration	Limit	
Parameter	(ug/Kg)	(ug/Kg)	

Benzene	ND	10.0
Toluene	ND	10.0
Ethylbenzene	ND	10.0
p,m-Xylene	ND	10.0
o-Xylene	ND	10.0
-		

**Total BTEX** ND

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	85.2 `%
	1,4-difluorobenzene	82.3 %
	Bromochlorobenzene	82.6 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Kutz J Federal #2E

Analyst

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301







# EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A	Р	roject#:	N	I/A
Sample ID:	0105BBLK QA/QC	a	ate Reported:	0	1-05-12
Laboratory Number:	60725	Đ	ate Sampled:	N	I/A
Sample Matrix:	Soil	Ď	ate Received:	N	I/A
Preservative:	N/A	Ď	ate Analyzed:	.0	1-05-12
Condition:	N/A		nalysis:	-B	STEX
		D	ilution:	10	)
Calibration and Detection Limits (ug/L)	I-Cal RF:	C-Cal RF: Accept: Range	A. K. C.	Blank Conc	Detect. Limit
Benzene	2.0718E+007	2 0759E+007	0.2%	ND	1.0
Tolueñe	2.1276E+007	2.1319E+007	0.2%	ND	1.0
Ethylbenzene	1.9045E+,007	1.9084E+007	0.2%	ND	1.0
p,m-Xylene	4.8336E+007	4 8433E+007	0.2%	ND	1.0
- V I	4 77407 007		0.00/	A I PO	4.0
o-Xylene	1.7518E+007	1.7553E+007 <sup>1</sup>	0.2%	ND	1.0
	1.7518E+007			ND Accept Range	
Duplicate Conc. (ug/Kg)			. 3. %Diff <b>%</b> ← . 0:0%	Accept Range	Detect Limit:
Duplicate Conc. (ug/Kg) Benzene	Sample		%. %Diff.	Accept Range	Detect Limit:
	Sample ND	Duplicate	. 3. %Diff <b>%</b> ← . 0:0%	Accept Range	Detect Limit:
Duplicate Conc. (ug/Kg) Benzene Toluene	Sample ND ND	Duplicate ND ND ND	%%Diff	Accept Range: 0 - 30% 0 - 30%	Detect Limit: 10.0 10.0 10.0

Spike Conc. (ug/Kg)	Sample Amo	ount Spiked & Spik	ed Sample %	Recovery	Accept Range
Benzene	ND	500	477	95:3%	39 - 150
Toluene	ND	500	488	97.6%	46 - 148
Ethylbenzene	ND	500	481	96.2%	32 160
p,m-Xylene	ND	1000	972	97.2%	46 - 148
o-Xylene	ND	500	495	99.0%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 60725, 60727-60728.

Analyst

Review

\_

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879





Çlient:	XTO	Project #:	.98031-0528
Sample ID:	BGT Closure	Date Reported:	01-05-12
Laboratory Number:	60725	Date-Sampled:	01-04-12
Chain of Custody No:	13121	Date Received:	01-04-12
Sample Matrix:	Soil	Date Extracted:	01-05-12
Preservative:	Cool	Date Analyzed:	01-05-12
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

257

18.2

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:


Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Kutz J Federal #2E

5796 US Highway 64, Pall Mington, NM 87401

Ph (505) 632-0615 Fx (505) 632

Ph (970) 259-0615 Fr (800) 362-1879

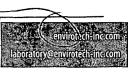



# **EPA METHOD 418.1** Analytical LaboratorOTAL PETROLEUM HYDROCARBONS QUALITY ASSURANCE REPORT

Client:	QA/QC
Sample ID:	QA/QC

Project #: Date Reported: N/A 01-05-12

Laboratory Number:

01-04-TPH.QA/QC 60725

Date Sampled:

N/A

Sample Matrix:

Freon-113

Date Analyzed:

01-05-12

Preservative:

Condition:

N/A N/A

Date Extracted: Analysis Needed: 01-05-12 TPH

Calibration 💮

L'Cal Date ..... C-Cal Date .... I-Cal RF .... C-Cal RF ... % Difference Accept Range 11-16-11 01-05-12

1.610

1,670

3.7%

**\*/- 10%** 

Blank Conc. (mg/Kg)

Concentration

Detection Limit

TPH

ND

6.4

Duplicate Conc. (mg/Kg) TPH

Sample' 257

295

15.0%

Duplicate: % Difference Accept: Range **+/- 30%** 

TPH

Sample 257

2,000

1,860

82.4%

Spike Added Spike Result % Recovery Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 60725

Analyst

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fr (800) 362-1879

5796 US Highway 64, Farmington, NM 87401



#### Chloride

Client:

XTO

Project #:

98031-0528

Sample ID:

**BGT** Closure

Date Reported:

01-05-12

Lab ID#:

60725

Date Sampled:

01-04-12

Sample Matrix:

Soil

Date Received:

01-04-12

Preservative:

Cool

Date Analyzed:

01-05-12

Condition:

Intact

Chain of Custody:

13121

**Parameter** 

Concentration (mg/Kg)

**Total Chloride** 

120

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.


Comments:

Kutz J Federal #2E

5796 of Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1869

Ph (970) 259-0615 Fr (800) 362-1879

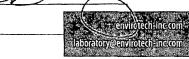

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

# CHAIN OF CUSTODY RECORD

Client: Project Name / Location:  KUTZ J PEDERAL # ZE								ANALYSIS / PARAMETERS														
Email results to: Sampler Name:  AAMES MCDINIC BROOGS									3015)	(8021)	8260)	S				-						,
Client Phone No.: Client No.: 980				131-0528			TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion		TCLP with H/P	CO Table 910-1	TPH (418.1)	CHLORIDE				Sample Intact		
Sample No./ Identification	Sample Date	Sample Time	Lab No.	No.	/Volume ontainers		reserva HCI	tive	TPH (	BTEX	0 0 0 0	RCRA	Cation	-Sc	TCLP	00	TPH (	CHLC				Samp
BET CLOSUPE	1/4	1422	60725	2	407				X	X							X	X			Y	1
				<u> </u>		+																
						-																
									_												_	
																					+	
														_							+	
									_	-											+	
Relinquished by: (Signature)  Bl Gff				Date	Time	Rece	ived b	y: (Si	gnati	ure)	0	12 pr			1			,		Da 1/4	e     121	Time (ごり
Relinquished by: (Signature)						Rece	lved b	y: (Si	gnatu	ure)												
Sample Matrix Soil Solid Sludge Aqueous Other																						
Sample(s) dropped off after	hours to sec	cure drop	off area.	3	PNV Ana	III (	ol La	e C	] Itory			P	<i>U</i> -	s t	<del>-</del>	1				<u>-</u>		
5795 US Highway 64	Farmingto	ン on; NM 874	401 • 505-632-0615 • 1	- Three Spr	ings • 65 l	Merca	do Stre	et, Su	uite 1	15, Du	ırang	o, C(	D 813	01 • 1	abore	atory	@env	rirote	ch-inc	.com		-



### James McDaniel /FAR/CTOC

01/04/2012 08:13 AM

To Mark\_Kelly@blm.gov

cc bcc

Subject BGT Closure Notifications

Mark,

Please accept this email as the required notification for BGT Closure activities at the following well sites:

Kutz J Federal #2E - 30-034-30755 - Unit I, Section 6, Township 27N, Range 10W, San Juan County, New Mexico

O H Randel 14 #1E - 30-045-34010 - Unit M, Section 14, Township 26N, Range 11W, San Juan County, New Mexico

The BGTs at both of these well sites are being closed due to the plugging and abandoning of the well sites. Thank you for your time in regards to this matter.



James McDaniel, CHMM #15676

EH&S Supervisor XTO Energy, Inc. omce#505333-3701

Cell # 505-787-0519 James Mcdanlet@xtoenergy.com



### James McDaniel /FAR/CTOC 01/04/2012 08:12 AM

To brandon.powell@state.nm.us

CC

bcc

Subject BGT Closures

Brandon,

Please accept this email as the required notification for BGT Closure activities at the following well sites:

Kutz J Federal #2E - 30-034-30755 - Unit I, Section 6, Township 27N, Range 10W, San Juan County, New Mexico

O H Randel 14 #1E - 30-045-34010 - Unit M, Section 14, Township 26N, Range 11W, San Juan County, New Mexico

The BGTs at both of these well sites are being closed due to the plugging and abandoning of the well sites. Thank you for your time in regards to this matter.



James McDaniel, CHMM #15676

EH&S Supervisor XTO Energy, Inc. omice # 505:333-3701 cell#:505-787-0519

James Mcdaniel Extoenergy.com



# Well Below Tank Inspection Report

Township

27N

ENERGY	StopName KUTZ J FEDERAL	Pumper 02E Brown Zacharv	Foreman Sanders, Davi	WellNam d KUTZ J			APIWellNum 3004530755		Section 6	Range 10W
InspectorName Inspection Date  LDR 08/07/200	Time LinerTo	VisibleTankLeak ears Overflow No	Collection OfSurfaceRun No	Visible LayerOıl Yes	Visible Leak No	Freeboard EstFT 1	PitLocation	PitTvpe	Notes	
Trent Willis 10/06/200		No	No	Yes	No	1			New Seperato	r.
ldr 11/04/200	8 1405 00 <b>N</b> o	No	No	Yes	No	1	Well Water F	P Below C	New Seperato	۲.
ldr 12/05/200	8 100 <sup>.</sup> 00 <b>N</b> o	No	No	Yes	No	1	Well Water F	P Below 0	New Seperato	г.
Trent Willis 01/29/200	9 14:55 <b>N</b> o	No	No	Yes	No	2	Well Water F	Pr Below C	Ground	
LDR 02/28/200	9 09:00 <b>N</b> o	No	No	Yes	No	3	Well Water F	Pi Below C	Fround	
gary ward 03/04/200	9 14:10 <b>N</b> o	No	No	Yes	No	3	Well Water F	Pi Below C	Ground	
GARY WARD 04/15/200	9 11:34 <b>N</b> o	No	No	Yes	No	2	Well Water F	Pi Below G	Ground	
GARY WARD 05/25/200	9 11:02 <b>N</b> o	No	No	Yes	No	4	Well Water F	PiBelow G	Ground	
GARY WARD 06/24/200	9 12:03 · No	No	No	Yes	No	3	Well Water F	PiBelow G	Ground	
GARY WARD 07/17/200	9 12.07 <b>N</b> o	No	No	Yes	No	3	Well Water F	P Below G	Ground	
GARY WARD 08/17/200	9 11 30 <b>N</b> o	No	No	Yes	No	5	Well Water F	Below G	Ground	
GARY WARD 09/10/200	9 10.52 <b>N</b> o	No	No	Yes	No	3	Well Water F	Pi Below G	Ground	
GARY WARD 10/22/200	9 14 <sup>.</sup> 06 <b>N</b> o	No	No	Yes	No	5	Well Water F	Pi Below G	Ground	
LDR 11/26/200	9 14 00 <b>N</b> o	No	No	Yes	No	5	Well Water F	Below G	Ground	
GARY WARD 12/21/200	9 11 <b>44 N</b> o	No	No	Yes	No	4	Well Water F	Pi Below G	Fround	
GARY WARD 01/29/201	0 14 <sup>.</sup> 11 <b>N</b> o	No	No	Yes	No	3	Well Water F	Pi Below G	Fround	
GARY WARD 02/20/201	0 10 58 <b>N</b> o	No	No	Yes	No	5	Well Water F	Pi Below G	Ground	
GARY WARD 03/12/201	0 10 <sup>.</sup> 34 <b>N</b> o	No	No	Yes	No	2	Well Water F	Below G	Ground	
GARY WARD 04/12/201	0 12 <sup>.</sup> 40 <b>N</b> o	No	No	Yes	No	3	Well Water F	PiBelow G	Fround	
LDR 05/11/201	0 12 <sup>.</sup> 25 <b>N</b> o	No	No	Yes	No	5	Well Water F	Below G	Fround	
GARY WARD 06/06/201	0 14 20 No	No	No	Yes	No .	4	Well Water F	Below G	round	
kolby durham 07/05/201	0 08 <sup>.</sup> 26 <b>N</b> o	No	No	Yes	No	4	Well Water F	Below G	iround	
GARY WARD 08/05/201	) 12·42 <b>N</b> o	No	No	Yes	No	3	Well Water F	Below G	iround	
GARY WARD 09/06/201	0 12:29 <b>N</b> o	No	No	Yes	No	3	Well Water P	Below G	iround	
GARY WARD 10/05/201	0 14.52 No	No	No	Yes	No	4	Well Water P	Below G	round	
LDR 11/12/201	0 10 <sup>.</sup> 15 No	No	No	Yes	No	3	Well Water P	Below G	round	
LDR 12/04/201	0 03.00 No	No	No	Yes	No	4	Well Water P	Below G	round	
LDR 02/12/201	1 01 <sup>.</sup> 45 <b>N</b> o	No	No	Yes	No	3	Well Water P	PiBelow G	round	

LDR	03/08/2011	10 <sup>.</sup> 25	No	No	No	Yes	No	3	Well Water Pi Below Ground
GARY WARD	04/11/2011	13 36	No	No	No	Yes	No	1	Well Water Pi Below Ground
LDR	05/03/2011	09.48	No	No	No	Yes	No	2	Well Water Pi Below Ground

# XTO Energy, Inc. Kutz J Federal #2E Section 6, Township 27N, Range 10W Closure Date 6/18/2012

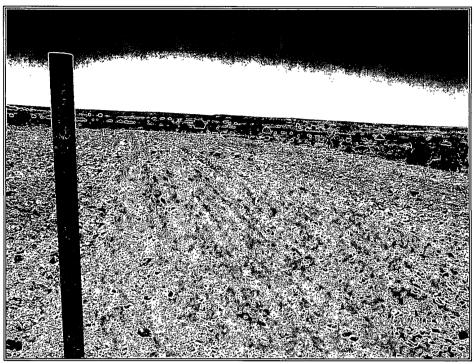


Photo 1: Kutz J Federal #2E after Reclamation.

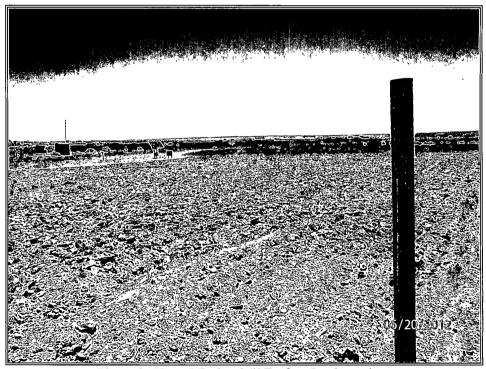


Photo 2: Kutz J Federal #2E after Reclamation.

## XTO Energy, Inc. Kutz J Federal #2E Section 6, Township 27N, Range 10W Closure Date 6/18/2012



Photo 3: Kutz J Federal #2E after Reclamation.

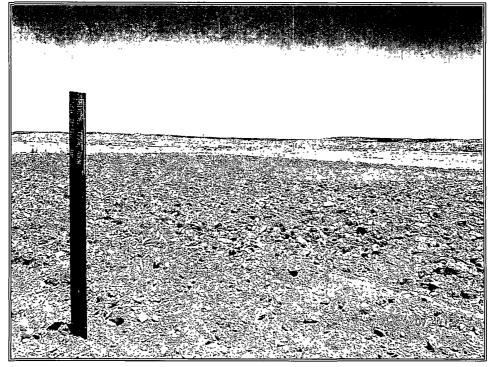


Photo 4: Kutz J Federal #2E after Reclamation.