

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Form C-141
Revised August 8, 2011

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office to
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company Burlington Resources Oil & Gas Company	Contact Crystal Tafoya
Address 3401 East 30th St, Farmington, NM	Telephone No. (505) 326-9837
Facility Name: San Juan 30-6 Unit 400	Facility Type: Gas Well

Surface Owner Bureau of Reclamation	Mineral Owner BLM (NMMN-012573)	API No. 30-039-23934
--	--	-----------------------------

LOCATION OF RELEASE

Unit Letter M	Section 14	Township 30N	Range 7W	Feet from the 300	North/South Line South.	Feet from the 990	East/West Line West	County Rio Arriba
-------------------------	----------------------	------------------------	--------------------	-----------------------------	-----------------------------------	-----------------------------	-------------------------------	-----------------------------

Latitude 36.80604 Longitude 107.5451

NATURE OF RELEASE

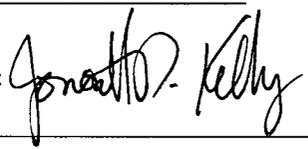
Type of Release Natural Gas, Produced Water, Lube Oil	Volume of Release 300mcf/15gal/15gal	Volume Recovered None
Source of Release Line hose	Date and Hour of Occurrence Approximately 4/1/2013 - 4/10/2013	Date and Hour of Discovery 4/10/2013 at 12:5pm
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? BLM (Mark Kelly) and OCD (Jonathan Kelly)	
By Whom? Crystal Tafoya	Date and Hour 4/23/13 at 7:00am-calculation completed 4/22/13	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.* N/A	RCVD APR 26 '13 OIL CONS. DIV. DIST. 3
---	---

Describe Cause of Problem and Remedial Action Taken.*
The 2" fuel line to the compressor had a pin hole leak found on 4/10/2013. The compressor was immediately shut down and the location blew down. Telemetry was used to determine the duration of the release from 4/1 - 4/10. The calculation was completed on 4/22/13 and resulted in 300mcf of Fruitland Coal natural gas being released. Along with the natural gas was 15gal of produced water and 15gal of lube oil.

Describe Area Affected and Cleanup Action Taken.*
The impacted soil was removed and transported to an approved disposal facility and remaining soil was treated in place. The fuel line was replaced and the well will be turned on when possible. No further action will be taken.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Crystal Tafoya	Approved by Environmental Specialist: 	
Title: Field Environmental Specialist	Approval Date: 11/8/2013	Expiration Date:
E-mail Address: crystal.tafoya@conocophillips.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 4/24/2013 Phone: (505) 326-9837		

* Attach Additional Sheets If Necessary

NSK 1331253958