

submitted in lieu of Form 3160-5

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Sundry Notices and Reports on Wells

2006 MAR 23 PM 2 36

RECEIVED

010 FARMINGTON, NM

1. Type of Well
Oil

15. Lease Number
Contract #70

6. If Indian, All. or
Tribe Name
Jicarilla Apache

7. Unit Agreement Name

2. Name of Operator
Golden Oil Holding Corporation

8. Well Name & Number
Jicarilla #70-7

3. Address & Phone No. of Operator
2200 Post Oak Blvd., Suite 720, Houston, TX 77027 713-626-1110

9. API Well No.
30-039-21827

Location of Well, Footage, Sec., T, R, M

10. Field and Pool
So. Lindrith GI-Dk

1850' FSL & 790' FEL, Section 27, T-24-N, R-4-W, Unit I

11. County & State
Rio Arriba, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☒ Casing Repair

☐ Altering Casing

☐ Other


☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

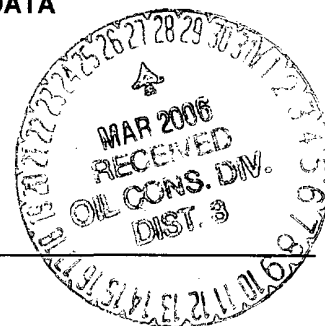

13. Describe Proposed or Completed Operations

Golden Oil repaired the 4.5" casing and returned this well to production.

Work performed from 2/23/06 to 3/7/06:

MOL, RU, pull rods. Pull 2.375" tubing; found hole at 4675'. Set RBP at 6126'; replace several joints tubing. Isolate casing leak from 4803' to 4931'. Set packer at 4547'. Squeeze leak with 280 sxs (370 cf) Type III cement; final pressure 900 psi. Drill out cement from 4685' to 4913'. Pressure test 4.5" casing to 800#; held OK for 30 minutes. Pull RBP. Land 229 joints 2.375" tubing at 7352' KB with 1 joint tail pipe, 4' perfed sub, SN at 7316', and then 228 joints tubing. Ran rods and pump. RD and MOL.

14. I hereby certify that the foregoing is true and correct.

Signed

Daryl Emmer
Daryl Emmer

Title

Director of Operations

Date

March 8, 2006

(This space for Federal or State Office use)

APPROVED BY

Title

DATE 2 4 2006

CONDITION OF APPROVAL, if any:

FARMINGTON OFFICE

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

NMOC

26440

Date 2-23-06 Day THU

Company GOLDEN OIL

FROM	TO	DESCRIPTION OF OPERATION
9:30	10:15	ROAD Rig & equip To Loc.
10:15	12:00	R-u Rig & Pump.
12:00	12:30	Check PSI on Well, CSG & TBG O# OPEN well UP. HANG well OFF.
12:30		PUMP 4 BBLs 3% KEL WATER D-N The TBG & CATCH Pressure. Pumping 1 1/2 BPM @ 1000#. PUMP 7 more BBLs 3% KEL & BREAK CIRC OUT CSG.
	1:00	R-u To Pull RODS.
1:00	1:30	P-u on RODS, RODS STUCK WORK RODS Free.
1:30	3:45	POOH with RODS & Pump 78-7/8" & 213-3/4" RODS.
3:45		XO For TBG, N-D W-H N-U & TEST BOP. R-u Rig floor & TBG equip.
	5:00	SHOT Well IN.
5:00	5:30	DRAIN Pump & LINES. SOFAL.
5:30	7:30	TRAVEL To YARD.
		(10 HRS)

Wireline _____

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	46		10
Derrick	P. Montes			10
Floors	N. Herrera			10
Floors	M. Montanez			10
Floors *	Tony Ochoa			10

20.

Rig No. # 8

Date 2-24-06 Day Fri

Well Name Jic #70-7

Company Golden oil

13 HCS.

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing _____

Wireline _____

CREW	NAME	UNIT	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		13
Derrick	P. Montes			13
Floors	N. Herrera			13
Floors	M. Montanez			13
Floors				

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

26250

Rig No. #8

Date 2-27-06 Day mon

Well Name Jic #70-7

Company Golden oil.

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:30	TRAVEL TO LOC.
7:30	8:00	START RIG & EQUIP. HELD SAFETY MTG (TOPIC) JSA.
8:00	9:30	POOH WITH SCRAPER & BIT
9:30		TIH WITH 4 1/2" DHS RBP & PACKER. SET B-P @ 6126'. Pull over JT
	11:30	& SET PACKER @ 6094'
11:30		LOAD THE TBG WITH 3 BBLs 3% KCL WATER TRY TO TEST B-P NO TEST.
		DROP STANDING VALVE. PUMP 3 BBLs 3% KCL WATER D-N THE TBG, TBG
	12:00	WOULD NOT TEST.
12:00		POOH WITH TBG TO 4500' WCT TBG, TBG STANDING FULL OF WATER. TRY TO TEST
		TBG, TBG WOULD NOT TEST. R-U TO FISH STANDING VALVE. TIH & FISH STANDING
		VALVE. POOH. PUT NEW CUPS ON STANDING VALVE. DROP STANDING VALVE. TRY
	2:00	TO TEST TBG, TBG WOULD NOT TEST.
2:00		POOH & FOUND SMALL SPLIT IN TBG @ 2209'. REPLACE BAD JT. TEST TBG TO
		1200". TIH 16 STDS TEST TBG TO 1200" OK. TIH 12 STDS. TEST TBG TO 1200"
		OK. TIH 12 STDS. TEST TBG TO 1200" OK. TIH 12 STDS. TEST TBG TO 1200"
	4:15	OK. TIH 8 STDS TEST TBG TO 1200" OK.
4:15		R-U TO FISH STANDING VALVE. TIH & FISH STANDING VALVE. POOH. R-D
	5:00	FISH EQUIP. R-U TOWERS. SHUT WELL IN SDPN.
5:00	7:00	TRAVEL TO YARD.
		13 1/2 HRS

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing _____

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		13 1/2
Derrick	P. Montez			13 1/2
Floors	N. Herrera			13 1/2
Floors	M. Montanez			13 1/2
Floors				

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

26576

Rig No. # 8

Date 2-28-06 Day Tue

Well Name Jic #70-7

Company GOLDEN OIL.

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:30	TRAVEL TO LOC.
7:30	8:00	START Rig & equip. HELD SAFETY mtg (TOPIC) TSA.
8:00	8:20	R-U Pump & Lines.
8:20		LOAD The Hole With 6 BBLs WATER. Try To Test CSG, CSG WOULD NOT TEST.
	8:40	SET PACKER @ 6,094'. TEST B-P TO 1000" OK.
8:40		POOH With TBG & PACKER TO 5,443'. LOAD & Circ The Hole Clean With 84 BBLs 3% KCL WATER. TEST CSG TO 800" From 5443' TO B-P @ 6,126' OK
	9:15	& From 5443' To Surf NO TEST.
9:15	9:30	POOH With TBG & PACKER TO 4085'
9:30	2:00	ISOLATE Holes IN CSG BETWEEN 4803' & 4931'
2:00		POOH With TBG & PACKER TO 4547'. DUMP SAND ON RBP.
	3:00	DRAIN Pump & Lines. SHUT well IN SDFN.
3:00	5:00	TRAVEL TO YARD.
		11 1/2 Hrs

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing _____

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		11 1/2
Derrick	P. MONTES			11 1/2
Floors	N. HERRERA			11 1/2
Floors	M. MONTANEZ			11 1/2
Floors *	LYNN SANGUVAL			11 1/3

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

26577

Rig No. H8

Date 3-1-06 Day Wed

Well Name Jic # 70-7

Company Golden oil

[illegible]

Fuel & Motor Oil _____ Water Hauled 1-Load Fresh + 1-Load Prod. "265 L.m

Rental Equipment _____ Cement Retainers _____

Cementing ^{14.9#} P-# 1-280 SKS

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		10 1/2
Derrick	P. MONTES			10 1/2
Floors	N. Herrera			10 1/2
Floors	M. MONTANEZ			10 1/2
Floors				

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

26578

Rig No. # 8

Date 3-2-06 Day THU

Well Name Jic # 70-7

Company Golden oil

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:30	TRAVEL TO LOC.
7:30	8:00	START RIG & EQUIP. HOLD SAFETY MTG (TOPIC) JSA.
8:00	8:30	OPEN UNLOADER & LET WELL EQUILIZE. RELEASE PACKER.
8:30	10:00	POOH WITH TBG & PACKER & RET HEAD.
10:00	11:30	TIE WITH TBG & 3 7/8" RETIP TOOTH BIT & TAG TAG @ 4685'
11:30	12:15	R-D TBG EQUIP. R-U DRILLING EQUIP.
12:15		DRILL CEMENT FROM 4685' TO 4836' WITH 6000# ON BIT 108 RPM & 500# PUMP PRESSURE. TEST CSG TO 800# @ 4836' OK. DRILL CEMENT FROM 4836' TO 4868'.
4:00	4:30	CIRC WELL CLEAN. TEST CSG TO 800# OK. SHUT WELL IN.
4:30	5:00	DRAIN PUMP & LINES. SDFN.
5:00	7:00	TRAVEL TO YARD.
		13 1/2 HRS

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing _____

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes.	35		13 1/2
Derrick	P. MONTES			13 1/2
Floors	N. Herrera			13 1/2
Floors	M. MONTANEZ			13 1/2
Floors *	LYND SANDOVAL			13 1/2

RCI - 090576A

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499

505-325-2627 • FAX (505) 325-1211

26579

Rig No. # 8

Date 3-3-06 Day Fri

Well Name Jic # 70-7

Company GOLDEN OIL

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:30	TRAVEL TO LOC.
7:30	8:00	START RIG & EQUIP. HELD SAFETY MTG (TOPIC) ISA.
8:00	8:30	R-U PUMP & LINES
8:30		DRILL CEMENT FROM 4868' TO 4900' 6000# ON BIT 104 RPM & 500#
		PUMP PRESSURE. TEST CSG TO 800# OK. DRILL CEMENT FROM 4900' &
	9:30	FALL OUT OF CEMENT @ 4913' CHECK FOR STRINGERS TO 4963'
9:30	10:30	CIRC WELL CLEAN. TEST CSG TO 800# HELD FOR 30 MIN OK.
10:30	10:45	R-D DRILLING EQUIP. R-U TBG EQUIP.
10:45	12:00	POOH WITH TBG & BIT
12:00	1:30	TIH WITH TBG & 4 1/2" CSG SCRAPER TO 5000'
1:30	3:00	POOH WITH TBG & SCRAPER. SHOW WELL IN. SD&N.
3:00	5:00	TRAVEL TO YARD.
		(11 1/2 HRS)

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing _____

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		11 1/2
Derrick	P. Montes			11 1/2
Floors	N. Herrera			11 1/2
Floors	* M. MONTANEZ			11 1/2
Floors *	LINO SANDOVAL			11 1/2

RCI - 090576A

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499

505-325-2627 • FAX (505) 325-1211

26580

Rig No # 8

Date 3-6-06 Day mon

Well Name Jic # 70-7

Company GOLDEN OIL

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:30	TRAVEL TO LOC.
7:30	8:00	START Rig & equip. HELD SAFETY mtg (Topic) JSA.
8:00	9:30	TiH with Ret Head & TAG @ 6072'
9:30	10:00	R-U Pump & Lines.
10:00	11:15	Clean out Fill (SAND & SHALE) To RBP. Circ Well Clean. Get on B-P.
11:15	1:00	POOH with TBG & RBP.
1:00		TiH with Prod TBG. & Land Well @ 7352' K-B SN @ 7316' K-B.
	3:30	1 JT Tail Pipe 4' Perf SUB S-N & 228 JTS 2 3/8" Euc 4.7" TBG.
3:30		R-D TBG equip & Rig floor. N-D BOP. N-U W-H. Xd for RODS. SHUT
	4:30	Well IN.
4:30	5:00	DRAIN Pump & Lines. SDFAL.
5:00	7:00	TRAVEL TO YARD.
		(13 1/2 Hrs)

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing

Wireline

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		13½
Derrick	P. Montes			13½
Floors	N. Herrera			13½
Floors	M. Montanez			13½
Floors	L. J. J. S. S. S.			

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499

505-325-2627 • FAX (505) 325-1211

26581

Rig No. 48

Date 3-7-06 Day Tue

Well Name Jic #70-7

Company Golden oil

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:30	TRAVEL TO LOC.
7:30	8:00	START Rig & equip. Held safety mtg (Topic) JSA.
8:00	9:00	Service Rig & Pump.
9:00	11:00	TIM with Rods & TOP Hole D-u Pump. 213-3/4" & 76-7/8" & 8' & 3-4' Pony SUBS.
11:00	12:30	SPACE Well out. HANG Well on. N-U Well Head.
12:30	2:30	R-D Rig & Pump & Pit. mol.
2:30	4:30	TRAVEL TO YARD & Rig Time
		(11 Hrs)

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing

Wireline _____

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	R. Whiteley	57		
Operator	A. Reyes	35		11
Derrick	P. Montes			11
Floors	N. Herrera			11
Floors	M. Montanez			11
Floors				