

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

N.M. 02854

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐		7. UNIT AGREEMENT NAME Carracas Mesa Unit
2. NAME OF OPERATOR Belco Petroleum Corporation		8. FARM OR LEASE NAME Carracas Mesa Unit
3. ADDRESS OF OPERATOR 630 Third Avenue, New York, New York		9. WELL NO. 1-26
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1040 FNL, 1040 FNL, Sec. 26, T32N, R5W		10. FIELD AND POOL, OR WILDCAT Basin Dakota
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 26, T32N, R5W
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 7113 K.B.		12. COUNTY OR PARISH Rio Arriba
		13. STATE N. Mex.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data



NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☒	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Ran 11 jts. 10-3/4 H40, 32.75# New Spang csg. to 318' K.B.
Cemented 2/300 sks. Reg. w/2% C.C. to surface.
Ran Schlumberger, IES, Gamma Ray-Sonic w/Caliper, Formation Density, Amplitude Sonic.
DST #1 8779-8820 Misrun.
Ran 277 jts. 4-1/2 11.60# N-80 New Spang csg. to 8833' K.B.
Cemented w/370 sks. 50-50 Pozmix; 1st 140 sks. w/6% Gel, next 230 sks. w/2% Gel.
Calculated cement top at 8000'
Plug down at 2:10 P.M., 7-10-65.

Tested csg. 2500# o.k.

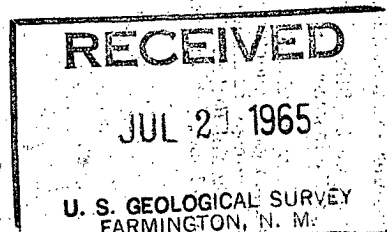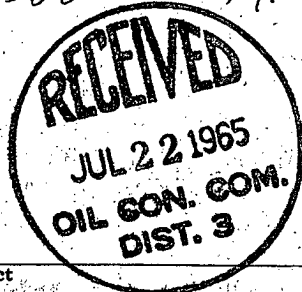

18. I hereby certify that the foregoing is true and correct

SIGNED *Edw. J. Sukrey*

TITLE **Drilling Supt.**

DATE **7-12-65**

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____