

District I - (505) 393-6161

P.O. Box 1940

Hobbs, NM 88241-1980

District II - (505) 748-1283

811 South First

Artesia, NM 88210

District III - (505) 334-6178

1000 Rio Brazos Road

Aztec, NM 87410

District IV - (505) 827-7131

State of New Mexico

Energy Minerals and Natural Resources Department

Oil Conservation Division


2040 South Pacheco Street

Santa Fe, New Mexico 87505

(505) 827-7131

Form C-141
Originated 2/13/97

Submit 2 copies to:
Appropriate District
Office in accordance
with Rule 116.

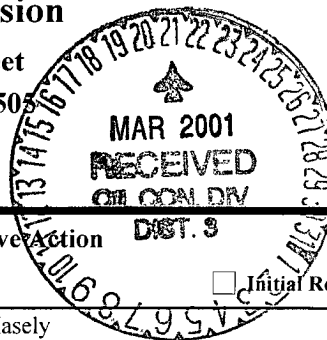

Release Notification and Corrective Action

OPERATOR

☐ Initial Report

☒ Final Report

Name:	Burlington Resources	Contact:	Ed Hasely
Address:	P.O. Box 4289 Farmington NM 87499	Telephone No.:	(505) 326-9841
Facility Name:	VAUGHN 13M	Facility Type:	Gas Well

Surface Owner:	Federal	Mineral Owner:	Federal	Lease Number:	NMSF-079266
----------------	---------	----------------	---------	---------------	-------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet From the	North/South Line	Feet From the	East/West Line	County: Rio Arriba
O	27	026N	006W	840	South	1650	East	

NATURE OF RELEASE

Type of Release:	Condensate and Produced Water	Volume of Release:	84 BBLS.	Volume Recovered:	5 BBLS.
Source of Release:	Condensate Tank	Date and Hour of Occurrence:	3/19/2001	Date and Hour of Discovery:	3/19/2001
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If Yes, To Whom?	Frank Chavez		
By Whom?	Ed Hasely	Date and Hour:	3/19/2001 3:15:00 PM		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	0		

If a Watercourse was Impacted, Describe Fully. (Attach Additional Sheets If Necessary)

NA

Describe Cause of Problem and Remedial Action Taken. (Attach Additional Sheets If Necessary)

The drain valve on the condensate tank (#3277) froze and broke. Approximately 67 bbls of condensate and 17 bbls of produced water leaked into the bermed area. A new valve was installed.

Describe Area Affected and Cleanup Action Taken. (Attach Additional Sheets If Necessary)

All fluids were contained inside the bermed area. A vacuum truck recovered 5 bbls of condensate. The impacted soils will be excavated and landfarmed on location.

A message was left w/ Mark Kelly (BLM) at 3:15 pm on 3/19/01.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:		OIL CONSERVATION DIVISION	
Printed Name:	Ed Hasely	Approved by:	
Title:	Environmental Representative	District Supervisor:	for Frank Chavez
Date:	3/19/01	Approval Date:	3/21/01
Phone:	(505) 326-9841 or 326-9842	Expiration Date:	
Conditions of Approval:		Submit remediation Report	
		Attached: <input type="checkbox"/>	

11 DG F0107937052