

District I
1625 N French Dr , Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
2040 South Pacheco
Santa Fe, NM 87505


Form C-141
Revised March 17, 1999

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

30 039 22402

OPERATOR

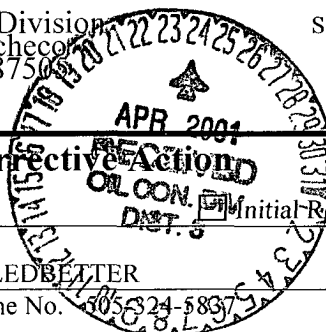

Initial Report

☒ Final Report

Name of Company CONOCO INC.	Contact GARY LEDBETTER
Address 3315 BLOOMFIELD HWY ; FARMINGTON, NM 87401	Telephone No. 505-324-5837
Facility Name Lindrith B-10	Facility Type PRODUCTION FACILITY

Surface Owner BLM	Mineral Owner BLM	Lease No. SF-078915
----------------------	----------------------	---------------------

LOCATION OF RELEASE

Unit Letter J	Section 34	Township 24N	Range 3W	Feet from the 1810	North/South Line FSL	Feet from the 1810	East/West Line FEL	County RIO ARRIBA
------------------	---------------	-----------------	-------------	-----------------------	-------------------------	-----------------------	-----------------------	-------------------

NATURE OF RELEASE

Type of Release PRODUCED OIL	Volume of Release 5 BARRELS	Volume Recovered 4 1/2 BARRELS
Source of Release OVERFLOW FROM STEEL WATER PIT	Date and Hour of Occurrence START UNKNOWN	Date and Hour of Discovery 4/16/01 12:00 PM
Was Immediate Notice Given? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.* THE 400 BARREL PRODUCED OIL TANK 2" DRAIN VALVE DEVELOPED A SMALL LEAK. THE PRODUCTION TANK DRAIN'S TO THE WATER TANK. THIS CAUSED THE 40 BARREL WATER TANK TO OVERFLOW INTO THE BERM AREA. A VACUUM TRUCK PICKED UP STANDING OIL INSIDE THE BERM.

Describe Area Affected and Cleanup Action Taken.*

THE BERM AREA, WHICH IS MADE FROM SURROUNDING DIRT COMMON TO THE AREA. THE CONTAMINATED SOIL WAS SHOVEL UP INTO PILES, WHICH WILL BE LANDFARMED ON LOCATION. PROPER PROCEDURES WILL BE FOLLOWED FOR SAMPLE TAKING.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOC rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOC marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOC acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Gary Ledbetter</i>	OIL CONSERVATION DIVISION	
Printed Name: GARY LEDBETTER	Approved by District Supervisor: <i>Denny Reunt for Frank Chavez</i>	
Title: SHEAR SPECIALIST	Approval Date: 4/27/01	Expiration Date:
Date: 4/20/01 Phone: 505-324-5837	Conditions of Approval:	Attached <input type="checkbox"/>

* Attach Additional Sheets If Necessary

NDGF0111756076