ConocoPhillips

Schematic - Current

API # 30-039-30631

SAN JUAN 28-7 UNIT #153M

Most Recent Job

Jobs

Job Category	Primary Job Type	Secondary Job Type	Actual Start Date	End Date
COMPLETIONS	INITIAL COMPLETION	INITIAL COMPLETION	1/19/2010	8/4/2010

Well Config: DEVIATED - Original Hole, 8/5/2010 7:19:03 AM

ftKB (MD)	Schematic - Actual
0	
16	1-1, Casing Joints, 9 5/8, 9.001, 16
17	2-1, Casing Hanger, 7, 6.366, 16, 1.5
	3-1, Casing Hanger, 4 1/2, 4.000, 16, 1.5
19	1-2, Casing Pup Joints, 9 5/8, 9.001, 16, 3.3
20	
26	2-2, Casing Pup Joint, 7, 6.366, 17, 8.0
49	3-2, Casing Pup Joint, 4 1/2, 4.000, 17, 31.2
350	1-3, Casing Joints, 9 5/8, 9.001, 19, 330.8
351	1-4, SAWTOOTH COLLAR, 9 5/8, 9.001, 350, 0.9
356	
3,488	3-3, Casing Joints, 4 1/2, 4.000, 49, 3,438.9
3,497	3-4, Marker Joint, 4 1/2, 4.000, 3,488, 9.8
	1-1, Tubing, 2 3/8, 1.995, 0, 7,554.3
4,390	
4,968	2-3, Casing Joints, 7, 6.366, 25, 4,942.3
4,969	2-4, Float Collar, 7, 6.366, 4,968, 0.8
4,970	3-5, Casing Joints, 4 1/2, 4.000, 3,497, 1,472.5
5,012	2-5, Casing Joints, 7, 6.366, 4,969, 43.3
5,012	2-6, Float Shoe, 7, 6.366, 5,012, 0.8
5,020	
5,154	Perforated, 5,154-5,516, 7/21/2010
5,516	
7,269	3-6, Casing Joints, 4 1/2, 4.000, 4,970, 2,298.9
7,279	3-7, Marker Joint, 4 1/2, 4.000, 7,269, 10.0
7,470	
7,554	Perforated, 7,470-7,602, 7/20/2010
7,556	1-2, Tubing Pup Joint/Marker, 2 3/8, 1.995, 7,555, 1.9
7,588	1-3, Tubing, 2 3/8, 1.995, 7,557, 31.0
7,588	1-4, Profile Nipple/F-Nipple, 2 3/8, 1.780, 7,587, 0.9
7,589	1-5, 1/2 MS EXP. CK., 2 3/8, 1.900, 7,588, 1.0
7,602	
7,622	Perforated, 7,622-7,656, 7/20/2010
7,656	
7,660	
7,662	3-8, Casing Joints, 4 1/2, 4.000, 7,279, 383.7
7,663	3-9, Float Collar, 4 1/2, 4.000, 7,662, 0.8
7,664	3-10, Float Shoe, 4 1/2, 4.000, 7,663, 1.3
7,669	

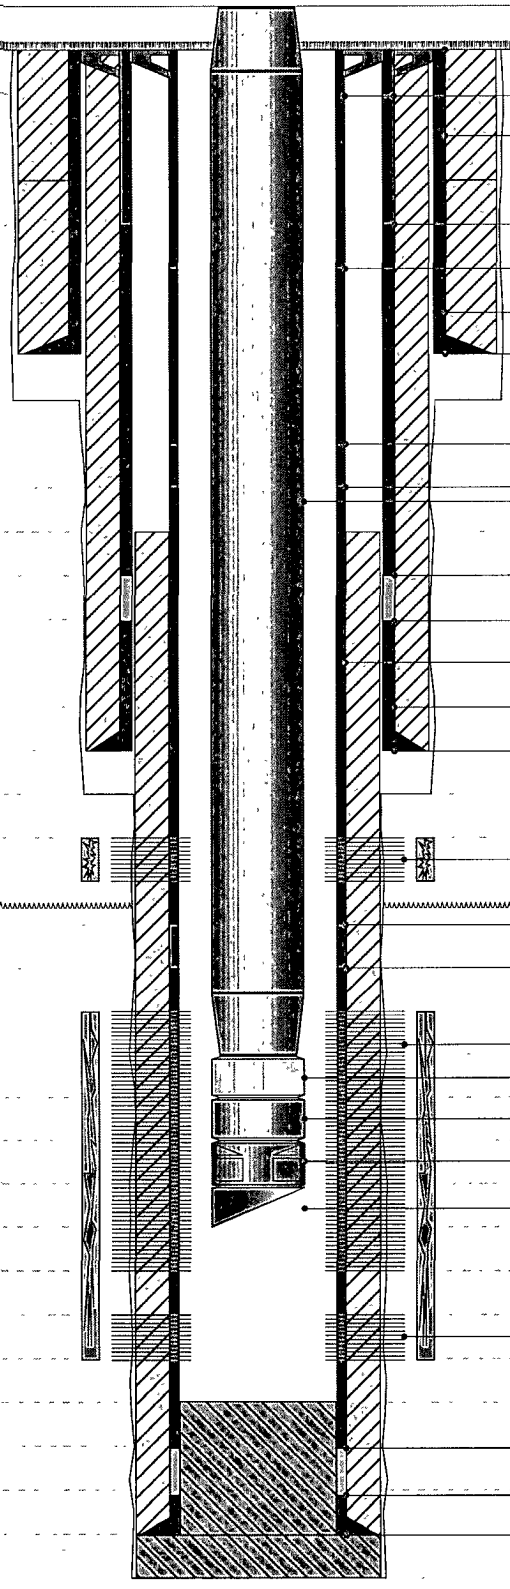

RCVD AUG 19 '10
OIL CONS. DIV.
DIST. 3

Report Printed: 8/5/2010