ConocoPhillips

Schematic - Current

Burlington Resources

SAN JUAN 30-6 UNIT #147N

API# 30-039-30816

Most Recent Job

Jobs

Job Category	Primary Job Type	Secondary Job Type	Actual Start Date	End Date
COMPLETIONS	INITIAL COMPLETION	INITIAL COMPLETION	4/5/2010	12/13/2010

Well Config: DEVIATED - Original Hole, 12/19/2010 10:22:52 AM

ftKB (MD)	Schematic - Actual
15	3-1, Casing Joints, 4 1/2, 4.000, 15
	1-1, Casing Joints, 9 5/8, 9.001, 15
16	3-2, Casing Hanger, 4 1/2, 4.000, 15, 1.0
18	1-2, Casing Hanger, 9 5/8, 9.001, 15, 3.3
25	3-3, Mandrel Pup Joint, 4 1/2, 4.000, 16, 9.5
31	3-4, Casing Pup Joint, 4 1/2, 4.000, 25, 5.0
230	1-3, Casing Joints, 9 5/8, 9.001, 18, 211.8
231	1-4, SAWTOOTH COLLAR, 9 5/8, 9.001, 230, 0.9
235	
2,885	2-1, Casing Joints, 7, 6.366, 15, 2,870.0
2,887	2-2, Stage Tool, 7, 6.366, 2,885, 2.5
4,008	1-1, Tubing, 2 3/8, 1.995, 15, 7,846.6
	2-3, Casing Joints, 7, 6.366, 2,888, 1,120.5
4,009	2-4, Float Collar, 7, 6.366, 4,008, 0.7
4,052	2-5, Casing Joints, 7, 6.366, 4,009, 43.2
4,053	2-6, Float Shoe, 7, 6.366, 4,052, 0.8
4,070	
4,119	3-5, Casing Joints, 4 1/2, 4.000, 30, 4,089.1
4,131	3-6, Marker Joint, 4 1/2, 4.000, 4,119, 11.9
4,472	Perforated, 4,472-4,904, 11/15/2010
4,904	
5,008	Perforated, 5,008-5,440, 11/15/2010
5,440	
5,516	Perforated, 5,516-5,936, 11/15/2010
5,936	
7,528	3-7, Casing Joints, 4 1/2, 4.000, 4,131, 3,397.1
7,543	3-8, Marker Joint, 4 1/2, 4.000, 7,528, 15.0
7,775	
7,862	Perforated, 7,775-7,928, 11/12/2010
7,864	1-2, Pup Joint/Marker, 2 3/8, 1.995, 7,862, 2.1
7,895	1-3, Tubing, 2 3/8, 1.995, 7,864, 31.4
7,896	1-4, Profile Nipple/F-Nipple, 2 3/8, 1.780, 7,895, 0.8
7,897	1-5, Mule Shoe, 2 3/8, 1.995, 7,896, 0.8
7,922	
7,928	
7,955	3-9, Casing Joints, 4 1/2, 4.000, 7,543, 412.0
7,956	3-10, Float Collar w/ Choke, 4 1/2, 4.000, 7,955, 0.7
7,957	3-11, Float Shoe, 4 1/2, 4.000, 7,956, 0.8
7,958	
7,981	
8,008	

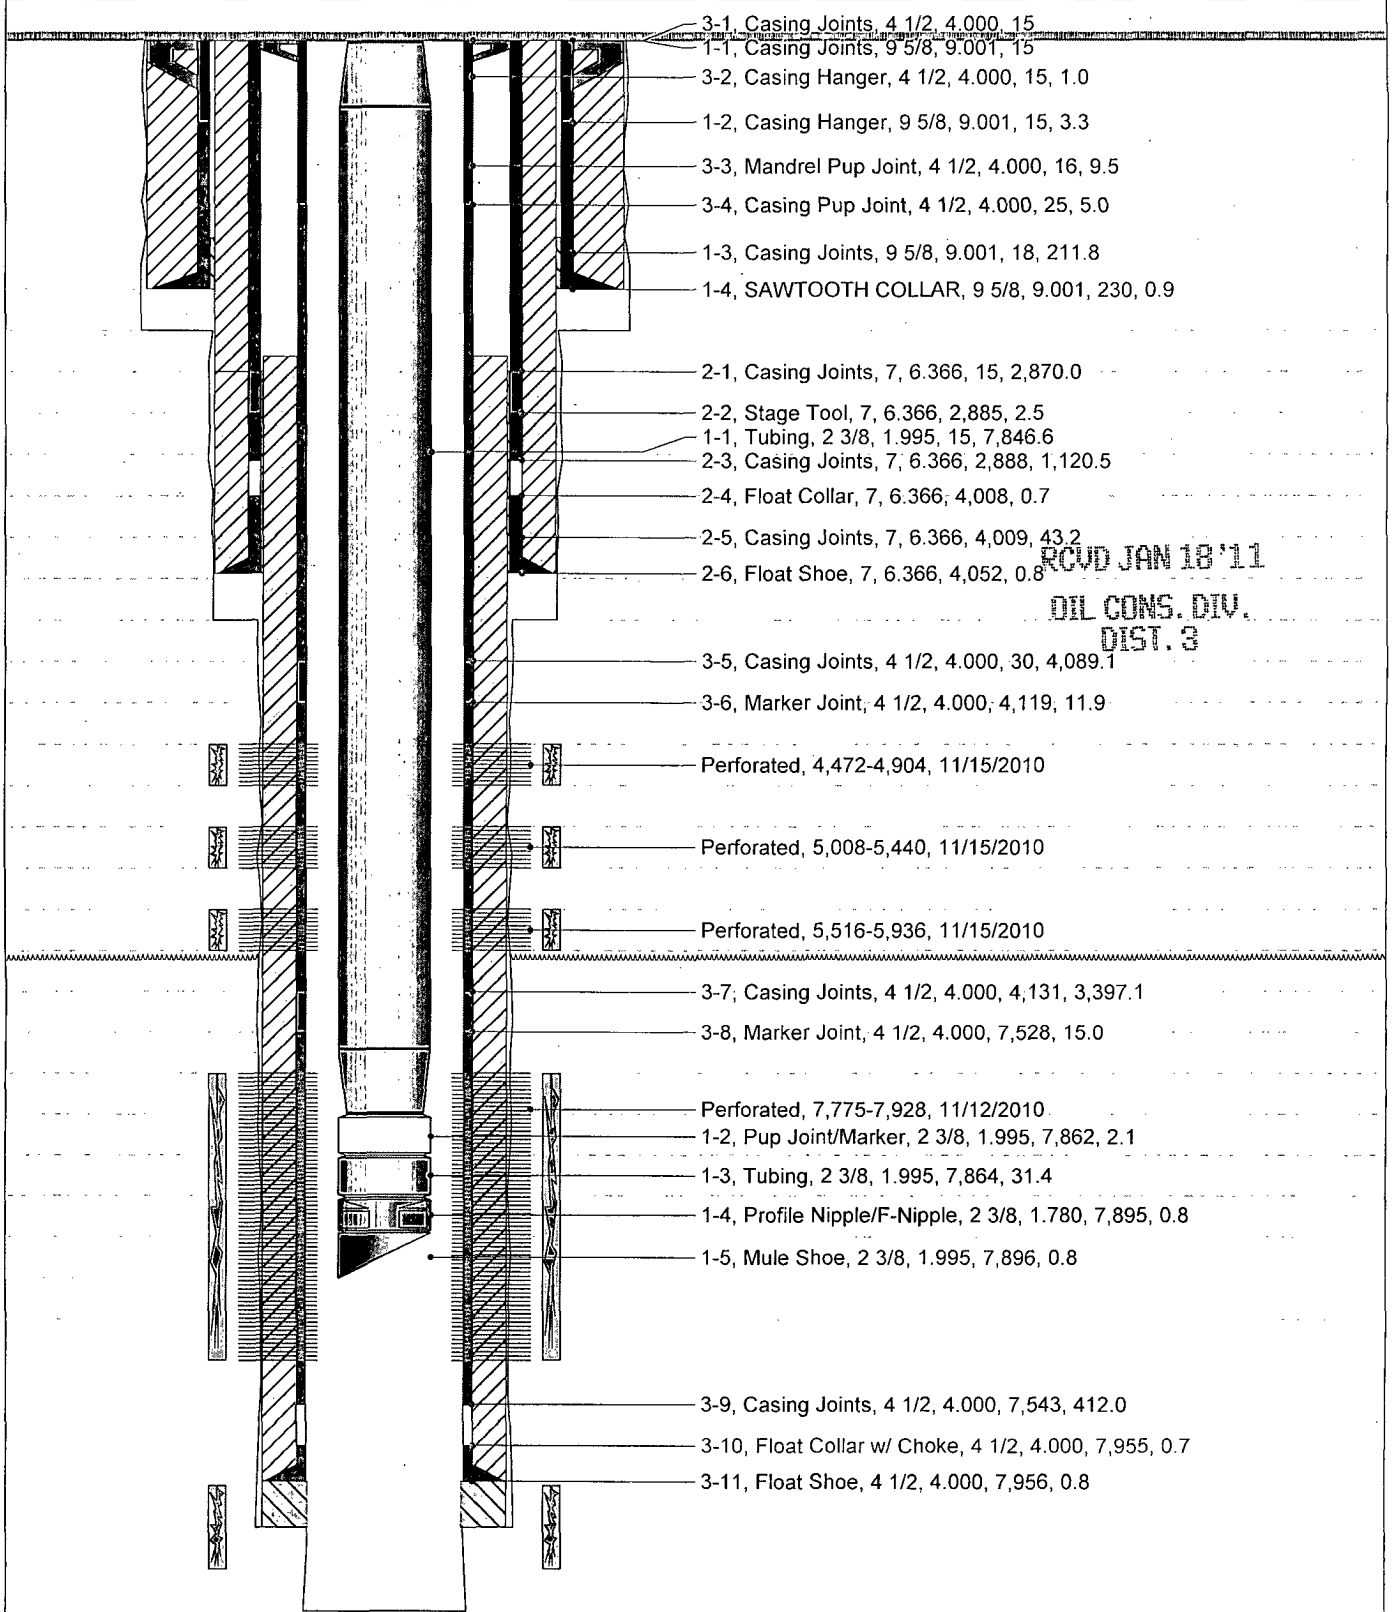

RCVD JAN 18'11

OIL CONS. DIV.
DIST. 3

Report Printed: 12/19/2010