



NEW MEXICO ENERGY, MINERALS & NATURAL RESOURCES DEPARTMENT

MAB

OIL CONSERVATION DIVISION
AZTEC DISTRICT OFFICE
1000 RIO BRAZOS ROAD
AZTEC NM 87410
(505) 334-6178 FAX: (505) 334-6170
[http://emnrd.state.nm.us/ocd/District III/3ddistrict.htm](http://emnrd.state.nm.us/ocd/District%20III/3ddistrict.htm)

BRADENHEAD TEST REPORT

(submit 1 copy to above address)

Date of Test 5/14/10 Operator Williams Production API #30-0 3907958


Property Name Rosa Unit Well No. 014 Location: Unit B Section 23 Township 31N Range 06W

Well Status(Shut-In or Producing) Initial PSI: Tubing 103 Intermediate 102 Casing 103 Bradenhead 103

OPEN BRADENHEAD AND INTERMEDIATE TO ATMOSPHERE INDIVIDUALLY FOR 15 MINUTES EACH

Testing	PRESSURE			INTERM	
	BH	Bradenhead Int	Csg	Int	Csg
TIME					
5 min	0	103	104	1	104
10 min				1	105
15 min				1	105
20 min				1	105
25 min				1	105
30 min				1	105

FLOW CHARACTERISTICS	
BRADENHEAD	INTERMEDIATE
Steady Flow	X NEVER BLEW DOWN
Surges	
Down to Nothing	
Nothing X NO PSI	
Gas	
Gas & Water	
Water	

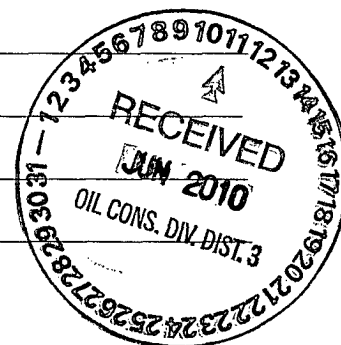

If bradenhead flowed water, check all of the descriptions that apply below:

CLEAR _____ FRESH _____ SALTY _____ SULFUR _____ BLACK _____

5 MINUTE SHUT-IN PRESSURE

BRADENHEAD 103

INTERMEDIATE 55

REMARKS:

LEFT BH OPEN AFTER TEST

SHUT IN INTERMEDIATE AFTER TEST

STEADY FLOW OF GAS ON INTERM. TEST

By ROBERT LUJAN

Witness _____

FIELD TECH

(Position)

E-mail address ROBERT.LUJAN@WILLIAMS.COM

ROSA UNIT #14
BLANCO MESAVERDE

Location:

930' FNL and 1830' FEL
NW/4 NE/4 Sec 23(B), T31N, R6W
Rio Arriba, New Mexico
Elevation: 6292' GR
API # 30-039-07958

Spud Date: 06/26/56

Completed Date: 08/07/56

1st Delivery Date: 10/28/56

Top	Depth
-----	-------

Kirtland	2452'
----------	-------

Fruitland	2850'
-----------	-------

Pictured Cliffs	3120'
-----------------	-------

Lewis	3513'
-------	-------

Cliff House	5324'
-------------	-------

Menefee	5412'
---------	-------

Point Lookout	5606'
---------------	-------

6 jts 9-5/8", H-40 8rd. Landed @ 190'
Cemented with 150 sx cmt

93 jts 7", 20#, J-55, CF&I 8rd csg. Landed @
3580'. Cemented with 200 sx cmt

183 jts 2-3/8", 4.7#, J-55, EUE, 8rd tbg Landed
@ 5689'.

184 jts 5", 11.5#, J-55, J&L 8rd csg. Landed @
5739'. Cemented with 150 sx cmt

Stimulation: 07/26/56

*Perf'd 5378'-5408' w/4 SPF.
Fraced w/43,680 gal water and
58,000# sand.*

*Perf'd 5614'-5638' w/4 SPF.
Fraced w/45,444 gal water and
56,500# sand.*

*Perf'd 5655'-5728' w/3 SPF.
Fraced w/50,190 gal water and
60,000# sand.*

TD @ 5739'

Casing	Cement	Top of Cmt
9-5/8"	150 sx	Surface
7", 20#	200 sx	??
5", 11.5#	150 sx	??

Slope Sales & Service, Inc.
 67 US Hwy. 64
 Farmington, New Mexico 87401
 Office: (505) 327-0918

WELLHEAD EQUIPMENT IDENTIFICATION

DATE: 05/21/10



CUSTOMER	WAPX
LOCATION	ROSA UNIT 14-23
FSO	10094
PREPARED BY	JOSE SANCHEZ

