


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

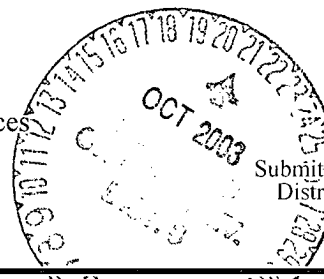

Form C-141
Revised March 17, 1999
Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company BP America Production Company	Contact Brittany Benko	
Address 200 Energy Court Farmington, NM 87401	Telephone No. (505) 326-9235	
Facility Name GCU 306 SWD (Bad Oil Facility)	Facility Type Salt Water Disposal Well	
Surface Owner Private	Mineral Owner NA	Lease No. 30-045-24286

LOCATION OF RELEASE

Unit Letter I	Section 19	Township 29N	Range 12W	Feet from the 2015	North/South Line South Line	Feet from the 830	East/West Line East Line	County San Juan County
-------------------------	----------------------	------------------------	---------------------	------------------------------	---------------------------------------	-----------------------------	------------------------------------	----------------------------------

NATURE OF RELEASE

Type of Release Condensate/Oil/Produced Water	Volume of Release 80 bbls Condensate/Oil 280 bbls Produced Water	Volume Recovered 60 bbls Condensate/Oil 140 bbls Produced Water
Source of Release "Gun Barrel" Tank	Date and Hour of Occurrence 10/02/2003 3:00 PM	Date and Hour of Discovery 10/02/2003 3:05 PM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Denny Foust	
By Whom? Brittany Benko	Date and Hour 10/03/2003 10:45 AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

A lightning strike hit the gun barrel tank at the GCU 306 SWD site. The strike caused the fiberglass tank to part at the base spilling the contents. The oil tank was also damaged - bulged from the strike. All the tank stairs and walk ways were damaged as the fiberglass tank landed against them and snapped the tank lugs off the side of the rest of the tanks. All material released was contained on location within a secondary containment berm built around the entire location. Upon arrival at the site, power to the facility was shut off, pumping wells feeding the facility were also shut down and damage was assessed. A water truck was called and some fluids were recovered. Work was halted as new storm moved toward the site. A decision was made to shut the Job down for night. Cleanup resumed the next morning.

Describe Area Affected and Cleanup Action Taken.*

The recoverable liquid was hauled to other disposal sites. The remaining contaminated soil is being landfarmed on location. Blagg Engineering has been contracted to sample the cleaned up areas to assure cleanup standards are met and will sample the landfarmed soil when it appears that it has reached cleanup standards as well. At that time the soil will be spread back out on the location. The fiber glass tank was disposed of at San Juan County Landfill. The damaged oil tank was hauled to a holding site and will be sold as scrap.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Brittany Benko</i>	OIL CONSERVATION DIVISION	
Printed Name: Brittany D-Benko	Approved by District Supervisor: <i>Denny Foust for Frank Chavez</i>	
Title: Environmental Coordinator	Approval Date: 12/11/03	Expiration Date:
Date: 10/15/2003	Phone: (505) 326-9235	Attached <input type="checkbox"/>
Conditions of Approval:		

* Attach Additional Sheets If Necessary

h DGF 0334553757