


District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
2040 South Pacheco
Santa Fe, NM 87505

Form C-141
Revised March 17, 1999

Submit 2 Copies to appropriate
District Office in accordance
With Rule 116 on back
side of form

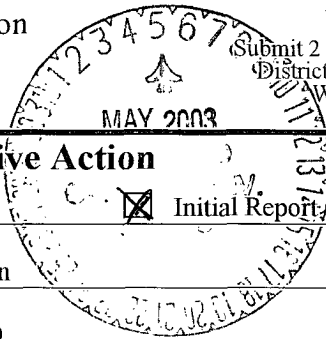

Release Notification and Corrective Action

30 039 26101

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company Black Hills E&P/ Mallon	Contact <input type="checkbox"/> Doran Newlin	
Address P.O. Box 2797 Durango, Co. 81302	Telephone No. <input type="checkbox"/> 907-382-9100	
Facility Water Station 2	Facility Type Water Station Transfer Line	
Surface Owner Jicarilla Apache Res.	Mineral Owner Mallon Oil Co.	Lease No. Jic 30-3-34-2

LOCATION OF RELEASE

Unit Letter NWNE B	Section Sec. 34	Township T 30 N	Range R3W	Feet from the	North/South Line	Feet from the	East/West Line	County Rio Arriba <input type="checkbox"/>
-----------------------	--------------------	--------------------	--------------	---------------	------------------	---------------	----------------	---

NATURE OF RELEASE

Type of Release Produced Water	Volume of Release <input checked="" type="checkbox"/> 60 BBLS.	Volume Recovered 25 BBLS.
Source of Release Fiberglass line	Date and Hour of Occurrence 4-17-03 @ ?	Date and Hour of Discovery <input checked="" type="checkbox"/> 4-17-03 @ 10:00 a.m.
Was Immediate Notice Given? Yes	If YES, To Whom? O.C.D. and E.P.O. Jic.	
By Whom? Gary Stripling	Date and Hour 4-17-03 @ 10:30 a.m.	
Was a Watercourse Reached? yes	If YES, Volume Impacting the Watercourse. 30 bbls.	
If a Watercourse was Impacted, Describe Fully. *Water was discovered on location of Jic. 30-3-34-2 approx. 30 bbls. @ 10:00 a.m. Jicarilla EPO officer K.C. showed up on location and paced off 570 steps down canyon. Sent backhoe down and isolated run off before reaching main water - course. Had Dawn vacuum suck up standing water and had backhoe dig suction hole @ leak area. Had Enviro. Tech. Come out and take 3 water samples @ source, middle and end of water run. Pulled 3 soil samples @ same. Test to be ran Cat-Ion. Pulled off site soil sample. Cleared dirt back off leak source and identified leak. Secured Area.		
Describe Cause of Problem and Remedial Action Taken. Fiberglass line cracked due to weight of earth. Remediation pending upon samples taken.		
Describe Area Affected and Cleanup Action Taken: Half an acre on location and 570 steps 2ft. wide. Instructed by Jicarilla EPO officer to wait on cleanup until test results are completed!		

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remedial contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	OIL CONSERVATION DIVISION	
Printed Name: Gary Stripling	Approved by <input type="checkbox"/> District Supervisor	
Title: Plant Foreman	Approval Date: 05/08/03	Expiration Date:
Date: 4-18-03	Phone: 486 - 2136	Conditions of Approval: File Final Report
		Attached <input type="checkbox"/>

* Attach Additional Sheets If Necessary

A DGF 0310748047