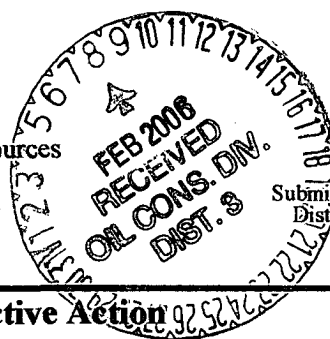


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505



Form C-141
Revised March 17, 1999

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

30-039-23408

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company <i>Questar Exploration & Production</i>	Contact <i>Kirby Sanchez-Lybrook (Nageezi) N.M.</i>
Address <i>1050 17th Street, Denver, Co. 80265</i>	Telephone No. <i>505-568-4420 (Office) 505-330-9605 (cell)</i>
Facility Name <i>Escrito Gallup Unit #29</i>	Facility Type <i>Tank Battery</i>

Surface Owner <i>Federal</i>	Mineral Owner	Lease No. <i>14-08-0001-8691</i>
---------------------------------	---------------	-------------------------------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
	<i>20</i>	<i>24N</i>	<i>7W</i>	<i>790'</i>	<i>=</i>	<i>790'</i>	<i>=</i>	<i>Rio Arriba</i>

NATURE OF RELEASE

Type of Release <i>Oil & PW</i>	Volume of Release <i>135/10</i>	Volume Recovered <i>117</i>
Source of Release <i>Tank #1220 water drain valve</i>	Date and Hour of Occurrence <i>12/06/05 2:00 AM</i>	Date and Hour of Discovery <i>12/06/05 10:00 AM</i>
Was Immediate Notice Given? ☒ Yes ☐ No ☐ Not Required	If YES, To Whom? <i>Steve Hayden @ OCA District III Office</i>	
By Whom? <i>ALAN Pitney (303) 672-6969</i>	Date and Hour <i>12/07/05 approx 9:47 AM</i>	
Was a Watercourse Reached? ☐ Yes ☒ No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.* *Water drain valve froze and broke, emptying 145 Bbls of mostly oil (10 Bbls PW) into dike. Recovered 117 bbls of oil with vac truck. Used back hoe to clean up residue on edge and fire wall. Floated and removed add'l residue on 12/09/05 with hot oil truck.*

Describe Area Affected and Cleanup Action Taken.* *All but 1 bbl was contained inside dike. 1 bbl trickled approximately 65' to roadside (excavated and placed soil inside dike) Excavated all contaminated soil inside fire wall on 12/19/05 (60 yards) and hauled to Envirotech for remediation on 02/03/06. Pull two 5 point samples for BTEX and TPH tests. Results included w/ form.*

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

OIL CONSERVATION DIVISION

Signature: <i>Kirby D. Sanchez</i>	Approved by District Supervisor: <i>Denny Fournier for Charlie Perron</i>	
Printed Name: <i>Kirby D. Sanchez</i>	Approval Date: <i>2/13/06</i>	Expiration Date:
Title: <i>Production Foreman</i>	Attached ☐	
Date: <i>02/07/06</i> Phone: <i>505-568-4420</i>	Conditions of Approval:	

* Attach Additional Sheets If Necessary

1106F 0535433525

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Questar E & P	Project #:	03074-001
Sample ID:	1	Date Reported:	12-21-05
Laboratory Number:	35545	Date Sampled:	12-19-05
Chain of Custody:	15228	Date Received:	12-20-05
Sample Matrix:	Soil	Date Analyzed:	12-21-05
Preservative:	Cool	Date Extracted:	12-20-05
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	ND	1.8
Toluene	9.1	1.7
Ethylbenzene	43.2	1.5
p,m-Xylene	35.6	2.2
o-Xylene	3.7	1.0
Total BTEX	91.6	

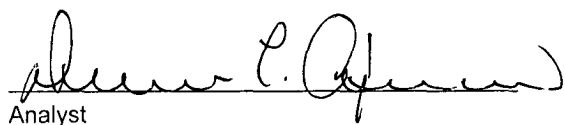
ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	98.0 %
	1,4-difluorobenzene	98.0 %
	Bromochlorobenzene	98.0 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: EGU #29.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

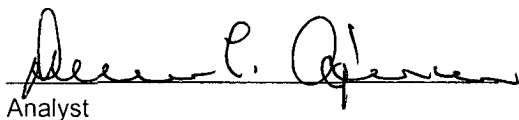
Client:	Questar E & P	Project #:	03074-001
Sample ID:	Sample 2	Date Reported:	01-13-06
Laboratory Number:	35721	Date Sampled:	01-12-06
Chain of Custody No:	15361	Date Received:	01-12-06
Sample Matrix:	Soil	Date Extracted:	01-12-06
Preservative:	Cool	Date Analyzed:	01-13-06
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	317	0.2
Diesel Range (C10 - C28)	726	0.1
Total Petroleum Hydrocarbons	1,040	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: **EGU #29.**


Analyst


Review