

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company Williams Production	Contact Michael K. Lane
Address PO Box 640	Telephone No. 505-634-4219
Facility Name Rosa #225A (API: 30-039-29576)	Facility Type Well Site

Surface Owner BLM	Mineral Owner BLM	Lease No.
--------------------------	--------------------------	-----------

LOCATION OF RELEASE

Unit Letter O	Section 12	Township 31 N	Range 06W	Feet from the	North/South Line	Feet from the	East/West Line	County Rio Arriba
-------------------------	----------------------	-------------------------	---------------------	---------------	------------------	---------------	----------------	-----------------------------

Latitude 36.90889 Longitude -107.41111

NATURE OF RELEASE

Type of Release Produced Water	Volume of Release ~6 bbl	Volume Recovered ~6 bbl
Source of Release Produced Water Tank	Date and Hour of Occurrence 4/08/10 10:45 AM	Date and Hour of Discovery Same
Was Immediate Notice Given? <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Brandon Powell-NMOCD & Kevin Schneider-BLM (email)	
By Whom? Myke Lane	Date and Hour 4/12/10 ~ 10:40 AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

RCVD APR 13 '10

OIL CONS. DIV.

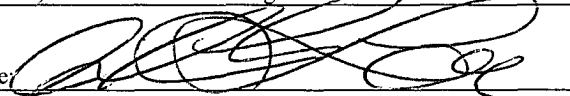

Describe Cause of Problem and Remedial Action Taken.

Well was put back on production following tank cleaning operations. A one-inch valve from the well to the production tank was left cracked open. On a followup inspection after the well was placed online, the field tech notice the valve leaking and secured the valve and placed a plug in the open end. All water was contained in bermed area and immediately vacuumed up, and returned to the disposal system. The cleaning contractor has been notified of the incident and a request has been made that they monitor for leaks following cleaning to ensure tank integrity is reestablished.

Describe Area Affected and Cleanup Action Taken.

See actions taken above. As containment to be sterilized during production life of well, will reclaim when well P&A'd. No further action being taken at this time.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Michael K. Lane	Approved by District Supervisor:  For: CP	
Title: SJB EH&S Specialist	Approval Date: 4/28/10	Expiration Date:
E-mail Address: myke.lane@williams.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 4/12/10 Phone: (505) 330-3198		

* Attach Additional Sheets If Necessary

WBP10 27140000