


FIELD DATA CORE ANALYSIS REPORT

DATE JAN 31-77

SAMPLE NUMBER	DEPTH FEET	PERMEABILITY MILLIDARCYs	POROSITY PERCENT	RESIDUAL LIQUID SATURATION			VERTICAL PERM.	REMARKS
				% VOL	OIL % PORE	TOTAL WATER % PORE		
1	5608-09	153	22.2		21.1	61.6	144	
2	-10	729	27.4		18.6	61.2	443	
3	-11	670	25.8		24.8	60.4	650	
4	-12	1143	26.6		21.0	61.6	941	
5	-13	1300	27.6		25.3	62.0	1280	
6	-14	251	22.2		21.2	67.2	86	
7	-15	4.7	17.9		0.6	86.0	2.8	
8	-16	325	25.8		19.4	67.4	289	
9	-17	807	25.7		13.2	73.6	788	
10	-18	719	25.8		24.1	64.8	640	
11	-19	526	26.6		23.7	63.9	354	
12	-20	304	25.7		9.8	75.3	198	
13	-21	222	22.1		11.3	81.0	181	
14	-22	369	22.6		10.6	77.9	268	
15	-23	212	23.8		7.1	85.7	161	
16	-24	443	26.5		19.6	69.0	405	
17	-25	532	27.5		14.5	68.8	487	
18	-26	611	26.7		15.7	68.9	557	
19	-27	564	23.8		13.9	75.3	541	
20	-28	611	24.6		7.3	81.3	517	
21	-29	601	25.8		0.0	90.0	535	
22	-30	576	24.4		0.0	87.3	490	
23	-31	396	25.5		0.0	89.5	372	
24	-32	472	27.0		0.0	89.6	400	
25	-33	407	27.7		0.0	83.1	375	
26	-34	591	25.5		0.0	87.9	546	
27	-35	532	25.1		0.0	84.7	508	
28	-36	591	26.2		0.0	87.6	531	
29	-37	729	28.0		0.0	88.2	689	
30	-38	896	25.9		0.0	84.6	837	

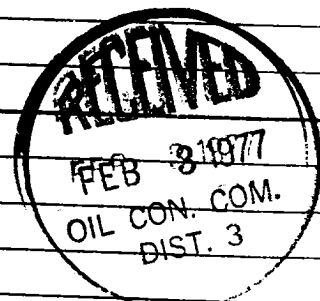

COMPANY DOMO PET. CORP WELL SANTA FE 20 NO. 1
COUNTY SAN JUAN STATE N. MEXICO FIELD W. C. ELEVATION 6567 GR-L
LOCATION SW - NE. SEC 20 T14N R 8 W