

5 - USGS

1 - Billie Robinson

1 - File

1 - TR

Form 9-331
Dec. 1973Form Approved.
Budget Bureau No. 42-R1424UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)


1. oil ☐ well gas ☒ well other ☐
2. NAME OF OPERATOR
Dugan Production Corp.
3. ADDRESS OF OPERATOR
P O Box 208, Farmington, NM 87401
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1550' FNL - 1850' FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐
- FRACTURE TREAT ☐
- SHOOT OR ACIDIZE ☐
- REPAIR WELL ☐
- PULL OR ALTER CASING ☐
- MULTIPLE COMPLETE ☐
- CHANGE ZONES ☐
- ABANDON* ☐
- (other) ☐

SUBSEQUENT REPORT OF:

- ☒
- ☐
- ☐
- ☐
- ☐
- ☐
- ☐
- ☐

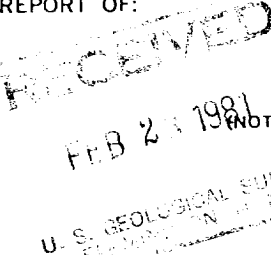

NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2-15-81 Rigged up and ran 58 jts 2-7/8" OD, 6.4# 10 Rd NEUE tbgs. for csg. T.E. 1437.74' set at 1436' GL. Cemented with 75 sx 2% Lodense w/ 1/4# cello flake per sx. Total slurry 211 cu.ft. Reciprocated pipe OK while cementing. Good circulation throughout job. P.O.B. at 1:30 p.m. 2-14-81. Circulated trace of cement to surface.

Subsurface Safety Valve: Manu. and Type _____

Set @ _____

Ft. _____

18. I hereby certify that the foregoing is true and correct

SIGNED

Jim

TITLE

Geologist

DATE

2-19-81

(This space for Federal or State office use)

APPROVED BY

FEB 24 1981

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

BY

FARMINGTON DISTRICT

1000

