

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office **Santa Fe**  
Lease No. **078884**  
Unit **Canyon Largo Unit**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<b>Water Frac.</b>	<b>X</b>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 17, 1959

Well No. **69** is located **1650** ft. from **NX** line and **1150** ft. from **E** line of sec. **15**

**SE Sec. 15**

(1/4 Sec. and Sec. No.)

**25N**

(Twp.)

**6W**

(Range)

**N.M.P.M.**

(Meridian)

**Chacra Wildcat**

(Field)

**Rio Arriba**

(County or Subdivision)

**New Mexico**


(State or Territory)

The elevation of the derrick floor above sea level is **6565** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On April 16, 1959. Total Depth 3536'. C.O.T.D. 3538'.  
Water fractured Chacra perf. int. 3400-3422; 3500-3510 w/2 DJ/ft with 30,000  
gallons water and 35,000# sand. B.D.P. 1500#, max. pr. 2100#, avg. tr. pr.  
1700-2000#. I.R. 61 B.P.M. Flush 7000 gallons.

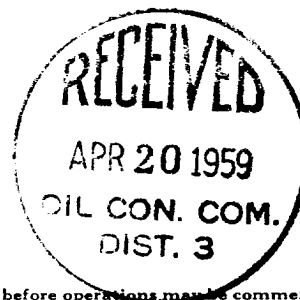

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Company**

Address **Box 997**

**Farmington, New Mexico**

Original Signed C. D. COX

By **Petroleum Engineer**

Title