


FIELD PIT SITE ASSESSMENT FORM

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 74° Footage from Wellhead 107'
b) Length : 17' Width : 16' Depth : 3'

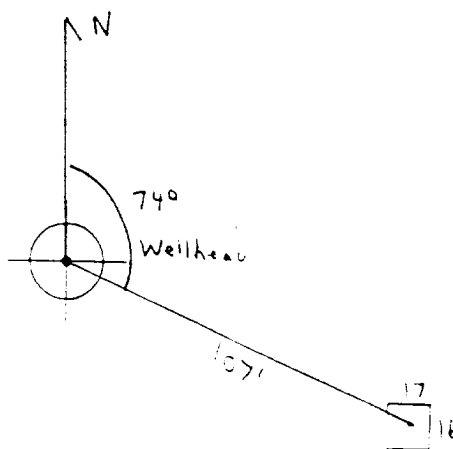

REMARKS :

Pictures @ 1236 (23-26)
Dump Truck

Completed By:

Cory Chane
Signature

5/18/94
Date

FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>70872</u> Location: <u>CANDADO</u> Coordinates: Letter: <u>A</u> Section <u>9</u> Township: <u>26</u> Range: <u>7</u> Or Latitude _____ Longitude _____ Date Started : <u>6-2-94</u> Area: <u>03</u> Run: <u>72</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KP# 79</u> Sample Depth: <u>12'</u> Feet Final PID Reading <u>000</u> PID Reading Depth <u>12</u> Feet Yes No Groundwater Encountered ☐ (1) ☒ (2) Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation ☒ (1) Approx. Cubic Yards <u>0</u> Onsite Bioremediation ☐ (2) Backfill Pit Without Excavation ☐ (3) Soil Disposition: Envirotech ☐ (1) ☒ (3) Tierra Other Facility ☐ (2) Name: _____ Pit Closure Date: <u>6-2-94</u> Pit Closed By: <u>B. E. F.</u>
REMARKS	Remarks : <u>Some Line Markers started Remediating to 12'</u> <u>Soil Looked Clean Took A Heated Head Pace At 12' on 1 Sample</u> <u>Hole Piv 000 Closed Pit</u>
	Signature of Specialist: <u>Kelly Padilla</u>



40

FIELD SERVICES LABORATORY
ANALYTICAL REPORT
PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

SAMPLE NUMBER:

Field ID

Lab ID

MTR CODE | SITE NAME:

SAMPLE DATE | TIME (Hrs):

SAMPLED BY:

DATE OF TPH EXT. ANAL.:

DATE OF BTEX EXT. ANAL.:

TYPE | DESCRIPTION:

N/A

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	<0.025	MG/KG	1			
TOLUENE	0.045	MG/KG	1			
ETHYL BENZENE	<0.025	MG/KG	1			
TOTAL XYLENES	<0.025	MG/KG	1			
TOTAL BTEX	0.12	MG/KG				
TPH (418.1)	<10	MG/KG			2.05	28
HEADSPACE PID	0 0.00 <i>July 10, 94</i>	PPM				
PERCENT SOLIDS	92.5	%				

— TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 —

The Surrogate Recovery was at 99 % for this sample All QA/QC was acceptable.

Narrative:

ATI results attached.

DF = Dilution Factor Used

Approved By:

Date:

7/14/94



Analytical **Technologies**, Inc.

2709-D Pan American Freeway NE Albuquerque NM 87107
Phone (505) 344-3777 FAX (505) 344-4413

ATI I.D. 406331

June 15, 1994

El Paso Natural Gas Co.
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 06/08/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.


If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.

Letitia Krakowski, Ph.D.
Project Manager

H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jd

Enclosure

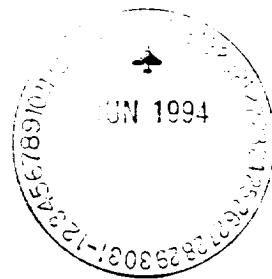



Analytical **Technologies**, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 8020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 406331
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
04	945337	NON-AQ	06/02/94	06/09/94	06/10/94	1
05	945338	NON-AQ	06/02/94	06/09/94	06/09/94	1
06	945339	NON-AQ	06/02/94	06/09/94	06/10/94	25
PARAMETER			UNITS	04	05	06
BENZENE			MG/KG	<0.025	<0.025	11
TOLUENE			MG/KG	0.045	<0.025	75
ETHYLBENZENE			MG/KG	<0.025	<0.025	37
TOTAL XYLENES			MG/KG	<0.025	<0.025	320

SURROGATE:

BROMOFLUOROBENZENE (%)	99	103	171*
------------------------	----	-----	------

*OUTSIDE ATI QUALITY CONTROL LIMITS DUE TO MATRIX INTERFERENCE