

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT - " for such proposals


SUBMIT IN TRIPLICATE

1. Type of Well  
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator  
ENERGEN RESOURCES CORPORATION

3. Address and Telephone No.  
2198 Bloomfield Highway, Farmington, NM 87401

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
1010' FSL, 1555' FWL, Sec. 3, T26N, R3W, N.M.P.M.

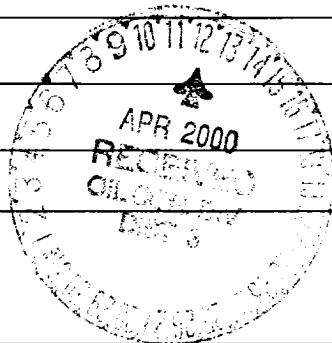

5. Lease Designation and Serial No.

JIC CONT 115

6. If Indian, Allottee or Tribe Name

Jicarilla Apache

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Jicarilla 115E 13R

9. API Well No.

30-039-26351

10. Field and Pool, or exploratory Area

Blanco MV/WC:26N3W3N Gallup

11. County or Parish, State

Rio Arriba NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent  
☒ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other \_\_\_\_\_
- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☒ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

4/1/00 Ran 97 jts 7" 20# J-55 casing, set @ 4099'. Cement with 500 sks 65/30 "B", 6% gel, 10#/sk gilsonite, 1/2#/sk flocele, 1% CaCL<sub>2</sub>, followed by 100 sk 50/50 poz, 2% gel, 10#/sk gilsonite, 1/2#/sk flocele, 2% CaCL<sub>2</sub> (1093 cu. ft.) Plug down @ 12:35 am 4/1/00. Circ. 57 sks cement to surface. WOC. Test casing to 1200 psi - ok.

RECEIVED  
BLM  
00 APR -7 AM 10:56  
ALBUQUERQUE, N.M.

14. I hereby certify that the foregoing is true and correct

Signed Monica Papp

Title Production Assistant

Date 4/5/00

(This space for Federal or State office use)

Approved by [Signature]

Title Lands and Minerals

Date APR 7 2000

Conditions of approval, if any: