

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE
(OTHER INSTRUCTIONS ON REVERSE SIDE)Form approved
Bul. of Interior No. 42 E1124
3. LEASE DESIGNATION AND SERIAL NO.

SF 078344-B

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for applications to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT TO DRILL" for such proposals.)

| | | | |
|---|--|--|--|
| 1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> Injection Well | | 7. UNIT AGREEMENT NAME East Bisti Unit | |
| 2. NAME OF OPERATOR Skelly Oil Company | | 8. FARM OR LEASE NAME | |
| 3. ADDRESS OF OPERATOR 1860 Lincoln Street - Denver, Colorado 80203 | | 9. WELL NO. 62 | |
| 4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980' FNL and 660' FWL Section 34-25N-10W | | 10. FIELD AND FOOT, OR WILDCAT Bisti Lower Gallup | |
| 11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA Section 34-25N-10W | | 12. COUNTY OR PARISH San Juan | |
| 13. STATE New Mexico | | 14. PERMIT NO. 6930' DF | |

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING


ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Regeneration Report and Log Form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

All depths shown are from Ground Level.

8/13/71 - MI&RU Aztec Well Service Unit. No rods in hole.
Spotted cement plug from 5348' to 5248'. Pulled 2" tubing.
Worked 5 1/2" casing to free same. Rigged up Blue Jet, perforated from 1704' to 1705' w/4 shots. Ran 2" tubing. Spotted cement plug from 1705' to 1555'. Perforated from 959' to 960' w/4 shots. Spotted cement plug from 960' to 860'. Pulled tubing. Shot 5 1/2" casing off at 710'. Spotted cement plug from 760' to 660', 50' inside casing stub and 50' above casing stub. Pulled a total of 22 joints 713' of 5 1/2" casing. Spotted 10' cement plug in surface casing. Installed dry hole marker. Completed P&A 8/20/71.

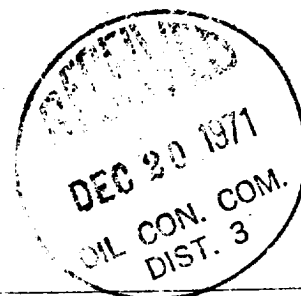

18. I hereby certify that the foregoing is true and correct

SIGNED

L. E. Bile

TITLE

Lead Clerk

DATE December 15, 1971.

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: