


Santa Fe, N.M.

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office _____
Lease No. 036294
Unit Carbon Unit

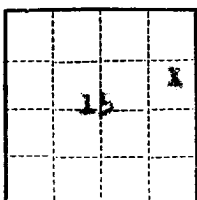

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 29

19 59

Well No. 12-15 is located 1980 ft. from N line and 600 ft. from E line of sec. 15
15 12N 12W
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Alisti San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6229 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 7-20-59

7-20-59 Ran and cemented (99') 3-5/8", 242, J-55 casing at 109' with 100 sacks
to cement, 122 cu. ft. Portland cement treated with 2% calcium chloride.
7-21-59 Good returns to surface. Surface temperature 90°F, formation temperature 75°F. Estimated strength after 12 hours 1100 psi. Flanged up and waited on cement. Pressure tested casing and O.P. with 700 psi.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company
Address 705 West Municipal Drive
Farmington, New Mexico

Original signed by
B. W. SHEPARD
By B. W. Shepard
Title Exploitation Engineer