

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe, New Mexico
Lease No. 87-078064
Unit Carson Unit

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. 13-12 is located 1780 ft. from (N) line and 460 ft. from (E) line of sec. 12
34 12 25N 12W 100W
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Matl San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is 6360 ft. (approx. ground)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 8:00 A.M. 9-2-58

9-2-58 Ran and cemented (98%) 8 5/8", 24#, 3-15 casing at 103' with 100 sacks
to cement treated with 2% calcium chloride. Dred returns to surface.
9-3-58 Flanged up and waited on cement. Pressure tested casing and bit with
700 psi, 1.

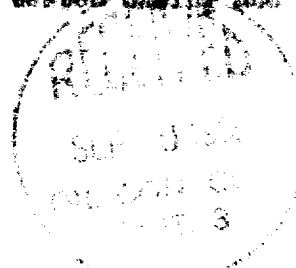

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Hell Oil Company

Address 705 W. Municipal Av.

Farmington, New Mexico

By E. W. Shepard

Title Exploitation Engineer