

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 000670  
Unit San Juan 27-4 Unit  
14-08-001-1054

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Water fracture</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 6, 1956

Well No. 8 is located 947 ft. from S line and 1800 ft. from W line of sec. 32  
SW Section 32 27N 4W NMPM  
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Wildcat Rio Arriba New Mexico  
 (Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is 7119 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

8-26-56 Total Depth 4007'. C.O. to 3961'.

Water fractured Pictured Cliffs perforated interval 3924-56 with 51,850 gallons water and 40,000# sand. Breakdown pressure 1500#, maximum pressure 1500#, average treating pressure 1500#. Injection rate 73 bbls./min. Flush 5000 gallons.

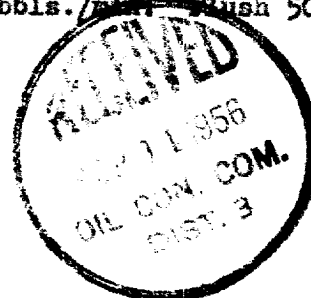

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By D. W. Boyd

Title Petroleum Engineer