

**B. & R.
SERVICE COMPANY**

TEMPERATURE SURVEY

COMPANY..... EL PASO NATURAL GAS COMPANY

WELL SAN JUAN 27-4 #14X FIELD

COUNTY RIO ARriba STATE NEW MEXICO

SEC..... 18 TWP..... 27N RGE..... 4W

APPROX. TOP CEMENT..... 2400'

Survey Begins at 2000 Ft. Ends at 3587 Ft.

Approx. Fill-Up 55% Max. Temp. 117° @ 3587'

Log Measured From R. T. Run No. 1

Casing Size	Casing Depth	Diam of Hole	Depth
9 $\frac{1}{8}$ from 0	to 3541'	12 $\frac{1}{4}$ from	to 3541'
from	to	from	to

Date of Cementing OCTOBER 9, 1957 Time 5:30 P.M.


Date of Survey OCTOBER 10, 1957 Time 6:00 A.M.

Amount of Cement 650 SACKS Type 50/50 POZMIX


Amount of Admix (4% GEL- $\frac{1}{4}$ " FLOCELE/SK) Type

Recorded by SMITH Witnessed by D. W. STEFFIN

REMARKS OR OTHER DATA

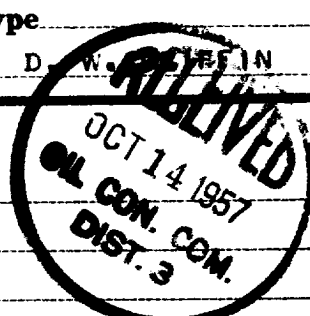

TEMPERATURE IN DEGREES FAHRENHEIT

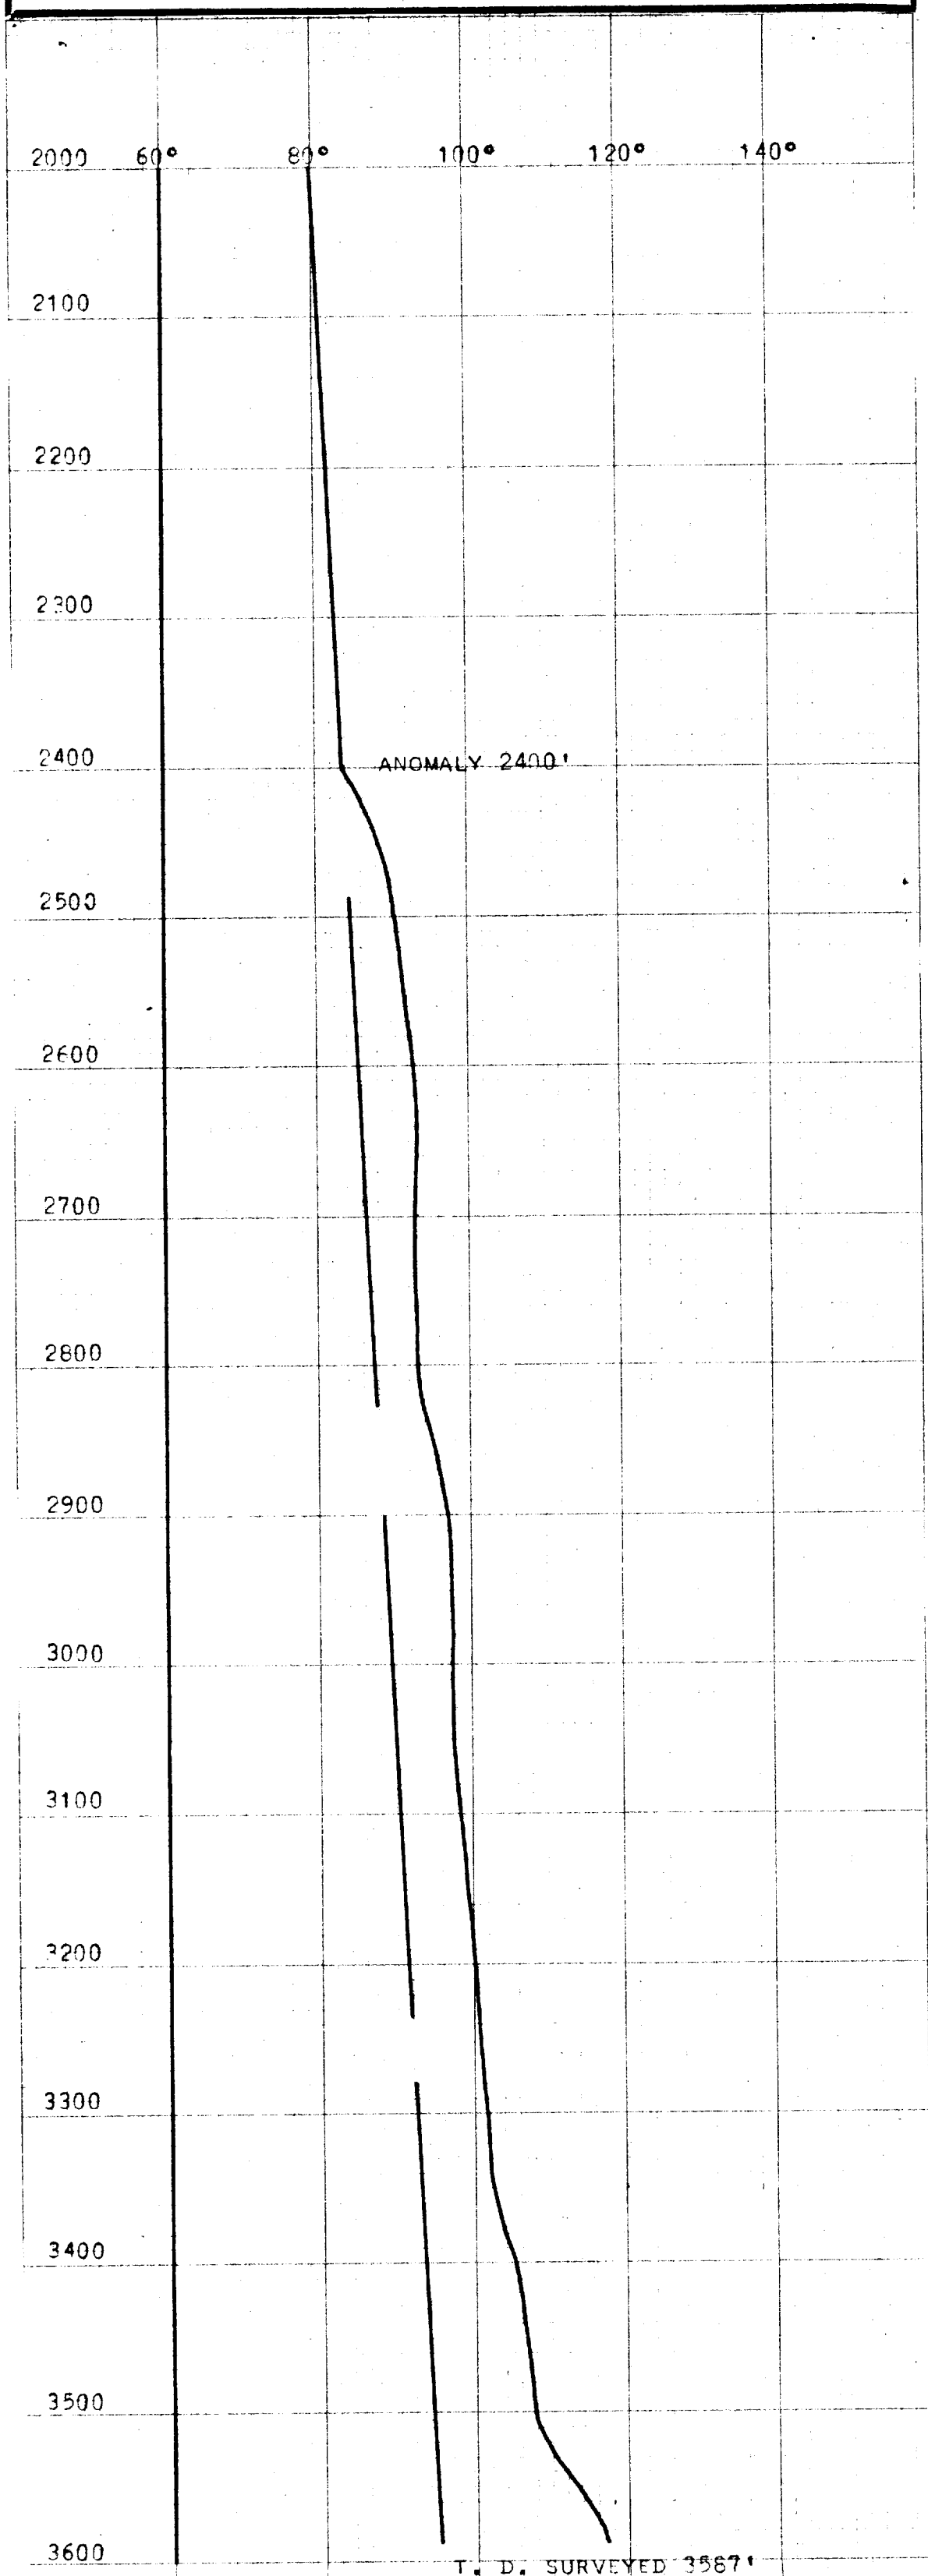

T. D. SURVEYED 3587'

1. The first step in the process is to identify the problem or issue that needs to be addressed. This involves gathering information and understanding the context of the problem.

**B. & R.
SERVICE COMPANY**

TEMPERATURE SURVEY

COMPANY EL PASO NATURAL GAS COMPANY

WELL SAN JUAN 27-4 #14-X FIELD

COUNTY RIO ARriba STATE NEW MEXICO

SEC. 18 TWP. 27N RGE. 4W

APPROX. TOP CEMENT 600'

Survey Begins at 300 Ft. Ends at 2367 Ft.
Approx. Fill-Up 68% Max. Temp. 91° @ 2367'
Log Measured From R. T. Run No. 1

Casing Size	Casing Depth	Diam of Hole	Depth
9 $\frac{1}{2}$ from 0 to		12 $\frac{1}{4}$ from to	
from to		from to	

Date of Cementing OCTOBER 10, 1957 Time 2:00 P.M.
Date of Survey OCTOBER 11, 1957 Time 2:00 A.M.
Amount of Cement 650 SACKS (2% GEL) Type 50/50 POZMIX
Amount of Admix Type
Recorded by SMITH Witnessed by P. W. GRIFFIN

REMARKS OR OTHER DATA

HOWCO RETAINER SET @ 2334'

TEMPERATURE IN DEGREES FAHRENHEIT

