

1000 Rio Brazos Rd. Aztec, NM 87410

Energy, Minerals and Natural Resources Department

Santa Fe, New Mexico 87504-2088

**SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE
(Revised 3/9/94)**

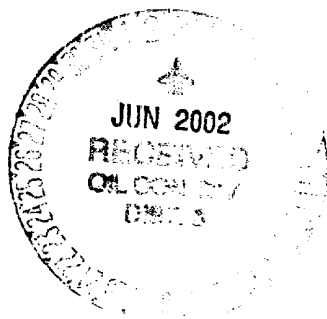
PIT REMEDIATION AND CLOSURE REPORT

South

0

0

0



Date Remediation Started: No Remediation Necessary Date Completed: N/A

Remediation Method: Excavation: _____ Approx. cubic yards _____

(Check all appropriate sections)

Landfarm _____ Insitu Bioremediation _____

Other _____

Remediation Location: Onsite _____ Offsite _____

(i.e. landfarmed onsite,

name and location of

offsite facility)

General Description Of Remedial Action: _____

Ground Water Encountered: No X Yes _____ Depth _____

Final Pit: Sample location Center of Pit Bottom

Closure Sampling: _____

(If multiple samples Sample depth 3'

attach sample results

and diagram of sample Sample date 9/27/2001 Sample time 3:00 PM

locations and depths)

Sample Results

Benzene (ppm) 1.13

Total BTEX (ppm) 10.54

Field headspace (ppm) N/A

TPH 650

Ground Water Sample: Yes _____ No X (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 5/2/2002 PRINTED NAME John E. Cofer

SIGNATURE John E. Cofer AND TITLE Environmental Coordinator

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified
Nonhalogenated Volatile Organics
Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	97070-003-397
Sample ID:	SEP Water Pit	Date Reported:	10-04-01
Laboratory Number:	21103	Date Sampled:	09-27-01
Chain of Custody No:	7532	Date Received:	09-28-01
Sample Matrix:	Soil	Date Extracted:	10-03-01
Preservative:	Cool	Date Analyzed:	10-04-01
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	640	0.2
Diesel Range (C10 - C28)	10.2	0.1
Total Petroleum Hydrocarbons	650	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28-7 #208.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	97070-003-397
Sample ID:	SEP Water Fit	Date Reported:	10-04-01
Laboratory Number:	21103	Date Sampled:	09-27-01
Chain of Custody:	7532	Date Received:	09-28-01
Sample Matrix:	Soil	Date Analyzed:	10-04-01
Preservative:	Cool	Date Extracted:	10-03-01
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	1,130	1.8
Toluene	2,130	1.7
Ethylbenzene	2,220	1.5
p,m-Xylene	1,420	2.2
o-Xylene	3,640	1.0
Total BTEX	10,540	


ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	95 %
	1,4-difluorobenzene	95 %
	Bromochlorobenzene	95 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28-7 #208.


Analyst


Review

7532

ENVIROTECH INC.

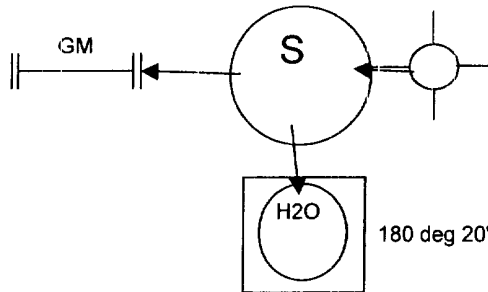
5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615

Lease Name: San Juan 28-7 # 208

Operator: Conoco

Date: 10-06-01

Site Security
(Indicate North)



Lease Name: San Juan 28-7 #208

Federal/ Indian Lease No:

SF 078640

CA No.:

Unit : K

Legal Description: S-15, T-27N, R-7W

County: Rio Arriba

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM