

NO. OF COPIES RECEIVED	4
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	2

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/> FEDERAL <input checked="" type="checkbox"/> Fee <input type="checkbox"/>	
SF 078430	

SUNDRY NOTICES AND REPORTS ON WELLS <small>(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)</small>	
1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- 2. Name of Operator SOUTHERN UNION PRODUCTION COMPANY 3. Address of Operator P. O. Box 808, FARMINGTON, NEW MEXICO 87401 4. Location of Well UNIT LETTER J , 1745 FEET FROM THE SOUTH LINE AND 1485 FEET FROM THE EAST LINE, SECTION 15 TOWNSHIP 26N RANGE 8W NMPM. 15. Elevation (Show whether DF, RT, GR, etc.) 7107 FT. R.K.B.	7. Unit Agreement Name 8. Farm or Lease Name NEWSON "A" 9. Well No. 6 10. Field and Pool, or Wildcat BADIN DAKOTA 12. County SAN JUAN

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER REPAIR CASING FAILURE <input checked="" type="checkbox"/>


SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

We Propose To:

- RIG UP UNIT. PULL 1-1/2", E.U.E., 2.90# TUBING.
- RUN CASING INSPECTION LOG.
- DEPENDENT ON CONDITION OF CASING REPAIR CASING BY SQUEEZE CEMENTING WITH REQUIRED AMOUNT OF CEMENT OR SET 4-1/2" MODEL "K" BAKER RETAINER AT APPROX. 7100 FT. RUN 1-1/2", E.U.E., 2.90# TUBING AND FILL ANNULUS BETWEEN TUBING AND CASING WITH APPROX. 95 BBL. OF MILCHEN CARBO TEC TUBING PAC MATERIAL.
- COMPLETE REPAIR AND RETURN WELL TO PRODUCTION.
- ESTIMATED DATE FOR STARTING WORK IS MARCH 20, 1974.

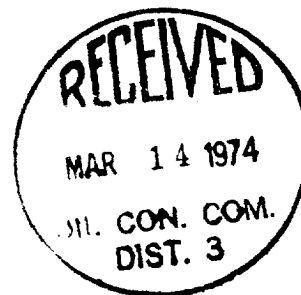

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original signed by SIGNED GILBERT D. NOLAND, JR.	TITLE DRILLING SUPERINTENDENT	DATE MARCH 11, 1974
APPROVED BY <i>Ernest C. Amos</i>	TITLE SUPERVISOR DIST. #2	DATE MAR 14 1974
CONDITIONS OF APPROVAL, IF ANY:		