


(SUBMIT IN TRIPLICATE)

Land Office Santa Fe

Lease No. 07817

Unit San Juan 21-7 Unit
14-08-001-459

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

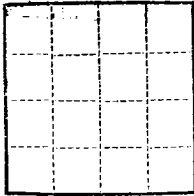

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....		SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....		SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....		SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....		SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Apr 11 23, 1956

Well No. 43 is located 1600 ft. from 2000 S line and 800 ft. from 2000 W line of sec. 21

3 Section 21
(1/4 Sec. and Sec. No.)

20N
(Twp.)

7E
(Range)

RMPM
(Meridian)

Blanco
(Field)

El Arriba
(County or Subdivision)


New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 6006 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 3-25-56. Total Depth 5065'.
Ran 156 joints 5 1/2", J-55, 15.50#, casing (5065') set at 5065' with 150 sacks regular cement, 150 sacks Pozmix, 150# Floccin and 25 Gal. Held 1000# 30 minutes.
Top of cement by temperature survey at 4900'.

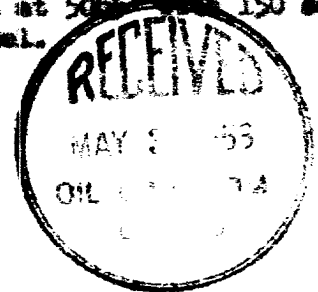

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By [Signature]

Title Petroleum Engineer