


Land Office Santa Fe
Lease No. 081506 - A
Unit San Juan 28-5

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

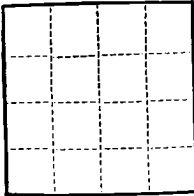

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Water Frac.</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 14, 1963

Well No. 57 is located 890 ft. from N line and 1150 ft. from E line of sec. 19

NE Section 19
(¼ Sec. and Sec. No.)

28N 5W
(Twp.) (Range)

104PM
(Meridian)

Basin - Dakota
(Field)

Rio Arriba
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 6569 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 12-24-62, TD 7920', COED 7875'. Perf. 7638-5) •(1 SPF) 7682-88 (2 SPF).
7730-42 (1 SPF) 7860-12, 7834-40 (2 SPF). Frac w/87,000 gal water, 75,000# sand.
Flush w/5225 gal. IR 31, Max P. 3800#, RD 1700#, King Pr. 2700-2900-2950-
3150-3300#, 3 drops of 12 balls, 1 of 24 balls.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company EL PASO NATURAL GAS COMPANY

Address Box 990
Farmington, New Mexico

By ORIGINAL SIGNED M. E. McANALLY
Title Petroleum Engineer