

		X	

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe

Lease No. SP-077966

Unit Gallegos Canyon Unit

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF..... <u>8-5/8"</u> <u>X</u>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

RECEIVED
NOV 7 1961
U.S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

Gallegos Canyon Unit

Farmington, New Mexico November 6, 1961

Well No. 115 is located 810 ft. from N line and 2130 ft. from E line of sec. 23

NW 1/4 NE 1/4 of Section 23 T-28-N R-13-W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)


Totah Gallup San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft. (To be reported later)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 12-1/4" hole October 30, 1961. Set 8-5/8" casing at 210' with 135 sacks Incon cement containing 2 percent Calcium Chloride. Circulated 25 sacks of cement. After waiting on cement, tested 8-5/8" casing with 500 psi for 15 minutes, which held with no indication of pressure drop. Reduced hole to 7-7/8" at 212' and resumed drilling operations.

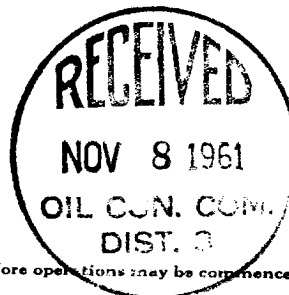

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Pan American Petroleum Corporation

Address P. O. Box 480

Farmington, New Mexico

Attn: L. O. Speer, Jr.

ORIGINAL SIGNED BY
R. M. Bauer, Jr.

By _____

Title Senior Petroleum Engineer