

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 87 077963
Unit C. J. Holder

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	<input type="checkbox"/>
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	<input type="checkbox"/>
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	<input type="checkbox"/>
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	<input type="checkbox"/>
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	<input type="checkbox"/>
NOTICE OF INTENTION TO ABANDON WELL.....		<input type="checkbox"/>

RECEIVED
MAR 1 1961
U.S. GEOLOGICAL SURVEY
FERTINGTON, NEW MEXICO

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

C. J. Holder

Fernington, New Mexico February 25, 1961


Well No. 6 is located 600 ft. from N line and 1800 ft. from W line of sec. 9
7 1/4 S 1/4 of Section 9 T-20N R-13E N.M.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
One One Keller San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6028 ft. (100)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 12-1/4" hole on February 9, 1961 and drilled to 235'. Set 6-5/8" casing at 235' with 175 sacks cement, containing 2 percent calcium chloride. Circulated 20 sacks of cement. After waiting on cement, tested 6-5/8" casing with 1000 psi for 30 minutes which held with no indication of pressure drop. Reduced hole to 7-7/8" at 235' and resumed drilling operations.

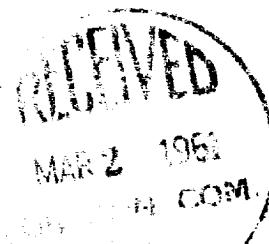

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Pan American Petroleum Corporation

Address Box 480, Fernington, New Mexico

Attn: L. O. Spier, Jr.

By _____

Title Senior Petroleum Engineer