


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYLand Office Santa FeLease No. 078415-A

Unit _____

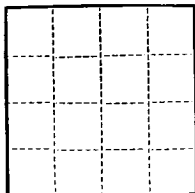

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Frac.</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 13, 1962

Roelofs

Well No. 5 is located 990 ft. from N line and 1650 ft. from W line of sec. 221/4 Section 22

(1/4 Sec. and Sec. No.)

29-N

(Twp.)

8-W

(Range)

N.M.P.M.

(Meridian)

Unders. Pictured Cliffs

(Field)

San Juan

(County or Subdivision)

New Mexico

(State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 7-7-62, T.D. 3435. C.O.T.D. 3386'.

Perf 3339-45; 3322-28 (2 SPP)

Frac w/31,798 gallons water, 30,000# sand.

Flush w/798 gallons water. I.R. 24.6 BPM.

Max pr 2800#, BDP 2800#, tr pr 2200-2800,

1 drop of 12 balls.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company E1 Paso Natural Gas CompanyAddress Box 990Farmington, New Mexico

Original Signed D. W. Meehan

By _____

Title Petroleum Engineer