DEPUTY OIL & GAS INSPECTOR

DEC 3 0 1997

Meter Number: 70122 70122-2

Location Name: SHANE GAS COM #1 (PIT 2)


Location:TN-29 RG-09

SC-14 UL-J

2 - Federal

NMOCD Zone:OUTSIDE

Hazard Ranking Score:00

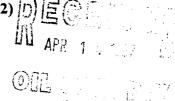

RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.




FIELD PIT SITE ASSESSMENT FORM

GENERAL	Meter: 70122 Location: SHANE GAS COM # (P,T#2) Operator #: 0203 Operator Name: Amoco P/L District: BcoonfreeD Coordinates: Letter: Section / Township: 25 Range: 9 Or Latitude Longitude Pit Type: Dehydrator Location Drip: X Line Drip: Other: Site Assessment Date: 5-13-94 Area: 10 Run: 92				
SITE ASSESSMENT	NMOCD Zone: (From NMOCD Maps) Inside Outside Outside Outside Depth to Groundwater Less Than 50 Feet (20 points) Greater Than 100 Ft (0 points) Wellhead Protection Area: Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or; Is it less than 200 ft from a private domestic water source? Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) Orecter Than 1000 Ft (10 points) Greater Than 1000 Ft (20 points) (2) Greater Than 200 Ft (20 points) (3) Name of Surface Water Body (Surface Water Body				
	TOTAL HAZARD RANKING SCORE: POINTS				
RKS	Remarks: TWO PITS NEAR DETERHOUSE. THIS PIT DOESNOT HAVE A FENCE! PITS ON COCATION, TWO TO BE CLOSED.				
REMARKS					

REMARKS

ORIGINAL PIT LOCATION

Original Pit: a) Degrees from North 25° Footage from Wellhead 203' b) Length: 15' Width: 15' Depth: 2'

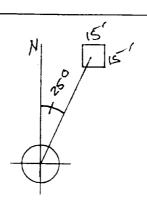

Remarks:

CONTRACTOR OF THE PARTY.

PHOTOGRAPH AH-3(14+15)

Completed By:

Signature

Date

FIEL PIT REMEDIATION/CLOSU. FORM

GENERAL	Meter: 70/22 Location: Shanc Gas com #1 (Pit #2) Coordinates: Letter: I Section 14 Township: 29 Range: 9 Or Latitude Longitude Date Started: 6-24-94 Area: 10 Run: 92
FIELD OBSERVATIONS	Sample Number(s): MK 36 Sample Depth: 3' Feet Final PID Reading Depth 3' Feet Yes No Groundwater Encountered (1) (2) Approximate Depth Feet
URE	Remediation Method : Excavation
ISOTO	Soil Disposition: Envirotech (1) (3) Tierra Other Facility (2) Name: Pit Closure Date: 6-24-94 Pit Closed By: BET
REMARKS	Remarks: EDNG line were marked Brown Soil HIDrocarbon odor Hit sand store 3'
L	Signature of Specialist: Morgan Xillion (SP3191) 04/07/9



FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

	Field	ID		Lab ID		
SAMPLE NUMBER:	MK36		949	945518		
MTR CODE SITE NAME:	70122 (DH#2)		N/A 1159			
SAMPLE DATE TIME (Hrs):						
SAMPLED BY:	N/A					
DATE OF TPH EXT. ANAL.:	627194 NA NG		6/2/194			
DATE OF BTEX EXT. ANAL.:			A A C C C C C C C C			
TYPE DESCRIPTION:			loane Dr	Coaux Brown Sand/Clay		
REMARKS: _						
	F	RESULTS				
PARAMETER	RESULT UNITS		QUALIFIERS			
FANAMETER			DF	Q	M(g)	V(ml)
BENZENE		MG/KG				
TOLUENE		MG/KG				
ETHYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
TPH (418.1)	7660	MG/KG			0.79	28
HEADSPACE PID	51	РРМ				
PERCENT SOLIDS	92.4	%				
e Surrogate Recovery was at rrative:	TPH is by EPA Method 41	8.1 and BTEX is by EPA % for this samp		was accep	otable.	
= Dilution Factor Used	Loss.		Date: _/	114/40	/	

Test Me dd for Oil and Grease and Petroleum Hydrocarbons in Water and Soil Perkin-Elmer Model 1600 FT-IR Analysis Report #4/06/27 15:20 Sample Udentification This is take of tamping p n Parama Nakalah merendian bermula dan kelebah As Heritago (1981) - - - - -