

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 012292
Unit San Juan 31-6 Unit
14-05-601-464

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Water Frac.</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 22, 1960


Well No. 18-3 is located 1460 ft. from S line and 1040 ft. from W line of sec. 3
SW/4 Sec. 3 (1/4 Sec. and Sec. No.) JCN (Twp.) 6W (Range) N.M.P.M. (Meridian)
Blanco Mesa Verde (Field) Rio Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6272 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

7-2-60 Total Depth 5724'. C.O.T.D. 5682'. Water fractured point Lookout perf. int. (2 in/ft) 5476-62; 5486-92; 5496-5504; 5524-34; 5548-58; 5576-90; 5626-32; 5638-44 w/60,329 gallons water and 65,000 sand. ED pr. none, max. pr. 2400#, avg. tr. pr. 1800#. I.R. 67.4 BHM. Flush 10,475 gallons. Dropped 2 sets of 20 balls, one set of 30, and 1 set of 5 balls for 5 stages.

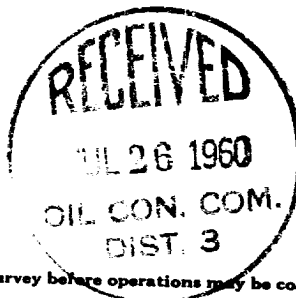

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

Original Signed D. W. Meehan

By _____

Title Petroleum Engineer