

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on the
reverse side)

Form approved
Bulldog Brand No. 12 11/71
5. LEASE DESIGNATION AND SERIAL NO.

14-20-603-2200

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Navajo

7. UNIT ACQUISITION NAME

Northwest Cha Cha

8. FARM OR LEASE NAME

NW Cha Cha Unit

9. WELL NO.

43-20

10. FIELD AND POOL, OR WILDCAT

Cha Cha Gallup

11. SEC., T., R., M., OR BLS. AND
SURVEY OR AREA

Sec 20-29N-1/W NMPM

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
Humble Oil & Refining Company

3. ADDRESS OF OPERATOR
P. O. Box 120, Denver, Colorado 80201

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

NENE(2310' FSL & 330' FEL) of Section 20

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
5570' KB

12. COUNTY OR PARISH
San Juan

13. STATE
New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)


REPAIRING WELL
ALTERING CASING
ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recognition Report and Log Form.)

17. HIGHLIGHT PROPOSED OR COMPLETED OPERATIONS (Clearly, state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all marks and zones pertinent to this work.)*

- 11-20-71 - Spot 10 sack cement plug 5055-4950', spot 10 sack cement plug 4200-4100'.
- 11-30-71 - Shot 4 1/2" casing at 2300', pk pulled casing. Spot 40 sack cement plug at 2450', 40 sack cement plug 970-870', 40 sack cement plug 262-182'.
- 12-1-71 - Set regulation dry hole marker in top of surface casing with 12 sack cement plug 30-0'.
Intervals between plugs filled with mixed mud.
- 2-7-72 - Location cleaned ready for inspection.

- cc: 2 - NM O&G Commission
- 1 - Minebals Supervisor - Navajo Tribe
- 1 - Midland
- 1 - Clinton

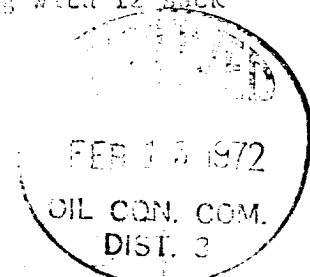

FEB 14 1972

U.S. GEOLOGICAL SURVEY

18. I hereby certify that the foregoing is true and correct

SIGNED _____ TITLE Dist. Superintendent DATE 2-9-72

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: