


ILLEGIBLE

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 07819A
Unit Ludwick

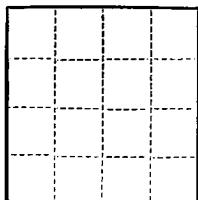

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

May 10

, 19 61

Well No. 18 is located 990 ft. from N line and 1790 ft. from E line of sec. 6

N 6 Section 6

(1/4 Sec. and Sec. No.)

R3-N

(Twp.)

10-W

(Range)

N.M.P.M.

(Meridian)

Basin Dakota

(Field)

San Juan

(County or Subdivision)

New Mexico

(State or Territory)

The elevation of the derrick floor above sea level is 5907 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 5-6-61, Total Depth 6953'.

Run 280 joints, 4 1/2" casing (56 jts. 11.60# and 164 jts 9.5#)

(6940') set @ 6953'. Cemented 1st stage with 240 sacks regular,

1/4 gal. 1/4# Surping/sk., 1/8# Flaccala/sk., 1/4# R-5, followed by

50 sks. regular, 1/4# R-5. Cemented 2nd stage w/230 sacks regular,

1/4 gal. Cemented 3rd stage w/150 sks. regular. Hold 1500#/30 minutes

RECEIVED

MAY 16 1961

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

By ORIGINAL SIGNED A.M. SMITH

Title Petroleum Engineer