

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SANTA FE

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME
Northeast Blanco Unit
Agrmt. No. 1, Sec. 929

8. FARM OR LEASE NAME

Northeast Blanco Unit

9. WELL NO.

28

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 34, 31N, 7W

12. COUNTY OR PARISH

Rio Arriba

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL ☐ GAS ☒ OTHER ☐
WELL WELL

2. NAME OF OPERATOR

Blackwood & Nichols Company

3. ADDRESS OF OPERATOR

P.O. Box 1237, Durango, Colorado 81301

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

770' F/SL - 1790' F/EL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6283' GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐Rework well ☒(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

On 12-4-75, pulled 2-3/8" tubing, set retrievable bridge plug at 5200', tested 5 1/2" Csg with 1200 PSI for thirty minutes. Held O.K. Recovered bridge plug, cleaned out with gas and drilled new hole to 5571'. On 12-5-75, 5571' TD, ran 341' of 4" flush joint liner set at 5570', top at 5229', cemented with 35 sacks of Class B cement.

On 12-7-75, perforated liner at 5436' with two 3/8" holes and squeezed cement with seventy-five sacks of Class B cement. On 12-8-75, drilled cement in liner to 5436', pressured up to 1500 PSI for thirty minutes, held O.K. On 12-9-75, perforated the Point Lookout Zone 5324' - 5544' with one hole per foot. Sand-water fractured with 76,000 gals water and 45,000 lbs. sand. Set retrievable bridge plug at 5217', perforated Cliffhouse Zone with one hole per foot 5125' - 5194'. Sand-water fractured with 60,000 gals. water and 45,000 lbs. sand. Cleaned out with gas and ran 177 Jts, 2-3/8" tubing 5531' set at 5542'.

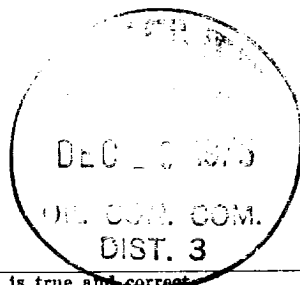

18. I hereby certify that the foregoing is true and correct.

by Delasso Loos

SIGNED Delasso Loos

Dist. Mgr.

TITLE District ManagerDATE 12-16-75

(This space for Federal or State office use)

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side