

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well

2. NAME OF OPERATOR

Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR

P.O. Box 90, Farmington, N.M. 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 845' FNL & 790' FEL
AT TOP PROD. INTERVAL: Same as above
AT TOTAL DEPTH: Same as above

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☒ Drlg Operations


SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐
☒

FEB 25 1981

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

(NOTE: Report results of multiple completion or zone change to Form 9-331-C)

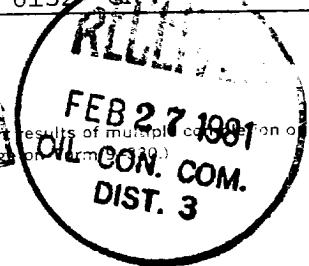

5. LEASE

SF 078999

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

San Juan 31-6 Unit

8. FARM OR LEASE NAME

San Juan 31-6 Unit

9. WELL NO.

#36

10. FIELD OR WILDCAT NAME

Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec 27 T31N R6W

12. COUNTY OR PARISH

Rio Arriba

13. STATE

New Mexico

14. API NO.

30-039-22488

15. ELEVATIONS (SHOW DE KDB, AND WD)

6132' GR

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Jan 8, 1981 Ran 244 jts (1108' of 11.6# 6792' of 10.5#) 4-1/2", K-55, ST&C & set at 7890'. Cemented w/ 225 sx Cl "B" w/ 8% gel & 12-1/2# fine gilsonite/sx & 0.4% R-11. Tailed w/ 100 sx Cl "B" w/ 1/4# tuf-plug & 0.4% R-11. Preceded w/ 40 bbls gel wtr. Displaced w/ 125 bbls wtr. Down @ 1315 hrs 1-8-81. Wilson ran temp survey - stuck on btm 7878'. Released rig @ 1700 hrs 1-8-81

Jan 9, 1981 Fishing for wireline tools.

NOW WAITING ON COMPLETION

Subsurface Safety Valve: Manu. and Type _____ Set _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna J. Brace TITLE Production Clerk DATE Feb 20, 1981

(This space for Federal or State office use)

APPROVED FOR RECORD

CONDITIONS OF APPROVAL, IF ANY:

FEB 26 1981

FARMINGTON DISTRICT
djb

*See Instructions on Reverse Side