

Terence A. Frost
DEPUTY OIL & GAS INSPECTOR

DEC 22 1997

Approved

Meter Number: 74942
Location Name: NEW MEXICO COM F #1
Location: TN-30 RG-10
SC-36 UL-M
1 - State
NMOCD Zone: OUTSIDE
Hazard Ranking Score: 00

RECEIVED
APR 14 1997
OIL CON. DIV.
DIST. 3

**RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS
LOCATED OUTSIDE OF THE VULNERABLE ZONE
IN THE SAN JUAN BASIN**

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone	10^{-9} to 10^{-13} cm/sec
Shale	10^{-12} to 10^{-16} cm/sec
Clay	10^{-12} to 10^{-15} cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.

FIELD PIT SITE ASSESSMENT FORM

EPFS

EL PASO FIELD SERVICE

GENERAL

Meter: 74942 Location: NEW MEXICO COM F #1

Operator #: 0263 Operator Name: TEXACO P/L District: BLOOMFIELD

Coordinates: Letter: M Section 36 Township: 30 Range: 10

Or Latitude _____ Longitude _____

Pit Type: Dehydrator _____ Location Drip: X Line Drip: _____ Other: _____

Site Visit Date: 4-15-94 Run: 10 83

SITE ASSESSMENT

NMOCD Zone: Inside Land Type: BLM ☐
 (From NMOCD Vulnerable State ☒
 Maps) Zone ☐
 Outside ☒ Fee ☐
 Indian _____

Depth to Groundwater

Less Than 50 Feet (20 points) ☐
 50 Ft to 99 Ft (10 points) ☐
 Greater Than 100 Ft (0 points) ☒

Wellhead Protection Area :

Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ YES (20 points) ☒ NO (0 points)

Horizontal Distance to Surface Water Body

Less Than 200 Ft (20 points) ☐
 200 Ft to 1000 Ft (10 points) ☐
 Greater Than 1000 Ft (0 points) ☒

Name of Surface Water Body _____

(Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds)


TOTAL HAZARD RANKING SCORE: 0 POINTS

REMARKS

Remarks : ONLY PIT ON LOCATION. PIT IS DRY.

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 314° Footage to Wellhead 62'
 b) Degrees from North _____ Footage to Dogleg _____
 Dogleg Name _____
 c) Length : 14' Width : 12' Depth : 2'

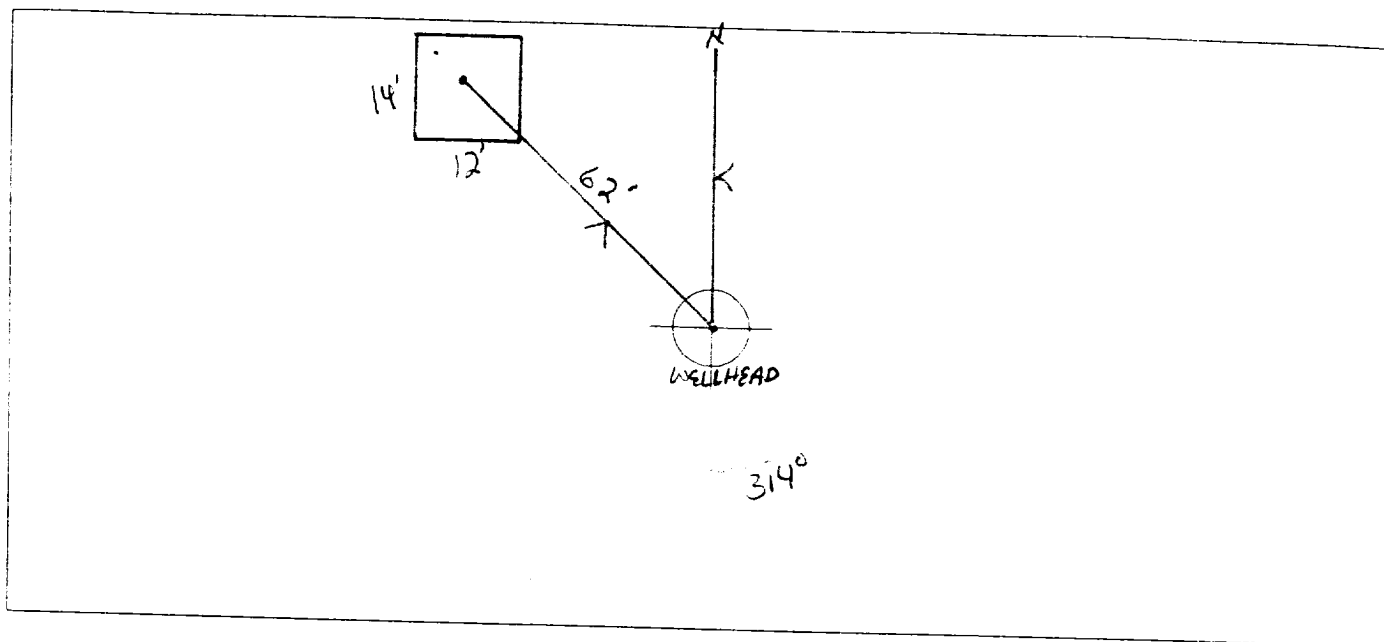

REMARKS :

STARTED TAKING PICTURES AT 9:04 A.M.
END DUMP

Completed By:

Bobt Thompson
 Signature

4-15-94
 Date

FIELD SITE REMEDIATION/CLOSURE FORM

GENERAL

Meter: 74942 Location: New Mexico Com F #1
 Coordinates: Letter: m Section 36 Township: 30 Range: 10
 Or Latitude _____ Longitude _____
 Date Started : 6-7-94 Area: 10 Run: 83

FIELD OBSERVATIONS

Sample Number(s): mk 13 _____
 Sample Depth: 6 Feet
 Final PID Reading 61 PID Reading Depth 6 Feet
 Yes No
 Groundwater Encountered ☐ (1) ☒ (2) Approximate Depth _____ Feet

CLOSURE

Remediation Method :
 Excavation ☐ (1) Approx. Cubic Yards _____
 Onsite Bioremediation ☐ (2)
 Backfill Pit Without Excavation ☒ (3)
 Soil Disposition:
 Envirotech ☐ (1) ☐ (3) Tierra
 Other Facility ☐ (2) Name: _____
 Pit Closure Date: 6-7-94 Pit Closed By: BEI

REMARKS

Remarks : Soil was black all the way through Hit Sand-
stone at 6' lines were marked

Signature of Specialist: Morgan Killian



FIELD SERVICES LABORATORY

ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

SAMPLE NUMBER:

Field ID

Lab ID

MTR CODE | SITE NAME:

SAMPLE DATE | TIME (Hrs):

SAMPLED BY:

DATE OF TPH EXT. | ANAL.:

DATE OF BTEX EXT. | ANAL.:

TYPE | DESCRIPTION:

mk 13

945387

74942

N/A

6-7-94

0830

N/A

6/10/94

6/10/94

N/A

N/A

VG

Black Sand/Clay

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE		MG/KG				
TOLUENE		MG/KG				
ETHYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
TPH (418.1)	1470	MG/KG			2.14	28
HEADSPACE PID	KDK 61 6-8-94 66	PPM				
PERCENT SOLIDS	87.9	%				

— TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 —

The Surrogate Recovery was at N/A % for this sample All QA/QC was acceptable.
Narrative:

DF = Dilution Factor Used

Approved By:

Don Swartz

Date:

6/16/94

 Test Method for
 Oil and Grease and Petroleum Hydrocarbons
 in Water and Soil
 Perkin-Elmer Model 1600 FT-IR
 Analysis Report

94/06/10 11:52

Sample identification
 945387

Initial mass of sample, g
 0.140

Volume of sample after extraction, ml
 28.000

Petroleum hydrocarbons, ppm
 1466.162

Net absorbance of hydrocarbons (2930 cm⁻¹)
 0.198

