

STATE OF NEW MEXICO
OIL CONSERVATION
COMMISSION
DISTRICT NO. 3
Phone 99 P. O. Box 697
AZTEC, NEW MEXICO

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078385
Unit E 1/2 Section 35

RECEIVED

DEC 6 1951
OIL CON. COM.

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 5, 1951, 19

Well No. Florance #1-39 is located 990 ft. from N line and 1650 ft. from E line of sec. 35

NE 1/4 of Section 35 T-30-N R-8-W NMPH
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Blanco San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5961 ft. G.L.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

Ran 11 Joints of 7" 23# J-55 (450') and 91 Joints of 7" 20# J-55 (3988') casing landed at 4422' with 200 sacks 1 st stage & 250 sacks regular cement 2 nd stage with full returns throughout job. Casing is set in top of Cliffhouse formation, cable tools with rotary attachment using gas mill will be moved in for Mesaverde completion; then well will be shot with S.N.G. Water shut-off test will be made where plug is drilled with cable tools.

(Present T. D. 4426')

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.


Company Delhi Oil Corporation

Address P. O. Box 1175

Farrington, N. M.

By J. B. Howell

Title Superintendent

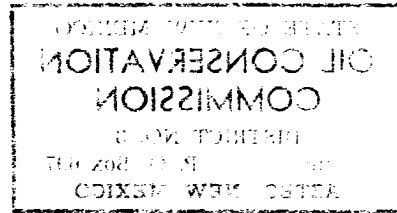

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
UNITED STATES
(SUBMIT IN TRIPlicate)

Land Office _____
Lesse No. _____
Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO ABANDON WELL		
NOTICE OF INTENTION TO FILL OR ALTER CASING		
NOTICE OF INTENTION TO SHUT OR ABANDON		
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		
NOTICE OF INTENTION TO CHANGE PLANS		
NOTICE OF INTENTION TO DRILL		
SUBSEQUENT REPORT OF WATER SHUT-OFF		
SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING		
SUBSEQUENT REPORT OF ALTERING CASING		
SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR		
SUBSEQUENT REPORT OF ABANDONMENT		
SUPPLEMENTARY WELL HISTORY		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE OR OTHER DATA)

Well No. _____ is located _____ ft from _____ line and _____ ft from _____ line of sec. _____

_____ (Town)
_____ (County or Subdivision)
_____ (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casing; indicate mudlogging jobs, cementing, etc.; and all other important proposed work)

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company _____

Address _____

By _____

Signature _____