


30
N.

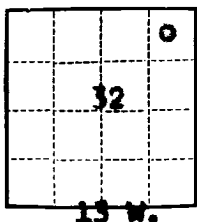

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**
Lease No. **078214**
Unit _____

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS APR 4 1963

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	U. S. GEOLOGICAL SURVEY
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	XX
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Northwest Farmington

April 2, 1963

Well No. 1-32 is located 790 ft. from [N] line and 790 ft. from [E] line of sec. 32
NE NE Section 32 T. 30N. R. 13W. NMPH
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Basin Dakota San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft. **5354' GL**


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

Spudded 1/17/63 - PBTD 6072

Drilled bridge plug @ 5860, Ran 181 joints
 1 1/2" OD, 2.75#, V-50, CW intergal joint tubing
 TE 5876.25 set @ 5888 KB. Nippled up well head.
 Initial Potential (After 7 day shut-in)

ROP - 2740 MCF/Day SITP - 1970
 CAOF - 3126 MCF/Day SICP - 1979

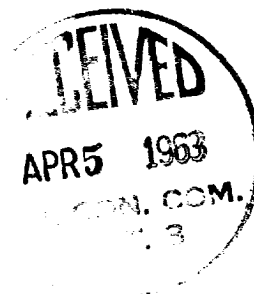

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company COMPASS EXPLORATION, INC.

Address 101 University Blvd.

Denver, Colorado

By _____

Title Manager of Exploration