

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-B1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	5. LEASE DESIGNATION AND SERIAL NO. NM 0206995
2. NAME OF OPERATOR Ladd Petroleum Corporation	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR 830 Denver Club Bldg., Denver, Colorado 80202	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 790' FNL & 1850' FWL of Section 35, T30N-R14W San Juan County, New Mexico	8. FARM OR LEASE NAME Aztec
14. PERMIT NO.	9. WELL NO. 1X
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5569' KB, 5557' GR	10. FIELD AND POOL, OR WILDCAT Basin Dakota
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 35-30N-14W
	12. COUNTY OR PARISH San Juan
	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

11-17-77 MI Service Unit. Worked packer 3 hrs. but unable to un-seat.
11-18-77 Worked packer free. Lowered packer to 5950' to check for fill (found none). Pulled tubing & packer. Found rubber elements gone off packer. Redressed packer. Ran packer (w/2 jts. tubing, 4' perforated sub & bull plug on bottom) on 2 3/8" tubing. Hydrotested tubing to 3000# running in hole (no leaks). NU tree.
11-19-77 RU swab. Swabbed 100 bbls. water in 7 hrs. Well started making gas. RD swab & service unit.
11-20-77 SI for pressure build-up.
11-21-77 Unloaded estimated 20 bbls. water. SI for pressure build-up.
11-22-77 Unloaded water. SI for pressure build-up.
11-23-77 thru 11-24-77 SI for Thanksgiving.
11-25-77 Turned well to sales.

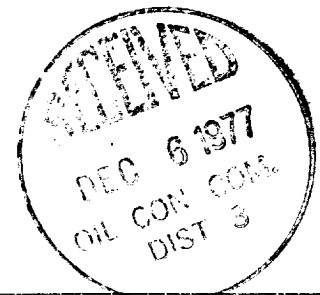

18. I hereby certify that the foregoing is true and correct

SIGNED

George B. Mayfield

TITLE Division Engineer

DATE 12-2-77

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side