

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 000597
Unit Gartner

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	X
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


Well No. 7 (OWO) is located 1190 ft. from SW line and 1650 ft. from W line of sec. 26
SW Sec. 26 30N 8W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5921 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

See Back for Remarks.

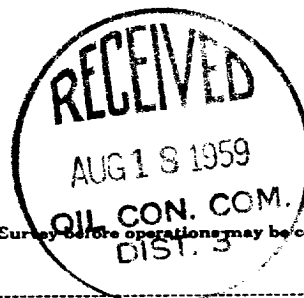

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
 Address Box 997
Farmington, New Mexico

By ORIGINAL SIGNED B.M. MEANS
 Title Petroleum Engineer

4-10-59 Rig up Britt Drilling Co. rig #4.
 4-11-59 Working on stuck tubing.
 4-12-59 Run Howco cutting tool. Cut tubing at 4344' and pulled. Rig #4.
 4-13-59 Set Culbertson Mfg. bridge plug at 4290'. Run Becker and tested casing. Found hole at approximately 750'. Set retainer and squeezed at 670'.
 4-14-59 Tested casing w/1000#. Held O.K. Drilling bridge plug and cleaning after squeeze.
 4-15-59 Blowing and cleaning shot hole.
 4-16-59 Blowing and cleaning out.
 4-17-59 Blowing and cleaning out. Reaming bridge.
 4-18-59 Blowing and cleaning out.
 4-19-59 Lost 5 joints of pipe & 2 DC's. Top of fish at 5010'.
 4-20-59 Pumped 100 sks. Went cement into annulus between surface pipe and production string. Max. pr. 600#. Shut in pr. opsl. Flushed w/one bbl. water.
 4-21-59 Drilling plug. Blowing hole.
 4-22-59 Ran 149 joints of tubing (4500') landed at 4593'.
 4-15-59 Date well was tested.