

	X	

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency Hernando-Lite

No. 14-20-604-1951

Allottee _____

Lease No. Hernando-Lite

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

RECEIVED

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 6

GEOLOGICAL SURVEY
FARMINGTON, 19158 MEXICO

Well No. 4 is located 1900 ft. from SW line and 3300 ft. from E line of sec. 33

NE SW/4 Sec. 33
(1/4 Sec. and Sec. No.)

31-N
(Twp.)

16-W
(Range)

NMPM
(Meridian)

Hernando-Gallup
(Field)

San Juan
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 5355 ft.

DETAILS OF WORK


(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

November 5, 1958 Total Depth 1326'.

Ran 32 joints 5-1/2", 15.50#, J-55 Casing (1315') set at 1323' with 50 sacks regular cement, 50 sacks Pozmix, 4% Gel., 1/4# Floccle per sack.

Held 1000#/30 Minutes.

Top of cement by temperature survey at 650'.

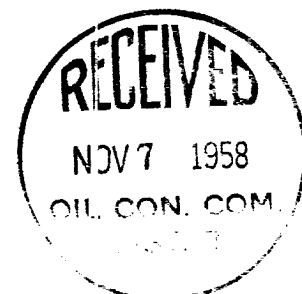

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Products Company

Address Post Office Box 1565

Farmington, New Mexico

ORIGINAL SIGNED BY: JOSEPH E. KREGER

Title Petroleum Engineer