

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. SE 0776-2  
Unit Labl

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


Well No. 1017 is located 700 ft. from N line and 790 ft. from E line of sec. 26  
1017 (1/4 Sec. and Sec. No.) 2-11 (Twp.) 12 (Range) 1 (Meridian)  
Basin Delora (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 5922 ft. G.L.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

P.B.T.D.- 7017  
 Sand-water fraced with 62,500 gals. water, 60,000# sand, flushed with 125 Bbls.  
 Breakdown pr. - 1800  
 Avg. treating pr. - 2000  
 Maximum treating pr.-3000  
 Avg. I.R. - 35.4 bps  
 dropped 15 rubber ball sealers  
 instant shut in pr.-1300  
 5 min. shut in pr.-1000  
 Ran 234 fte., 68-1' of 2 3/8" tubing, landed at 6650'  
 Shut in for gauge.

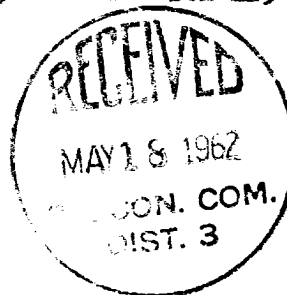

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Antec Oil and Gas Company

Address Drawer # 570

Farmington, N.M.

By ORIGINAL SIGNED BY JOE C. SALMON

Joe C. Salmon

Title District Superintendent