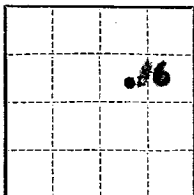


(SUBMIT IN TRIPLICATE)

Indian Agency Consolidated Ute

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee 14-20-604-83 ✓Lease No. Ute Mountain

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	2
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

RECEIVED
AUG 24 1959
U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


August 21, 1959

Well No. 6 is located 1900 ft. from N line and 1900 ft. from E line of sec. 21N/4 Sec. 21
(¼ Sec. and Sec. No.)31 N
(Twp.)14W
(Range)N7W
(Meridian)Verde Gallup
(Field)San Juan
(County or Subdivision)New Mexico
(State or Territory)The elevation of the G.L. 2561 ft. above sea level is 2561 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Install 2684' of 14#, J-55, 5½" Csg. to 2695' w/250 ex 8½ gal + ¾ floccula/sax + 50 sax heat. Plug down 12:10 A.M. 8/21/59. Centralizers = 2394', 2523', 2675'; Metal petal baskets = 1878', 2222', 2565'. Test 5½" csg. w/1500', 10 min. O.K.

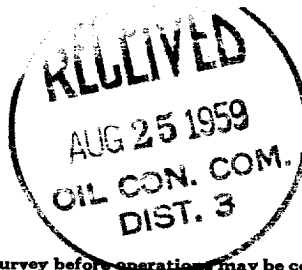

I understand that this plan of work must receive approval in writing by the Geological Survey before operation may be commenced.

Company Magnolia Petroleum CompanyAddress Box 2406,Hobbs, New MexicoBy J. Young, Jr.Title District Superintendent