


SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

Santa Fe, New Mexico 87504-2086

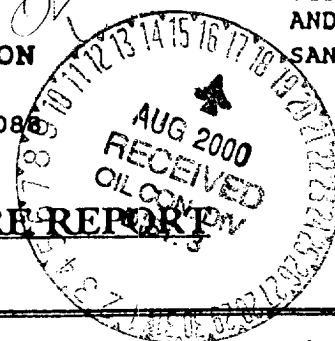

PIT REMEDIATION AND CLOSURE REPORT

RANKING SCORE (TOTAL POINTS): 8

Date Remediation Started: 6/3/97 Dated Completed: 6/3/97

Remediation Method: Excavation Approx. cubic yards
(Check all appropriate sections) Landfarmed Insitu Bioremediation
Other No action required

Remediation Location: Onsite Offsite
(ie. landfarmed onsite, and location of site facility)

General Description Of Remedial Action: No Action Required

Ground Water Encountered: No ✓ Yes Depth


Final Pit: Sample location mid-pit bottom
Closure Sampling:
(if multiple samples, attach sample results and diagram of sample locations and depths) Sample depth 6'
Sample date 6/3/97 Sample time 1440

Sample Results
Benzene(ppm) ND
Total BTEX(ppm) 0
Field headspace(ppm) 17
TPH ND

Ground Water Sample: Yes No ✓ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF
DATE 8/10/00
SIGNATURE Donald L. Johnson PRINTED NAME DONALD L. Johnson
AND TITLE Operations Manager

Revised 4/17/97



This lease is subject to the site security plan for the Blanco gas field. The plan is located at:
Koch Exploration Co.
610 S. Main
Aztec, New Mexico

KOCH

6/3/97

Lambe 2A

No apparent contamination.
Pit now used as secondary containment for a fiberglass steel tank.

PID in Pit

<u>Location</u>	<u>Conc. (ppm)</u>	<u>Remarks</u>
Mid pit 6' deep	0.0	Sand
W Bank 4' deep	0.0	"
N " " "	0.0	"
S " " "	0.0	"
E " " "	0.0	"

Head Space Sample

<u>Location</u>	<u>Conc. (ppm)</u>	<u>Remarks</u>
Mid pit 6' deep	17	Sand Lab Samp No: Lambe 2A-102

No surface water w/i 1000'

OFF: (505) 325-5667



LAB: (505) 325-1556

ANALYTICAL REPORT

Attn: *Shawn Adams*
Company: *Contract Environmental Services, Inc.*
Address: *P.O. Box 3376*
City, State: *Farmington, NM 87499*

Date: *10-Jun-97*
COC No.: *6391*
Sample No.: *14815*
Job No.: *2-1000*

Project Name: *Koch Exploration - Lamb 2A*
Project Location: *LAMB2A-102; Mid pit 6' deep*
Sampled by: *DGM* Date: *3-Jun-97* Time: *14:40*
Analyzed by: *HR* Date: *6-Jun-97*
Sample Matrix: *Soil*

Laboratory Analysis

Parameter	Results as Received	Limit of Quantitation	Unit of Measure	Method
<i>Total Petroleum Hydrocarbons, TPH</i>	<i>ND</i>	<i>25</i>	<i>mg/kg</i>	<i>EPA Method 418.1</i>

ND - Not Detected at Limit of Quantitation

Quality Assurance Report

Laboratory Fortified Blank/Spike Soil

Laboratory Identification	Analyzed Value	Acceptable Range	Unit of Measure
<i>Laboratory Fortified Blank Soil - QCBS2</i>	<i>< 25</i>	<i>< 25</i>	<i>mg/kg</i>
<i>Laboratory Fortified Spike Soil - QCSS1</i>	<i>870</i>	<i>828 - 1024</i>	<i>mg/kg</i>

Duplication

Laboratory Identification	% RSD	Limit % RSD
<i>14813-6391</i>	<i>< LOQ</i>	<i>15.0</i>

Approved by:

Date:

[Signature]
6/10/97

P.O. BOX 2606 • FARMINGTON, NM 87499

- TECHNOLOGY BLENDING INDUSTRY WITH THE ENVIRONMENT -

OFF: (505) 325-5667



LAB: (505) 325-1556

ANALYTICAL REPORT

Attn: *Shawn Adams*
Company: *Contract Environmental Services, Inc.*
Address: *P.O. Box 3376*
City, State: *Farmington, NM 87499*

Date: *10-Jun-97*
COC No.: *6391*
Sample No.: *14815*
Job No.: *2-1000*

Project Name: *Koch Exploration - Lambe 2A*
Project Location: *LAMB2A-102; (Mid Pit 6' deep)*
Sampled by: *DGM* Date: *3-Jun-97* Time: *14:40*
Analyzed by: *HR* Date: *5-Jun-97*
Sample Matrix: *Soil*

Laboratory Analysis

Parameter	Results as Received	Unit of Measure	Limit of Quantitation	Unit of Measure
<i>Benzene</i>	<i>ND</i>	<i>ug/kg</i>	<i>1</i>	<i>ug/kg</i>
<i>Toluene</i>	<i>ND</i>	<i>ug/kg</i>	<i>1</i>	<i>ug/kg</i>
<i>Ethylbenzene</i>	<i>ND</i>	<i>ug/kg</i>	<i>1</i>	<i>ug/kg</i>
<i>m,p-Xylene</i>	<i>1</i>	<i>ug/kg</i>	<i>1</i>	<i>ug/kg</i>
<i>o-Xylene</i>	<i>ND</i>	<i>ug/kg</i>	<i>1</i>	<i>ug/kg</i>
<i>TOTAL</i>	<i>1</i>	<i>ug/kg</i>		

ND - Not Detected at Limit of Quantitation

Method - SW-846 EPA Method 8020A Aromatic Volatile Organics by Gas Chromatography

Approved by: *[Signature]*
Date: *6/10/97*

P.O. BOX 2606 • FARMINGTON, NM 87499

TECHNOLOGY BLENDING INDUSTRY WITH THE ENVIRONMENT

CHAIN OF CUSTODY, RECORD

16391

6397

Date:

Page 1 of 1

657 W. Maple • P. O. Box 2606 • Farmington NM 87499
LAB: (505) 325-5667 • FAX: (505) 325-6256

Purchase Order No.:		Job No.	
Name: Don Johnson		Title:	
Company: KOCH Exploration Co.		Company: Contract Environmental Services, Inc.	
Address: PO Box 489		Mailing Address: P.O. Box 3376	
City, State, Zip: Actec, NM		City, State, Zip: Farmington, NM	
Telephone No.:		Telephone No.:	
Telefax No.:		Telefax No.:	

REPORT RESULTS TO				Name: Shawn Adams			
Number of Containers				Title:			
ANALYSIS REQUESTED				Company: Contract Environmental Services, Inc.			
Mailing Address: P.O. Box 3376				Mailing Address: P.O. Box 3376			
City, State, Zip: Farmington, NM				City, State, Zip: Farmington, NM			
Telephone No.:				Telephone No.:			
Telefax No.:				Telefax No.:			

SAMPLE IDENTIFICATION	SAMPLE		MATRIX	PRES.	Containers	LAB ID
	DATE	TIME				
Lamb 3-100 (mid-pit 10' deep)	6/3/17	0815	Soil	NAC	1	✓
Lamb 3-101 (east bank 17' deep)	6/3/17	1100	"	"	1	✓
Lamb 2A-102 (mid-pit 6' deep)	6/3/17	1440	"	"	1	✓
✓ SAMPLE CONTAINER ✓ SAMPLE LABEL - 101 & 102 ✓ ANALYSIS REQUESTED ✓ ANALYSIS REQUESTED						

Relinquished by: [Signature]	Date: 6/3/17/1000	Received by: [Signature]	Date: 6/3/17/1000
Relinquished by:	Date Time	Received by:	Date Time
Relinquished by:	Date Time	Received by:	Date Time

Method of Shipment:	24-48 Hours	10 Working Days	Special Instructions:
Authorized by: [Signature]	Rush	24 hr TAT	Special Instructions:
(Client Signature Must Accompany Request)			