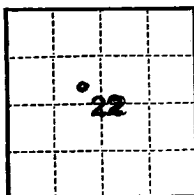


(SUBMIT IN TRIPLICATE)

Indian Agency NavajoChimney Rock Prospect

Allottee \_\_\_\_\_

Lease No. I-149-Ind-7652UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

## SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 7, 1956

Well No. 1 is located 2000 ft. from N line and 2380 ft. from EX line of sec. 22

SE NW 4 of 22 T-31-N R-17-W NMPM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Wildcat San Juan County New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the ~~surface~~ <sup>ground</sup> above sea level is 5242 ft.

## DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Reynolds Mining Corporation cemented seven joints, 251.16 feet, of 13 3/8-inch, H-40, 48 pound surface casing at 265.56 feet, kelly bushing which is 11.65 feet above ground level, with 290 sacks of four percent cement. The pump and plug method was utilized and a guide shoe was welded to the bottom casing joint. A surface pressure of 200 psi was held on casing for 12 hours and after allowing cement to set for 24 hours, the casing was tested with 1000 psi for 30 minutes - pressure held. Test conducted on November 30, 1956.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Reynolds Mining Corporation  
Oil and Gas Division  
 Address 152 1/2 East Ninth Street  
Post Office Box 1328  
Durango, Colorado

901COPY Original Signed By C. J. Eskridge, Jr.By C. J. Eskridge, Jr.Title District Petroleum Engineer