

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency Ute
Mountain Tribal
Allottee EPNG Co.
Lease No. 14-20-151-44

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 6, 1963

Well No. 2 is located 1080 ft. from N line and 1050 ft. from W line of sec. 14

SE-MW-14 31N 15W NMPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Verde San Juan NEW MEXICO
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5632 KB ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Plugged as follows:

From	To	Length Plug	Sacks Cement	Remarks
1970	1865	105	11	Covers prod. zone and up 50' into 5"
1460	1360	100	10	Over stub of 5"-50'in & 50' out
765	665	100	21	50' above and 50' below top of Mancos
156	106	50	16	Over shoe of 8 5/8"-26' in & 25' out
Surface				With appropriate marker

I understand that this plan of work must receive approval in writing by the Geological Survey before operation may be commenced.


Company E.M. CARROLL PRODUCTION COMPANY

Address P.O. BOX 838

Farmington, N.M.

By R. Owen

Title R Owen, Manager

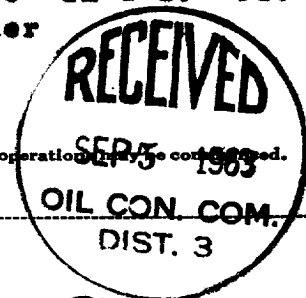

APPROVED

AUG 30 1963

E. A. SCHMIDT
ACTING DISTRICT ENGINEER

